



1839 Atchison Drive
 Norman
 OK
 USA

Encircle Hydro Full Report Norman Public Library - Central, 8.11.24

Policyholder

Name	Phone Number	Address
City Of Norman	--	103 West Acres Street, Norman, OK, USA

Claim Details

Carrier Identifier	Contractor Identifier	Assignment Identifier
Norman Public Library - Central, 8.11.24	--	--
Project Manager	Date of Loss	Date Claim Created
--	Aug 11, 2024	Aug 11, 2024
Insurance Company	Adjuster	Policy Number
--	--	--
Source of Loss	Initial Category of Water	
Rain water	Category 1	

Calculations

Dehumidifier Calculator




Atmosphere	Class of Water	Atmosphere Volume	Recommended AHAM Pints/Day
Stairway	Class 2	18000 ft ³	552 pints/day
Pioneer 305	Class 1	4528 ft ³	56 pints/day
3rd Floor Common Area	Class 1	60500 ft ³	989 pints/day
Research 314	Class 1	6073 ft ³	74 pints/day
2nd Floor Common Area	Class 1	23100 ft ³	283 pints/day
Staff Only 201A	Class 1	19223 ft ³	236 pints/day
Study Room 231	Class 1	1195 ft ³	15 pints/day
Staff Only 105	Class 1	9051 ft ³	101 pints/day
Childrens Area	Class 1	191625 ft ³	2135 pints/day
Staff Only 212	Class 1	5264 ft ³	65 pints/day
Study Room 233	Class 1	823 ft ³	10 pints/day

Air Mover Calculator




Area	Floor	Ceiling	Walls	Insets or Offsets	Recommended
Stairway	36 ft ²	0 ft ²	0 ft ²	0	2 air movers
Pioneer 305	23 ft ²	0 ft ²	0 ft ²	0	2 air movers
3rd Floor Common Area	60 ft ²	0 ft ²	0 ft ²	0	2 - 3 air movers
Research 314	30 ft ²	0 ft ²	0 ft ²	0	2 air movers
2nd Floor Common Area	193 ft ²	0 ft ²	0 ft ²	0	4 - 5 air movers

Area	Floor	Ceiling	Walls	Insets or Offsets	Recommended
Staff Only 201A	19 ft²	0 ft²	0 ft²	0	2 air movers
Study Room 231	5 ft²	0 ft²	0 ft²	0	2 air movers
Staff Only 115	10 ft²	0 ft²	12 ft²	0	2 air movers
Childrens Area	115 ft²	115 ft²	0 ft²	0	4 - 5 air movers
Staff Only 212	49 ft²	0 ft²	0 ft²	0	2 air movers
Study Room 233	5 ft²	0 ft²	0 ft²	0	2 air movers

Exterior

#	Time	Relative Humidity	Specific Humidity	Air Temperature	Notes & Photos
1	Aug 11, 6:43 PM	65.9%	116.6 gpp	84.2°F	
2	Aug 12, 5:03 PM	68.6%	119.1 gpp	83.6°F	
3	Aug 13, 1:00 PM	78.3%	116.2 gpp	78.8°F	

Unaffected Area Readings

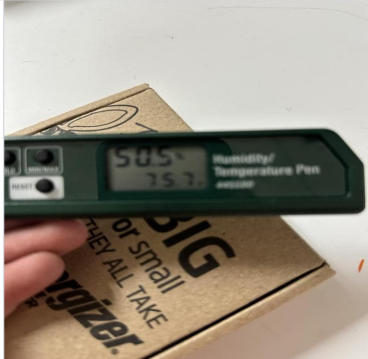
#	Time	Room	Relative Humidity	Specific Humidity	Air Temperature	Notes & Photos
1	Aug 11, 2:31 PM	1st floor common area	70.7%	100.8 gpp	77.7°F	
2	Aug 12, 2:02 PM	1st floor common area	61.2%	82.7 gpp	76.2°F	
3	Aug 13, 11:32 AM	1st floor common area	50.5%	67.3 gpp	75.9°F	

Unaffected Area HVAC Readings


#	Time	Room	Relative Humidity	Specific Humidity	Air Temperature	Notes & Photos
---	------	------	-------------------	-------------------	-----------------	----------------

Drying Chamber: Stairway


Affected Area Readings

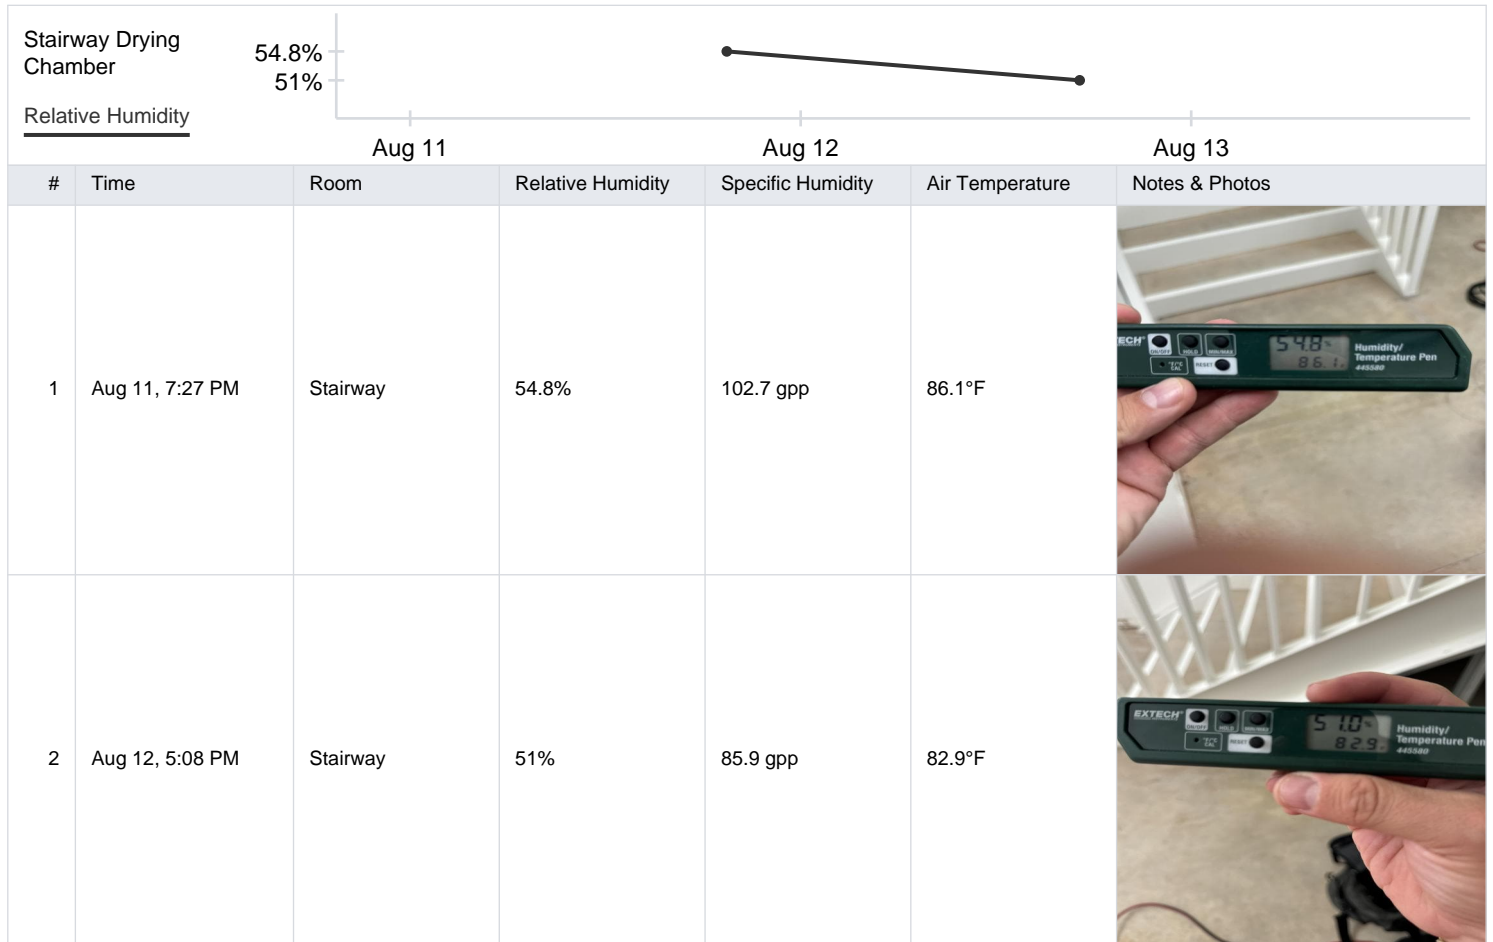


Affected Area: Stairway

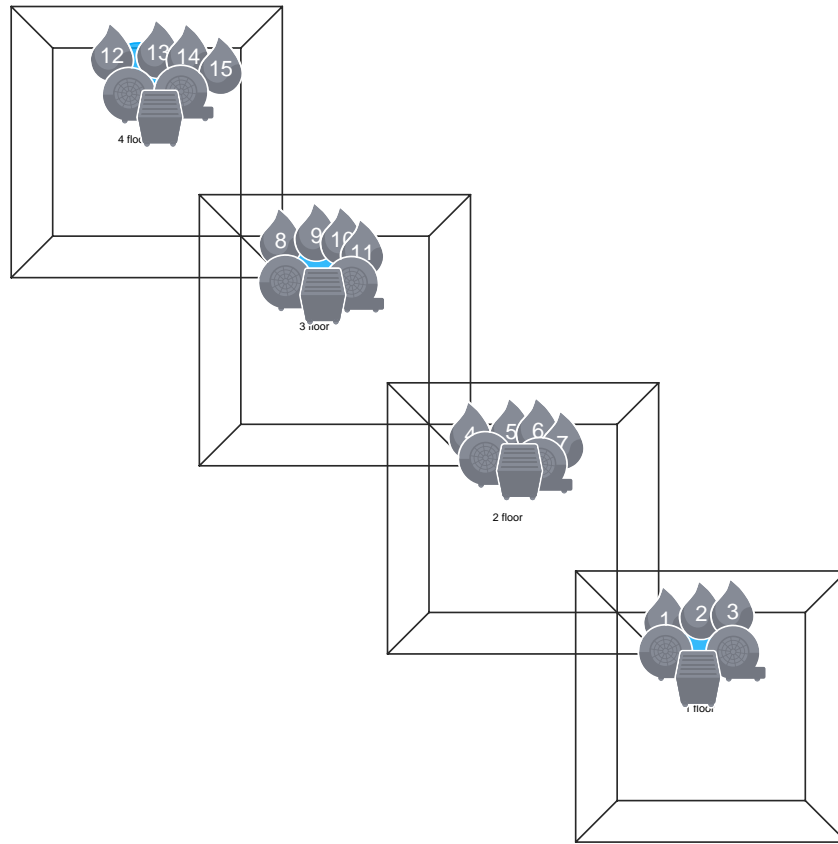


Point 1:

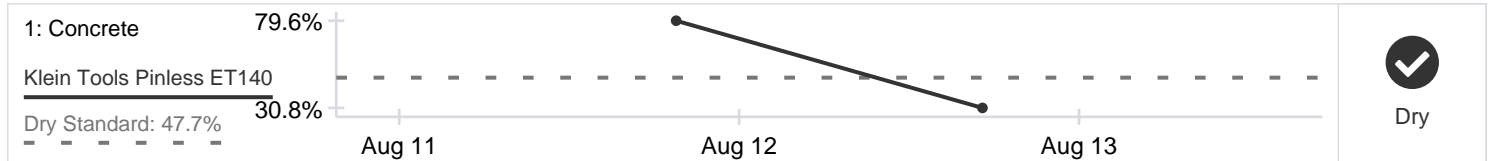



#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 7:33 PM	Klein Tools Pinless ET140	79.6%	76.1°F	


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 5:10 PM	Klein Tools Pinless ET140	30.8%	79.3°F	

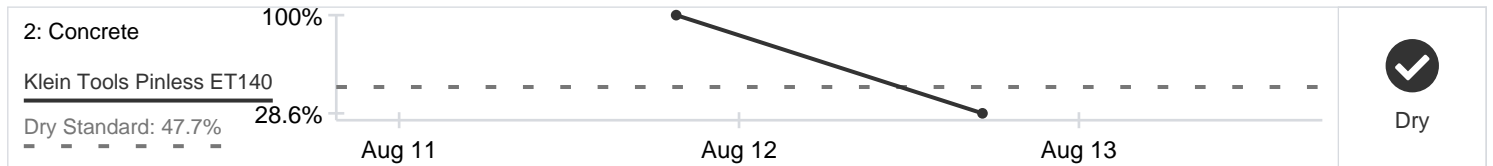Point 2:





#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 7:33 PM	Klein Tools Pinless ET140	100%	75.9°F	
2	Aug 12, 5:11 PM	Klein Tools Pinless ET140	28.6%	79.2°F	

Point 3:

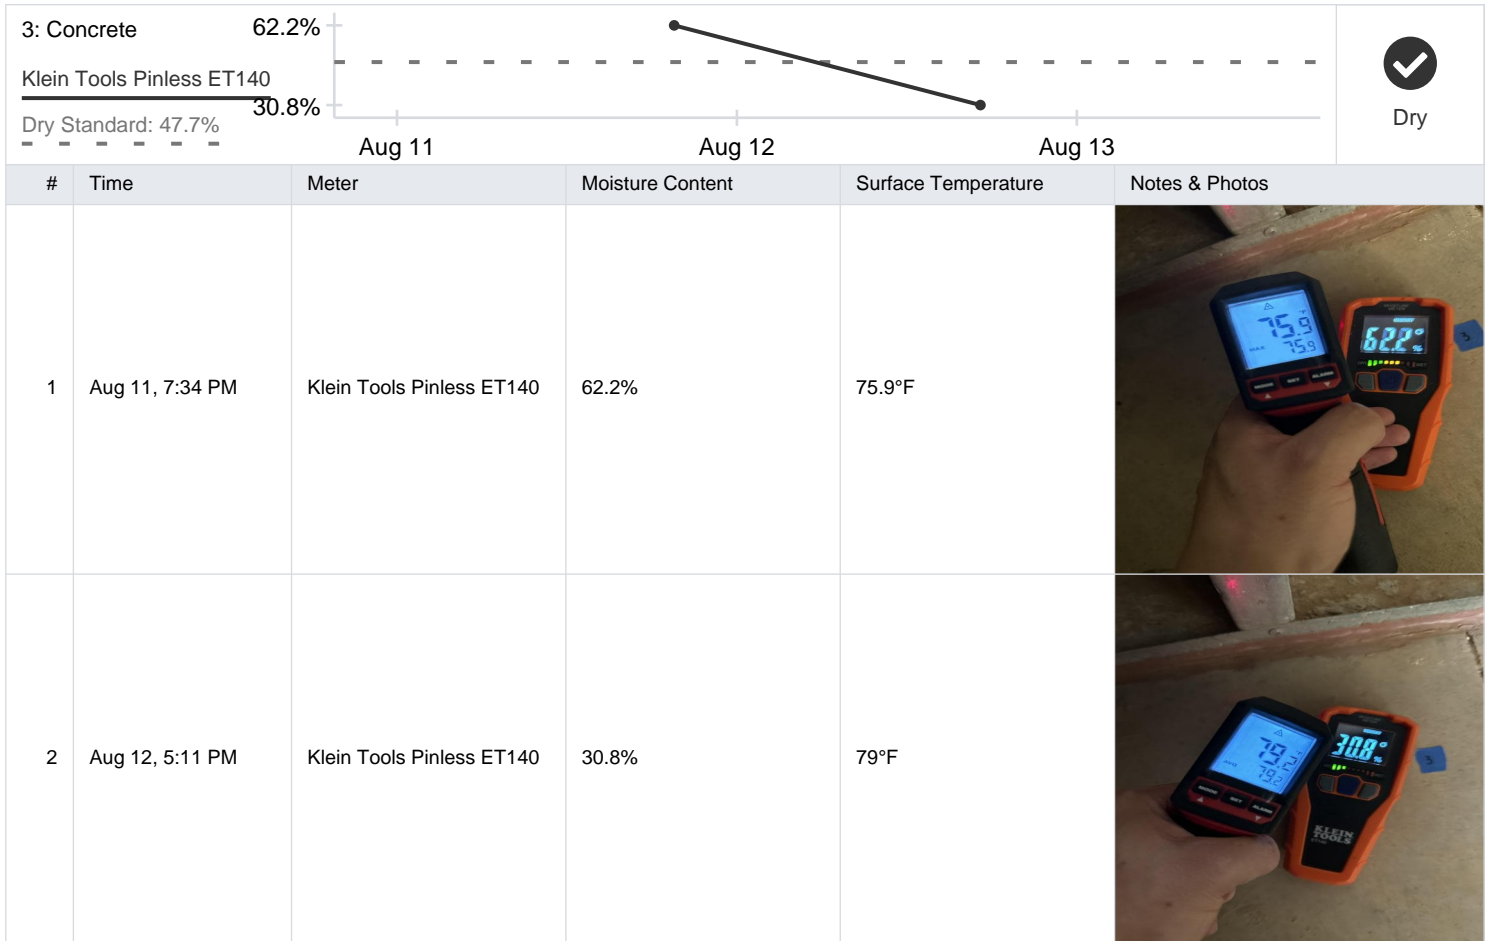


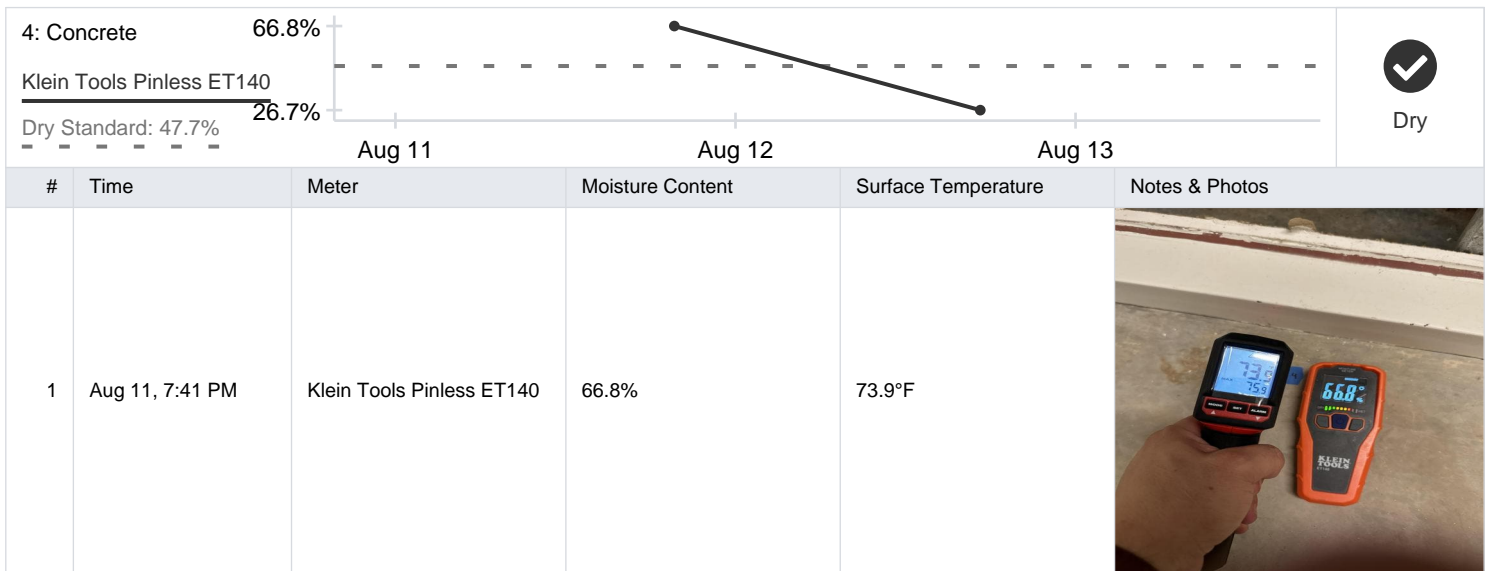

Point 4:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 5:16 PM	Klein Tools Pinless ET140	26.7%	83.7°F	

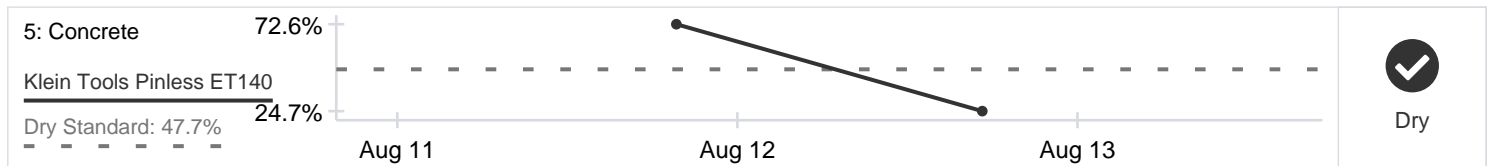Point 5:





#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 7:41 PM	Klein Tools Pinless ET140	72.6%	85.3°F	
2	Aug 12, 5:16 PM	Klein Tools Pinless ET140	24.7%	84.4°F	

Point 6:

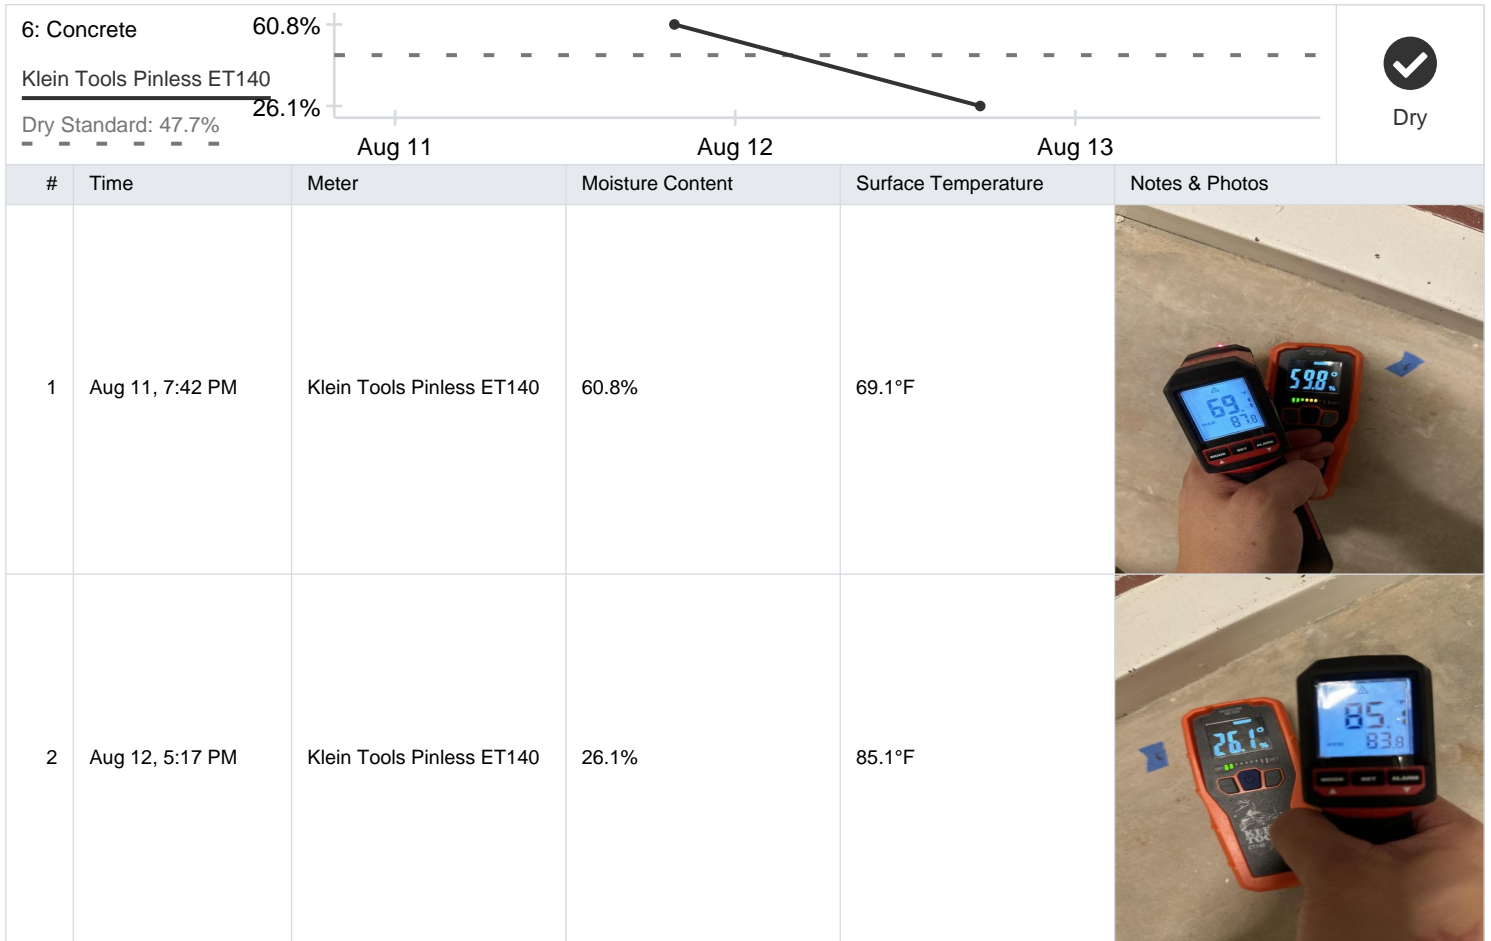




Point 7:

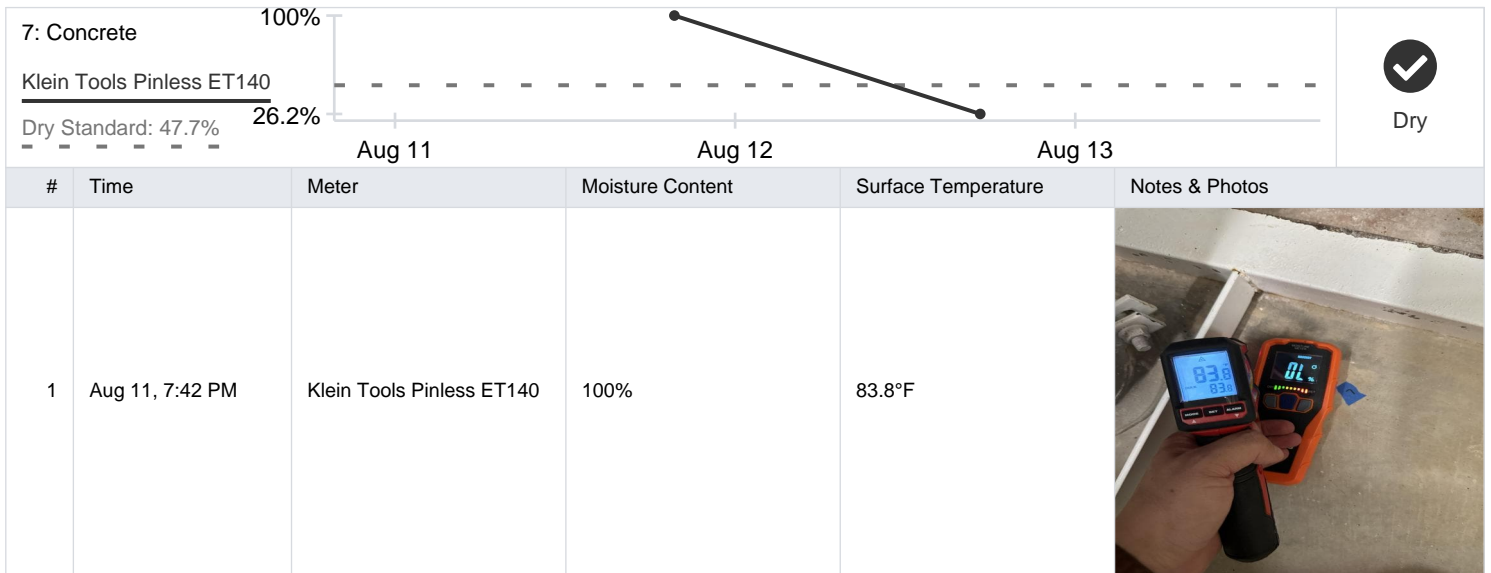


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 5:17 PM	Klein Tools Pinless ET140	26.2%	83.5°F	

Point 8:

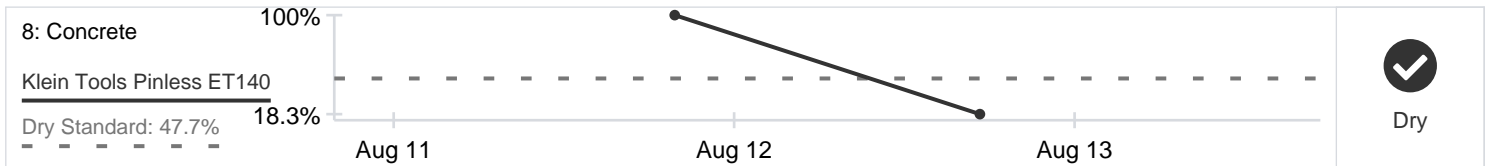


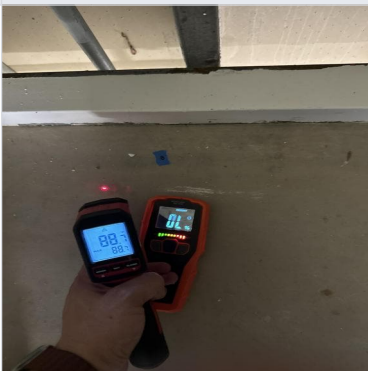
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 7:48 PM	Klein Tools Pinless ET140	100%	88.7°F	
2	Aug 12, 5:19 PM	Klein Tools Pinless ET140	18.3%	85.8°F	

Point 9:

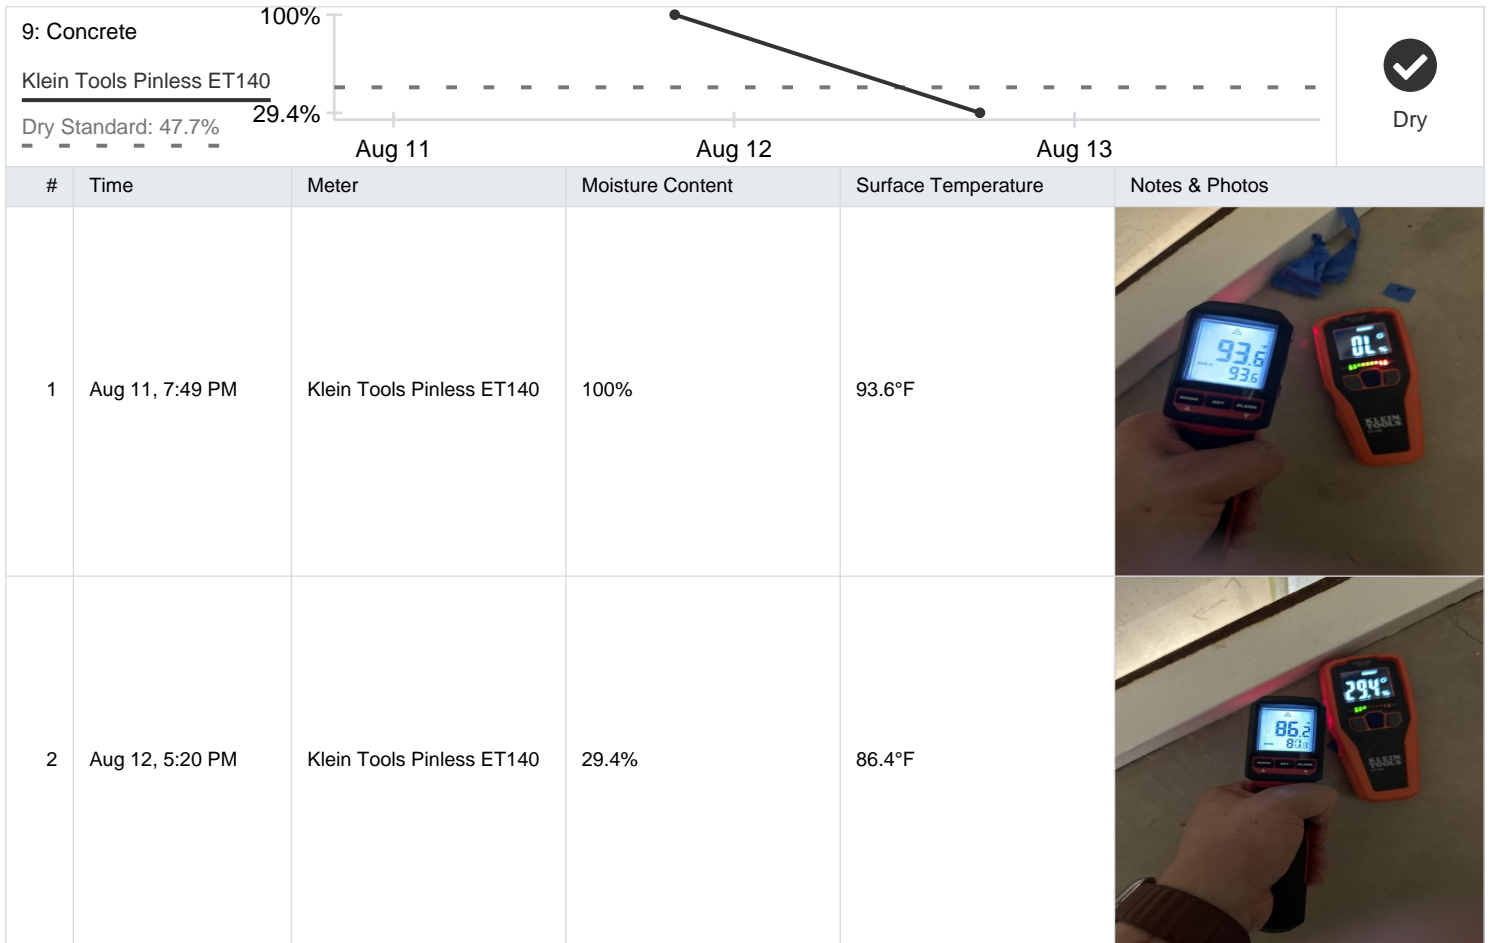


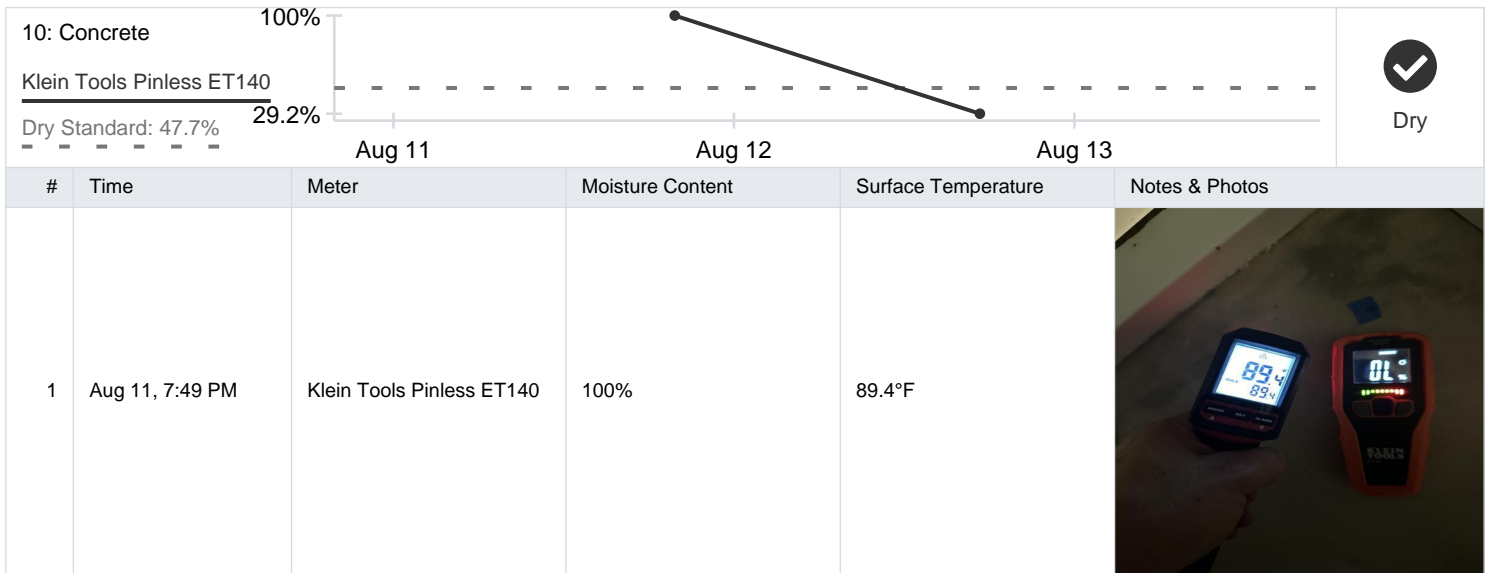

Point 10:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 5:20 PM	Klein Tools Pinless ET140	29.2%	52.3°F	

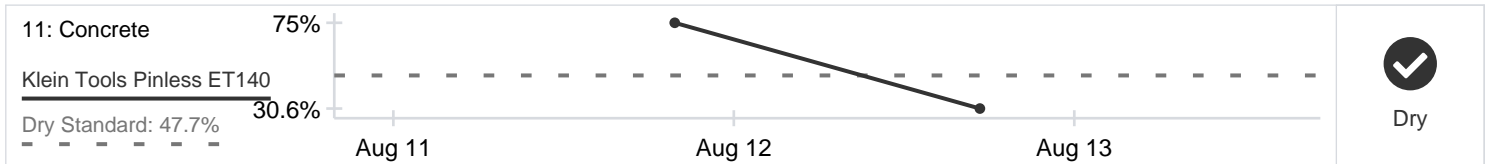Point 11:





#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 7:50 PM	Klein Tools Pinless ET140	75%	89.6°F	
2	Aug 12, 5:20 PM	Klein Tools Pinless ET140	30.6%	73.9°F	

Point 12:

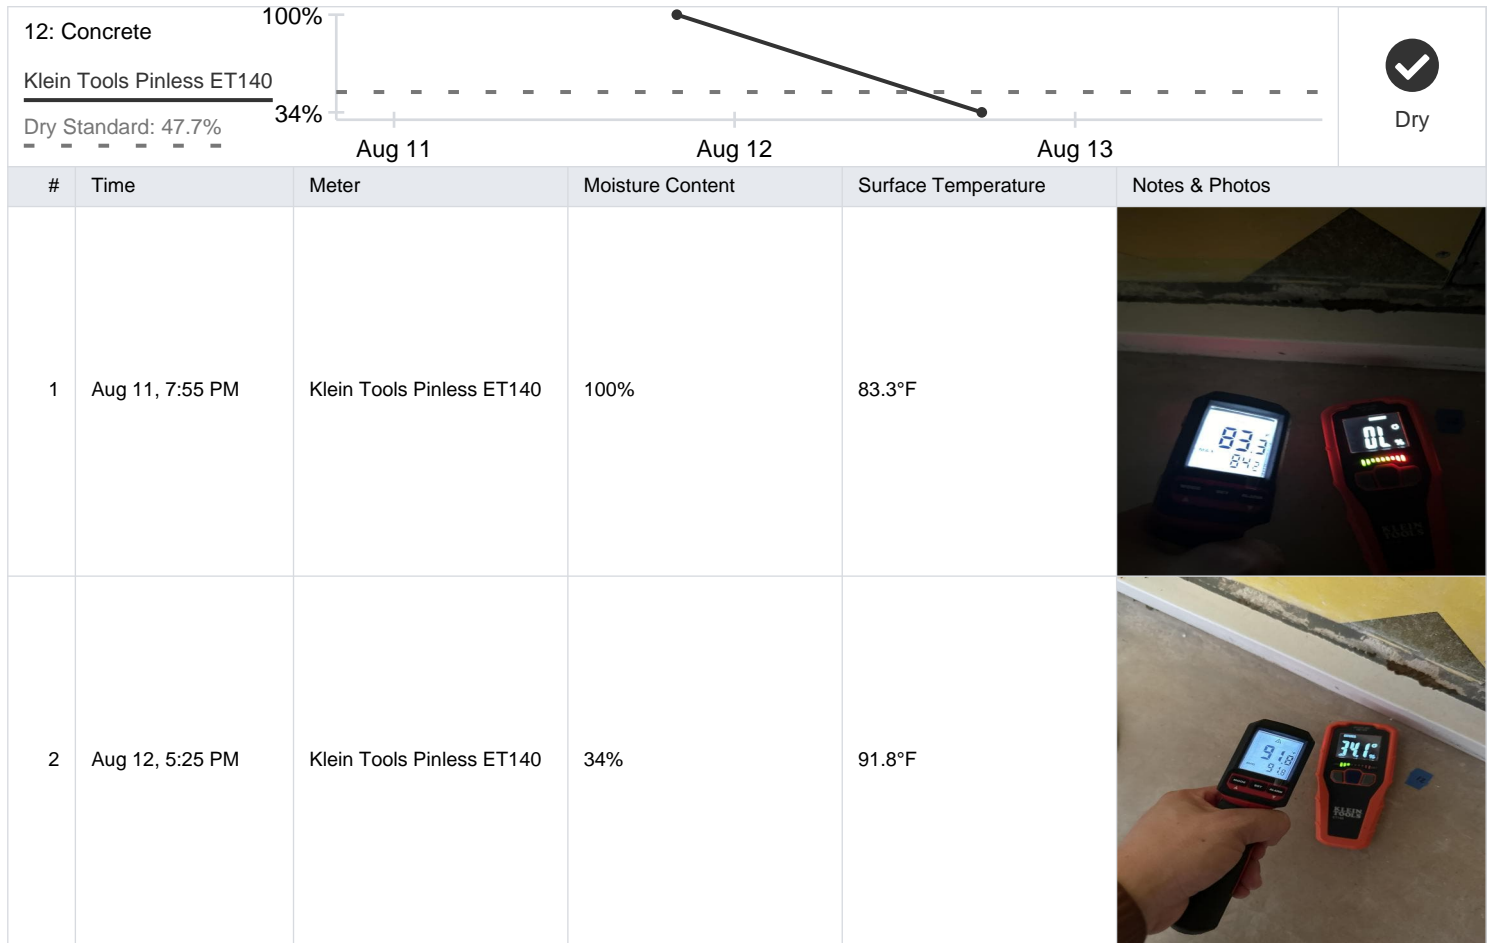


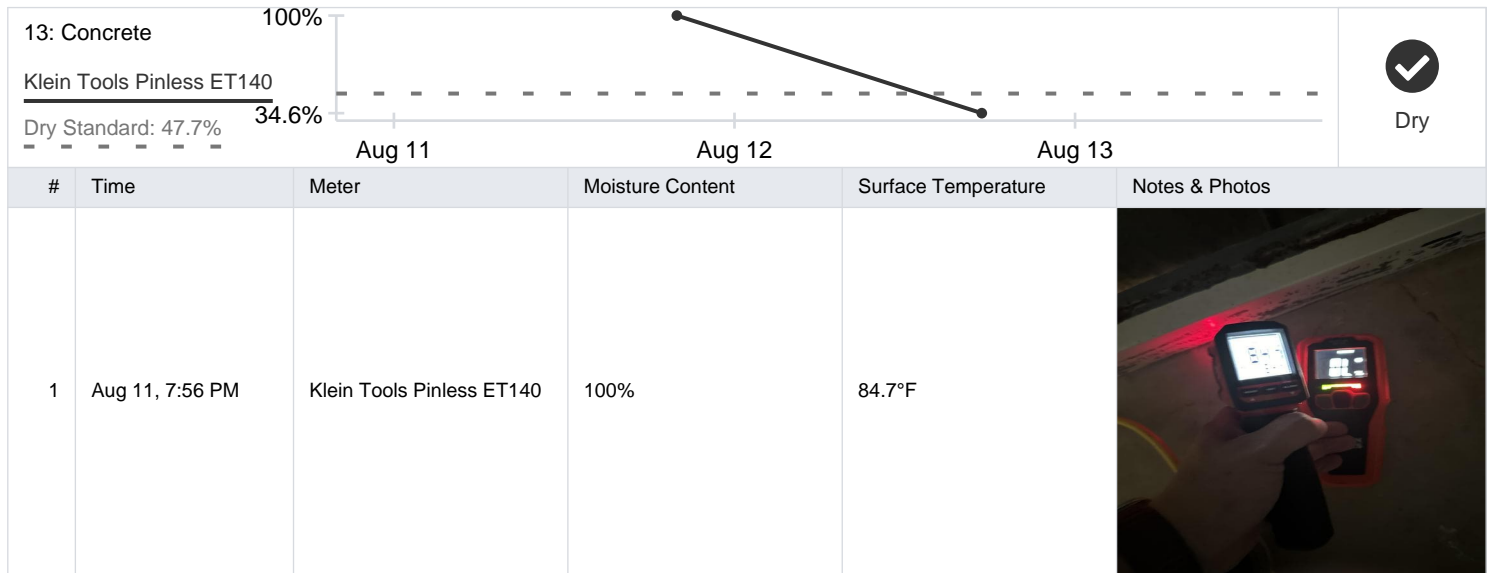

Point 13:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 5:25 PM	Klein Tools Pinless ET140	34.6%	92.8°F	

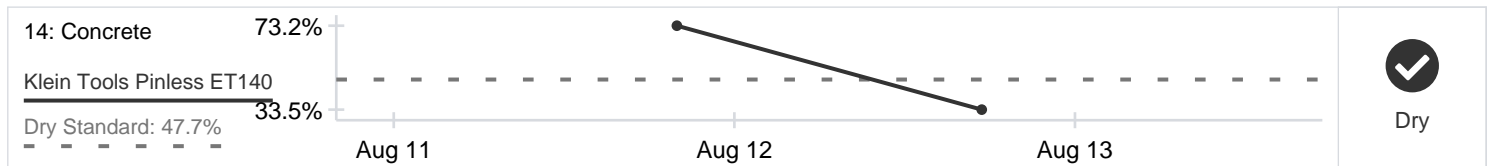Point 14:



#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 7:56 PM	Klein Tools Pinless ET140	73.2%	85.1°F	
2	Aug 12, 5:25 PM	Klein Tools Pinless ET140	33.5%	93°F	


Point 15:

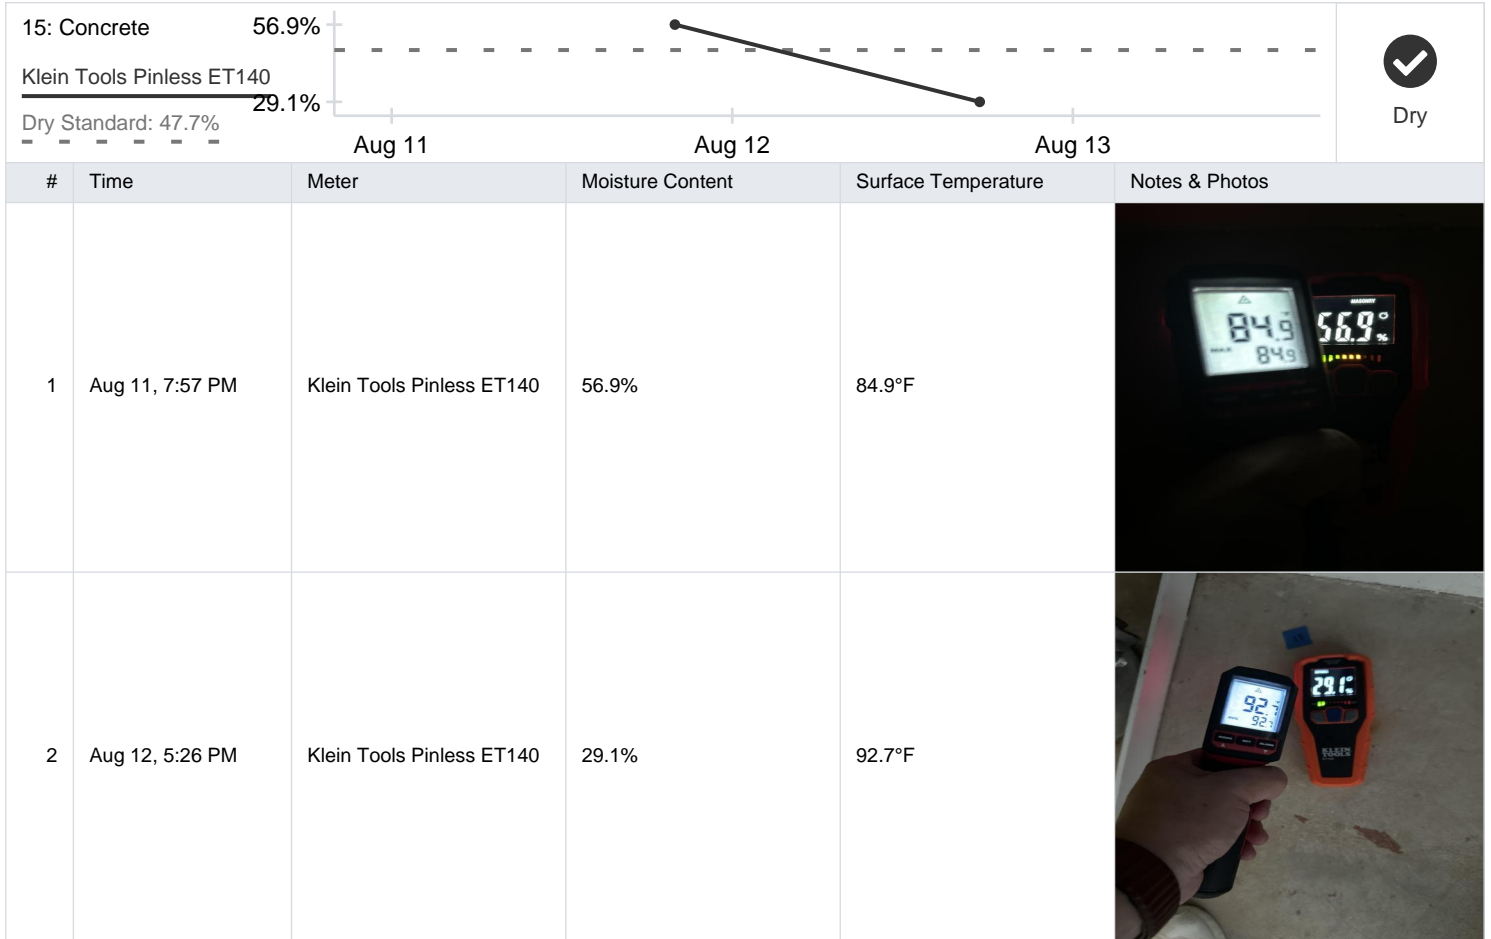


Equipment List: Stairway

Dehumidifier: Phoenix DryMax BLE [4038500] (66)


Placed Aug 11, 7:35 PM	Removed Still on site	Power 0.63 kW	Energy usage 53.33 kWh	Days on site 4 days
----------------------------------	---------------------------------	-------------------------	----------------------------------	-------------------------------

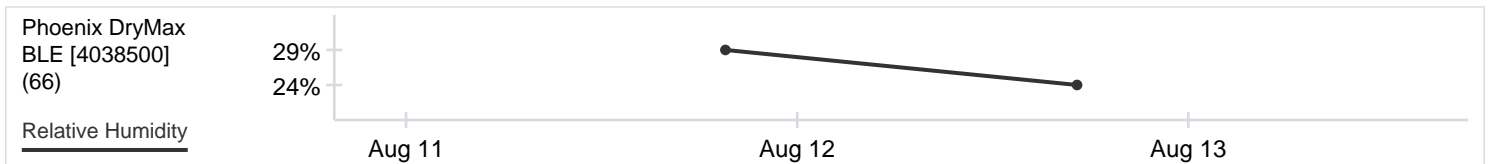


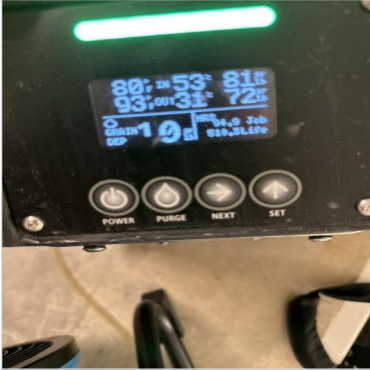
#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 7:35 PM	29%	80.7 gpp	99°F	22 gpp		
2	Aug 12, 5:10 PM	24%	64.6 gpp	98°F	21 gpp		

Dehumidifier: Phoenix DryMax BLE [4038500] (68)

Placed Aug 11, 7:43 PM Removed Still on site Power 0.63 kW Energy usage 53.24 kWh Days on site 4 days

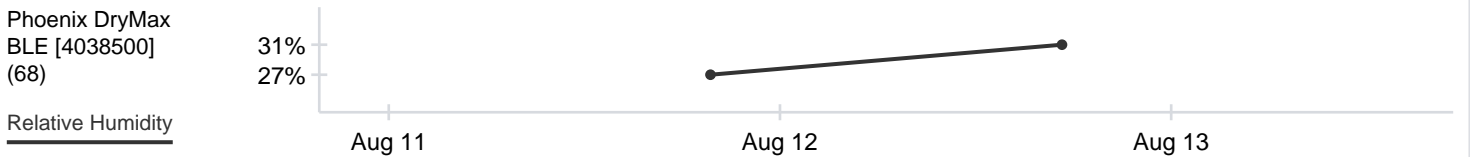



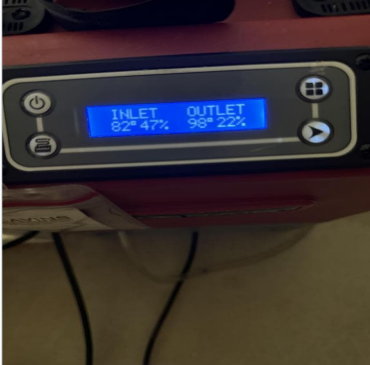
#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 7:44 PM	27%	77.4 gpp	100°F	25 gpp		

#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
2	Aug 12, 5:18 PM	31%	71.7 gpp	93°F	14 gpp		

Dehumidifier: ALORAIR Storm LGR Extreme [STORMLGREXTREME] (07)

Placed Aug 11, 7:51 PM Removed Still on site Power 0.64 kW Energy usage 54.60 kWh Days on site 4 days

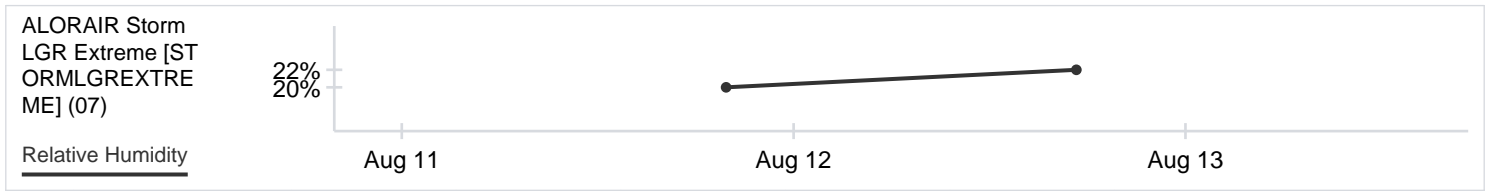


#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 7:51 PM	20%	64.4 gpp	104°F	38 gpp		
2	Aug 12, 5:19 PM	22%	59.1 gpp	98°F	27 gpp		



Dehumidifier: ALORAIR Storm LGR Extreme [STORMLGREXTREME] (08)

Placed Aug 11, 7:54 PM Removed Still on site Power 0.64 kW Energy usage 54.57 kWh Days on site 4 days

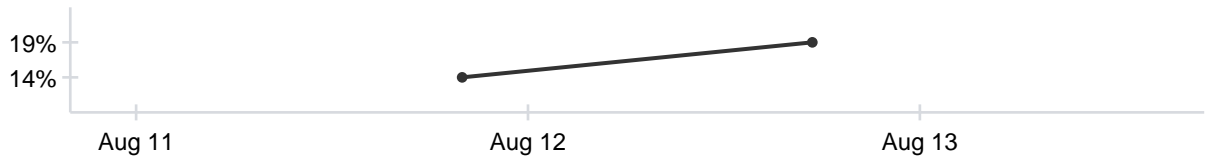ALORAIR Storm
LGR Extreme [ST
ORMLGREXTRE
ME] (08)



Relative Humidity


#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 7:58 PM	14%	55.2 gpp	111°F	47 gpp		
2	Aug 12, 5:24 PM	19%	66.9 gpp	107°F	19 gpp		

Air Movers: Stairway


Name	Placed	Removed	Energy usage	Days on site
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (24)	Aug 11, 7:34 PM	Aug 12, 9:42 AM	2.60 kWh	1 day
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (21)	Aug 11, 7:34 PM	Still on site	15.65 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (473)	Aug 11, 7:43 PM	Aug 11, 8:41 PM	0.18 kWh	1 day
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (50)	Aug 11, 7:43 PM	Still on site	15.62 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (455)	Aug 11, 7:50 PM	Aug 12, 10:20 PM	4.88 kWh	2 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (471)	Aug 11, 7:50 PM	Still on site	15.60 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (3)	Aug 11, 7:53 PM	Still on site	15.59 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (48)	Aug 11, 7:53 PM	Still on site	15.59 kWh	4 days

Drying Chamber: Pioneer 305


Affected Area Readings

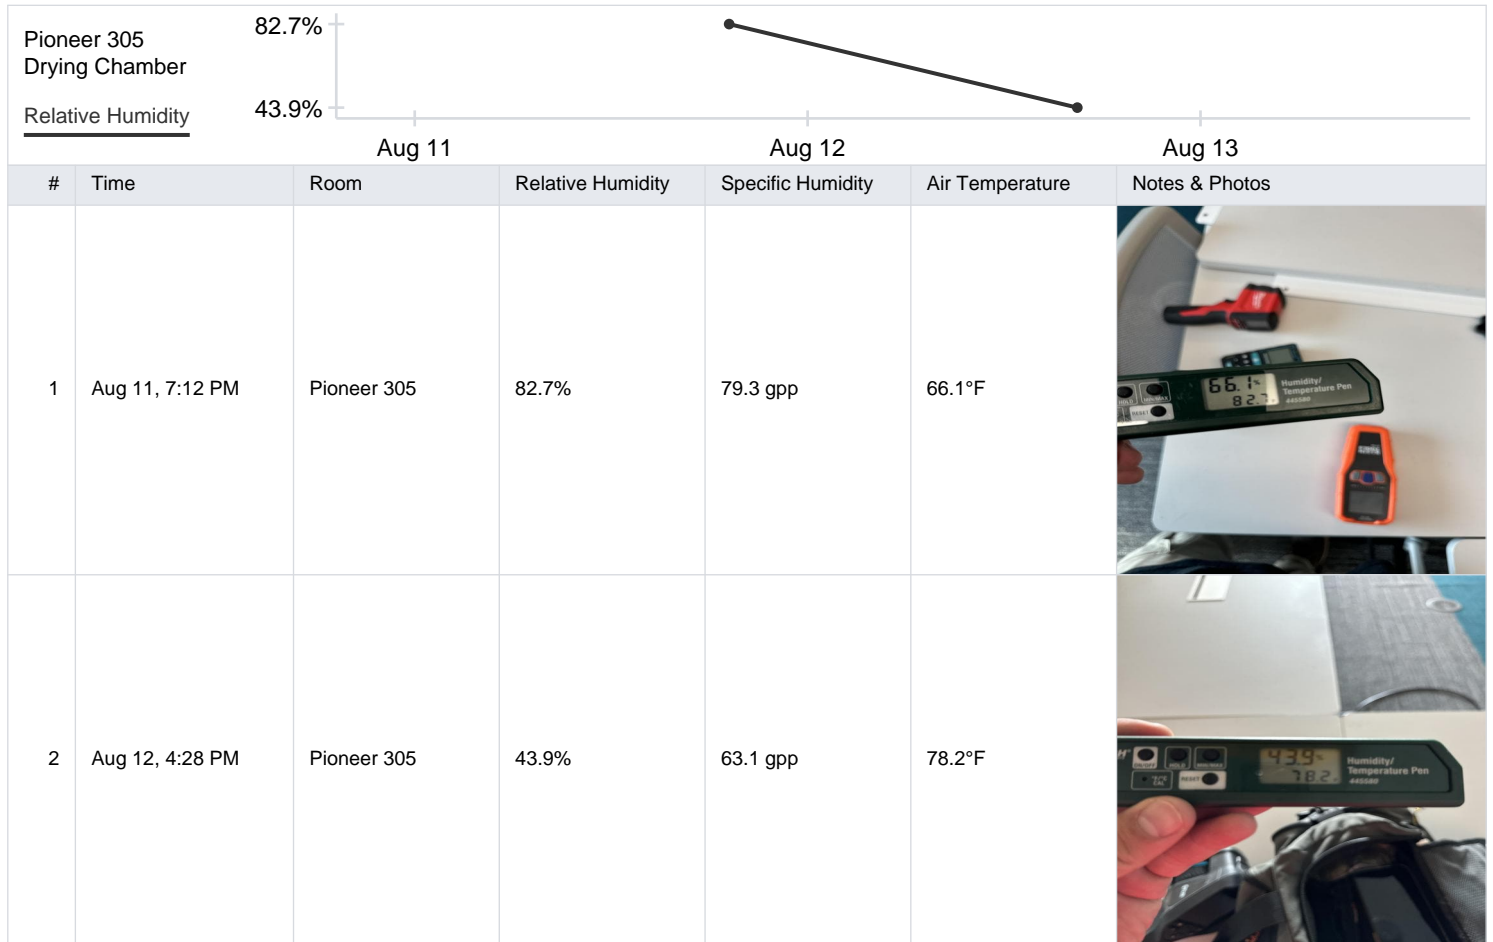

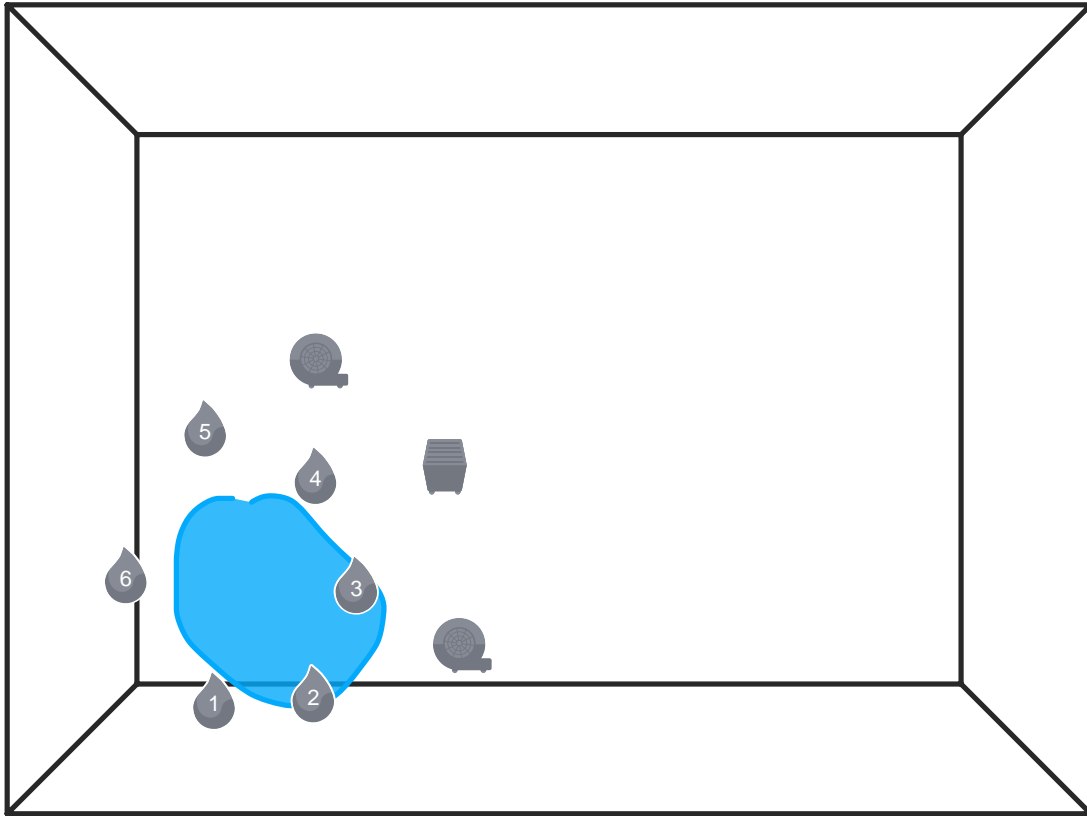

Affected Area: Pioneer 305

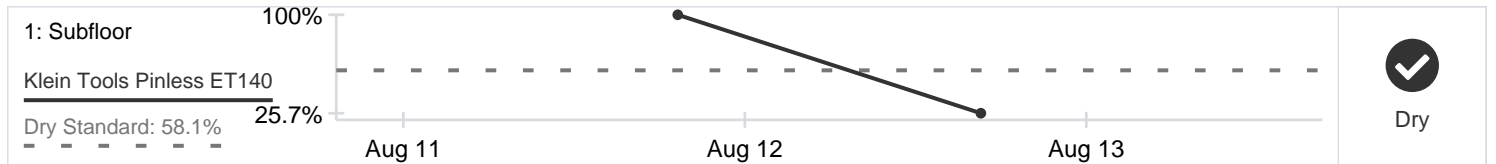


Point 1:





#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 7:17 PM	Klein Tools Pinless ET140	100%	82.4°F	


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 4:35 PM	Klein Tools Pinless ET140	25.7%	23°F	

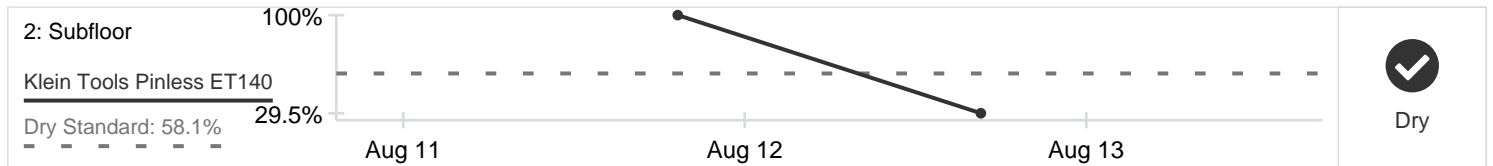Point 2:





#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 7:17 PM	Klein Tools Pinless ET140	100%	82.4°F	
2	Aug 12, 4:35 PM	Klein Tools Pinless ET140	29.5%	73.6°F	

Point 3:

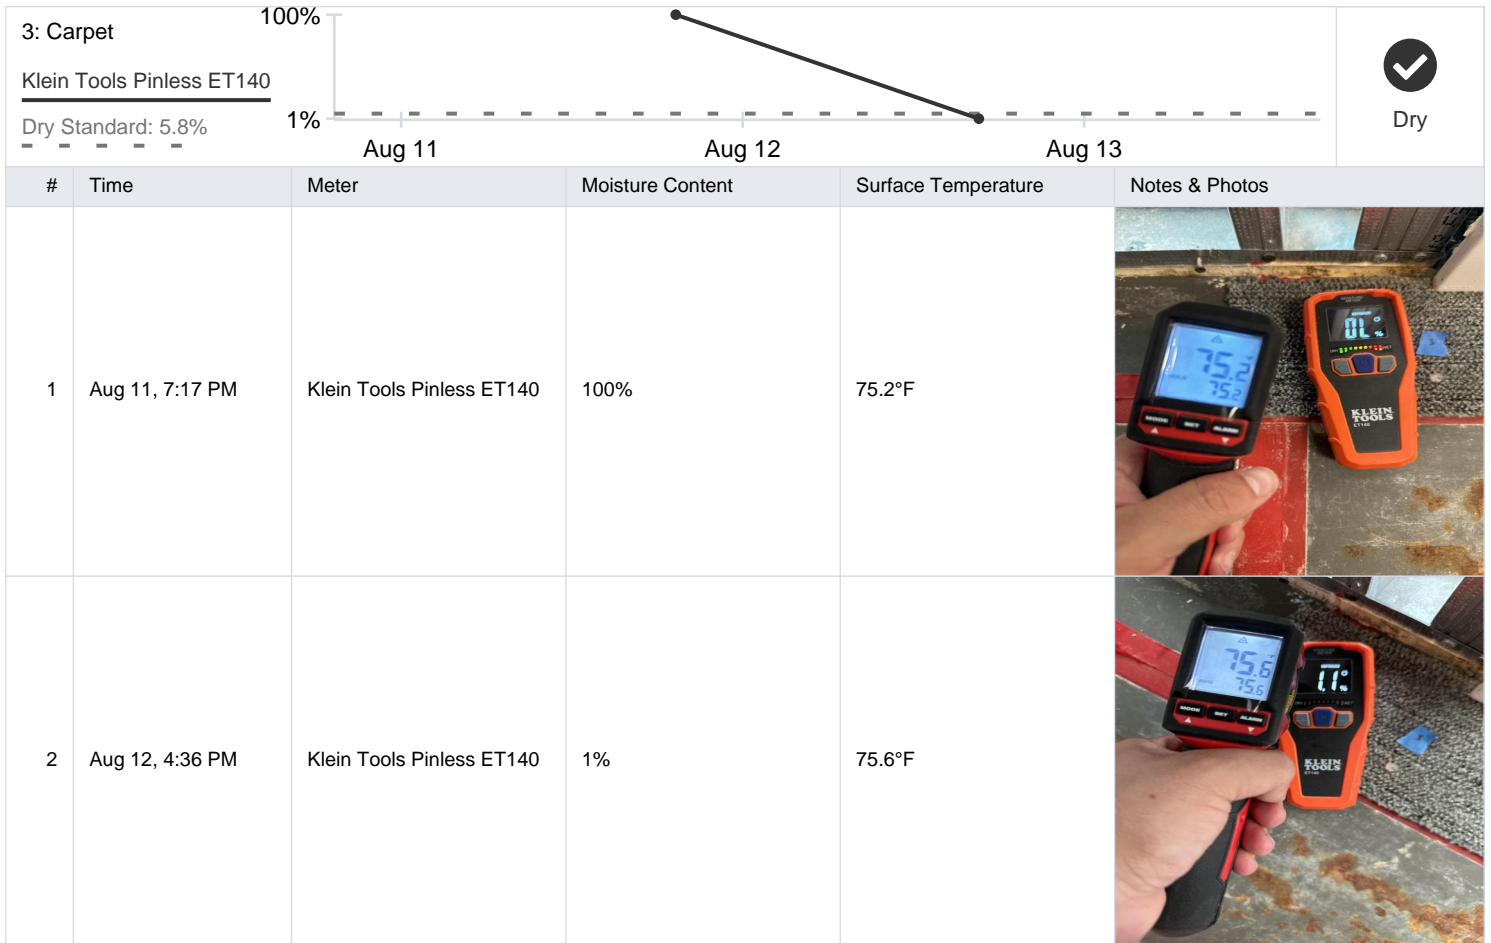


Point 4:

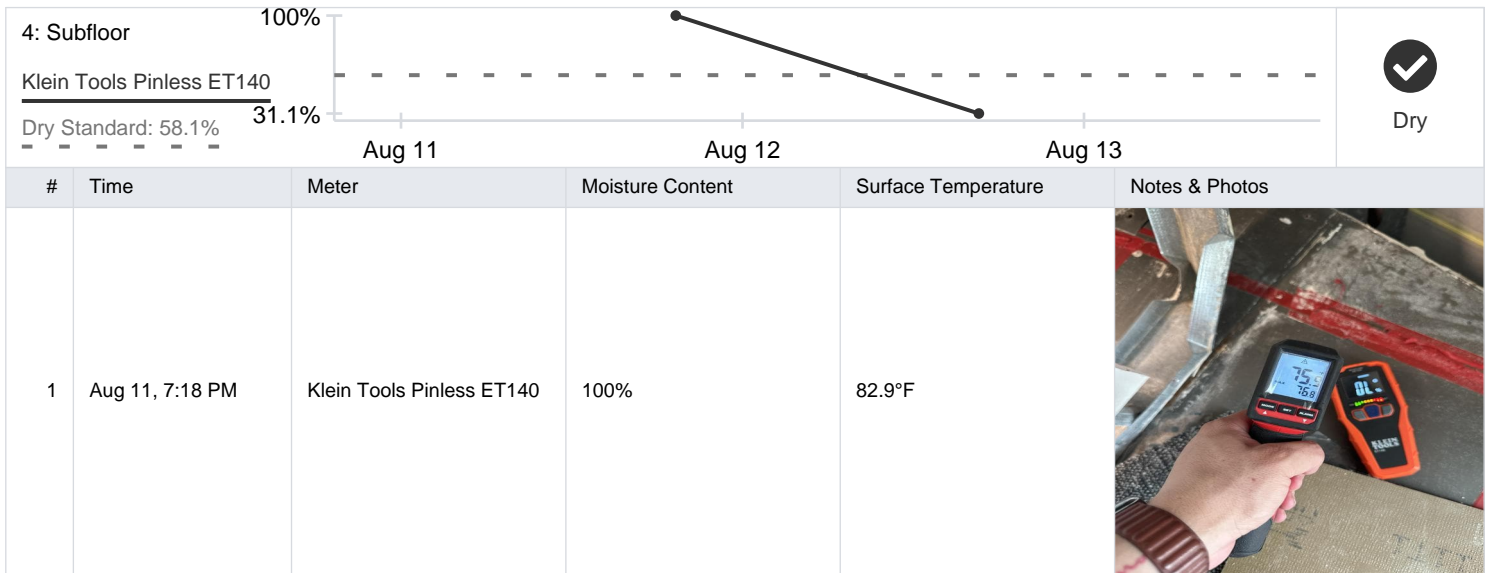

#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 4:36 PM	Klein Tools Pinless ET140	31.1%	75.4°F	

Point 5:

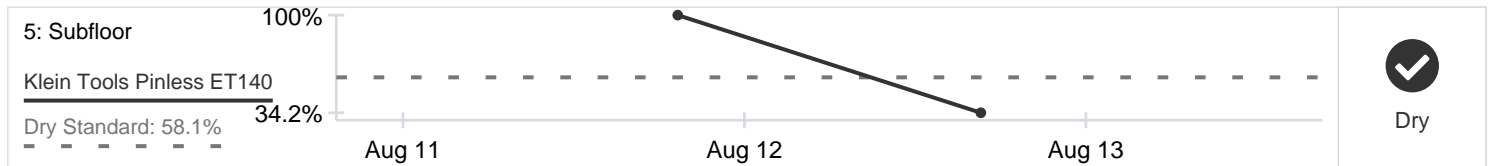


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 7:19 PM	Klein Tools Pinless ET140	100%	82.9°F	
2	Aug 12, 4:37 PM	Klein Tools Pinless ET140	34.2%	82.9°F	


Point 6:


6: Subfloor

Klein Tools Pinless ET140 55.7%

Dry Standard: 58.1%




Dry

#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 7:20 PM	Klein Tools Pinless ET140	55.7%	86.2°F	


Equipment List: Pioneer 305


Dehumidifier: ALORAIR Storm LGR Extreme [STORMLGREXTREME] (06)


Placed	Removed	Power	Energy usage	Days on site
Aug 11, 7:21 PM	Still on site	0.64 kW	54.92 kWh	4 days

ALORAIR Storm LGR Extreme [STORMLGREXTREME] (06)

Relative Humidity

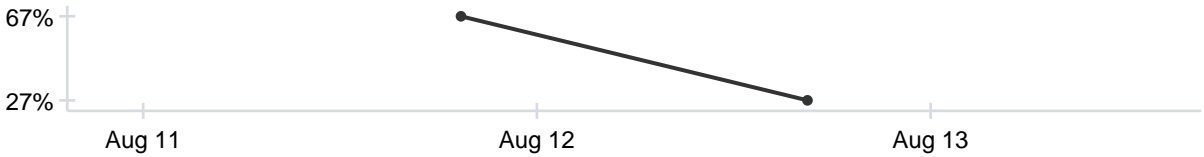

#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 7:22 PM	67%	125.8 gpp	86°F	-47 gpp		


#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
2	Aug 12, 4:29 PM	27%	58.5 gpp	91°F	5 gpp		


Air Movers: Pioneer 305

Name	Placed	Removed	Energy usage	Days on site
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (20)	Aug 11, 7:21 PM	Still on site	15.69 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (39)	Aug 11, 7:21 PM	Still on site	15.69 kWh	4 days


Drying Chamber: 3rd Floor Common Area

Affected Area Readings

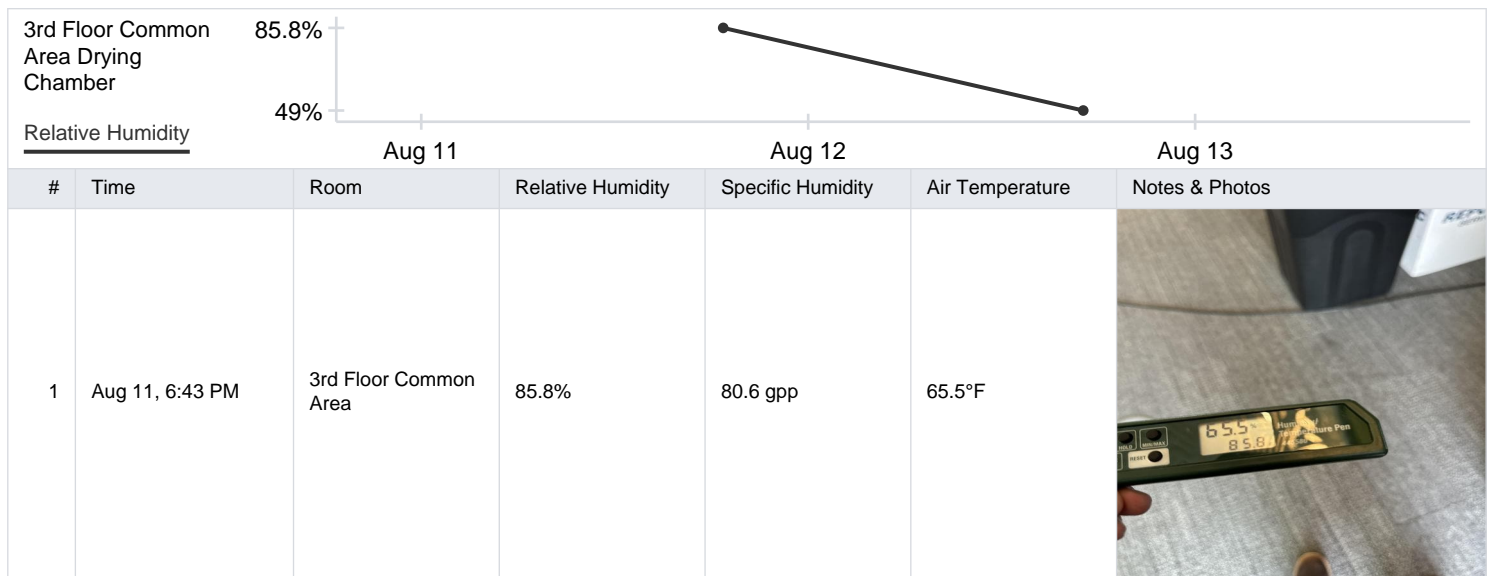


#	Time	Room	Relative Humidity	Specific Humidity	Air Temperature	Notes & Photos
2	Aug 12, 5:03 PM	3rd Floor Common Area	49%	86.4 gpp	84.3°F	


Affected Area: 3rd Floor Common Area

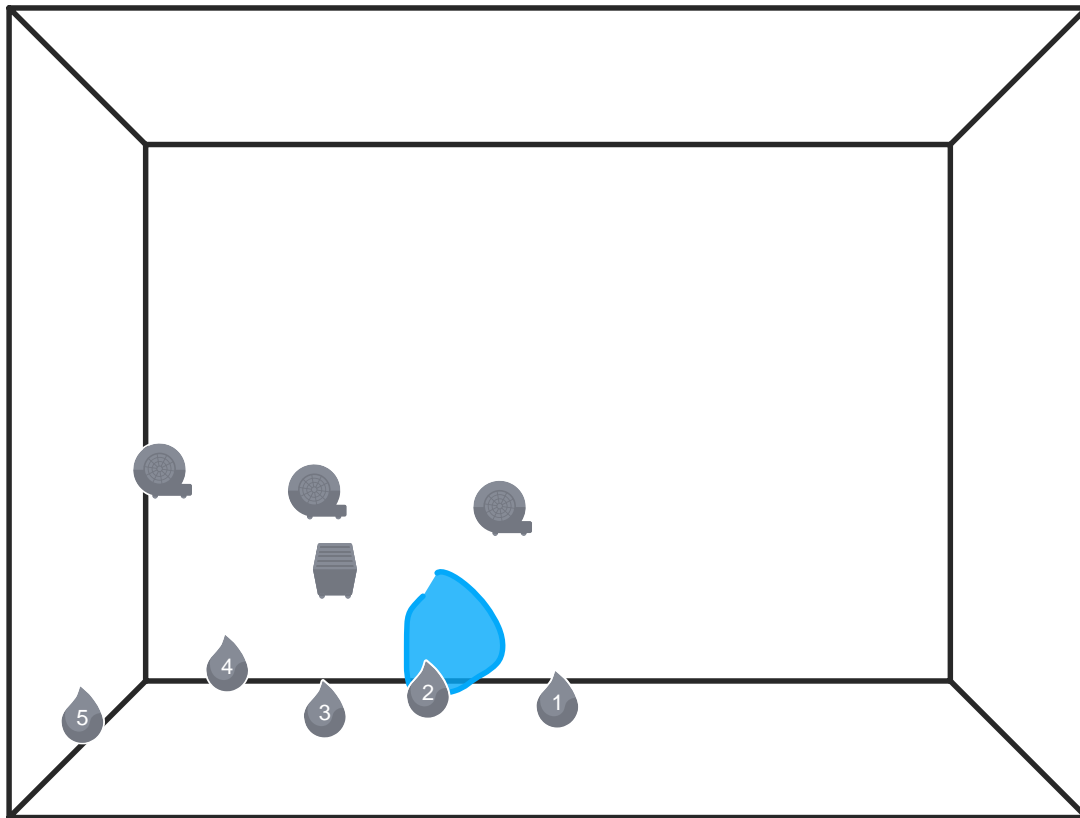


Point 1:

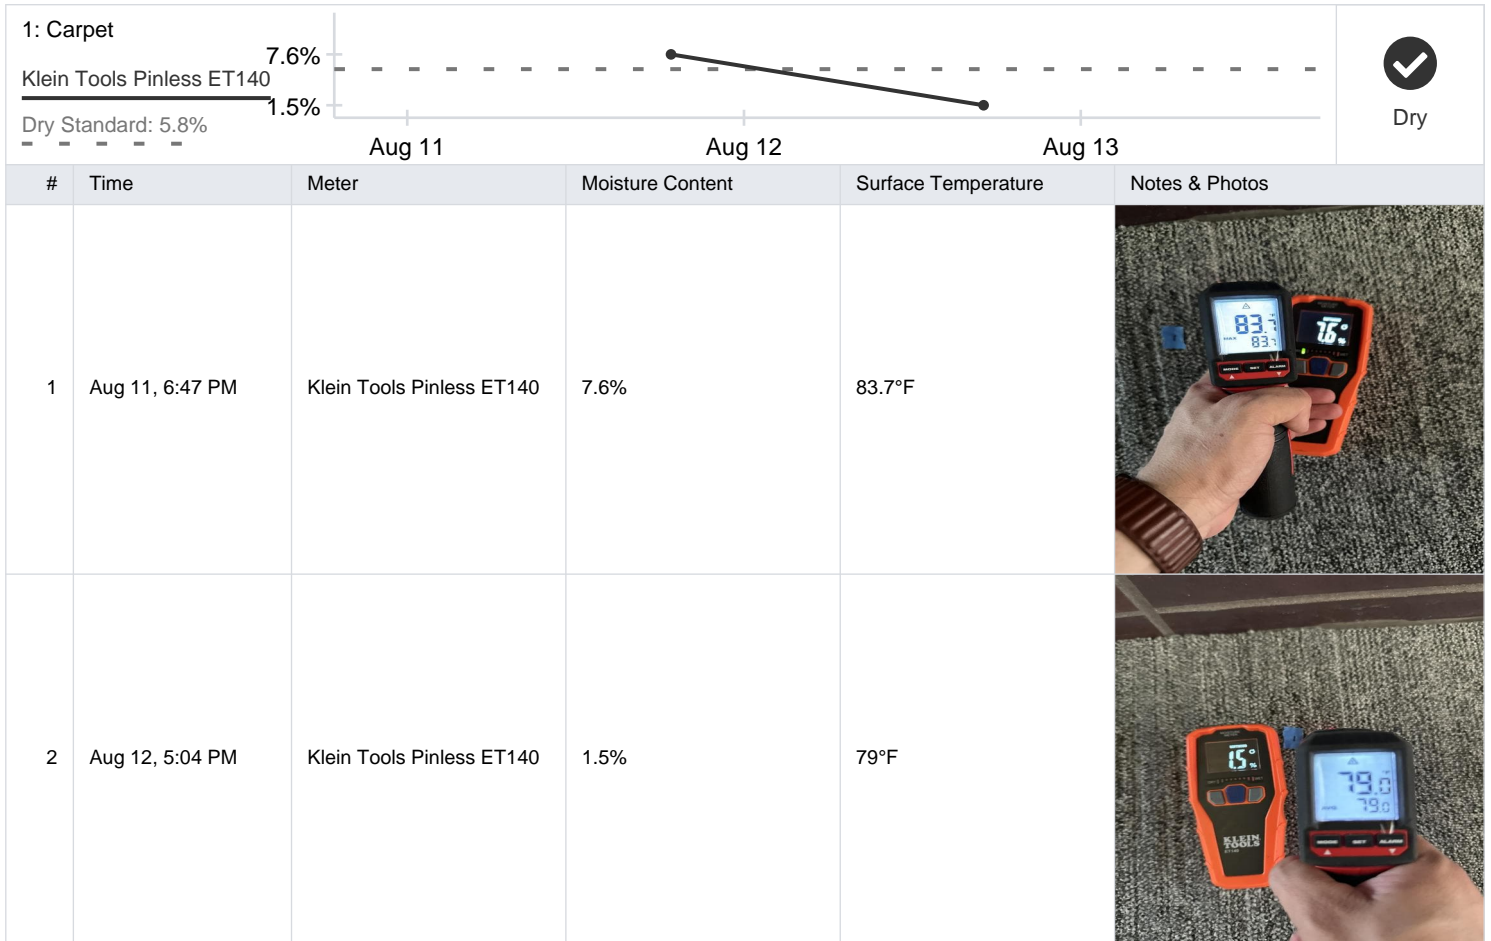


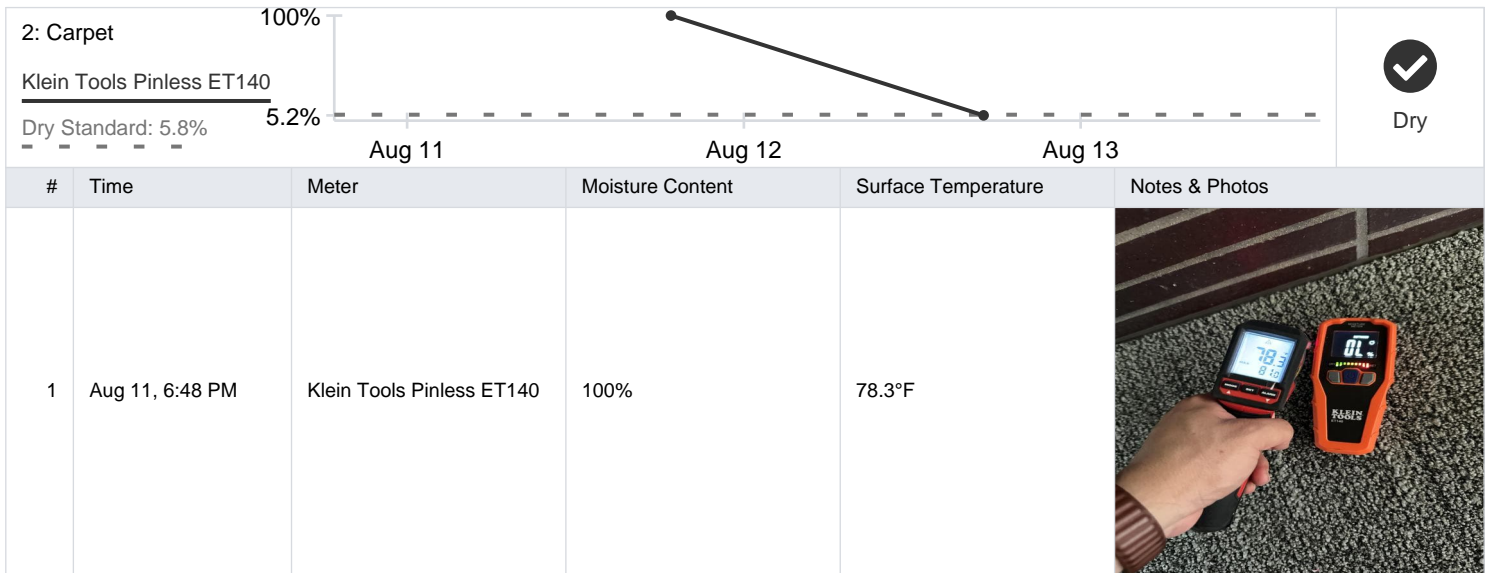

Point 2:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 5:04 PM	Klein Tools Pinless ET140	5.2%	79°F	

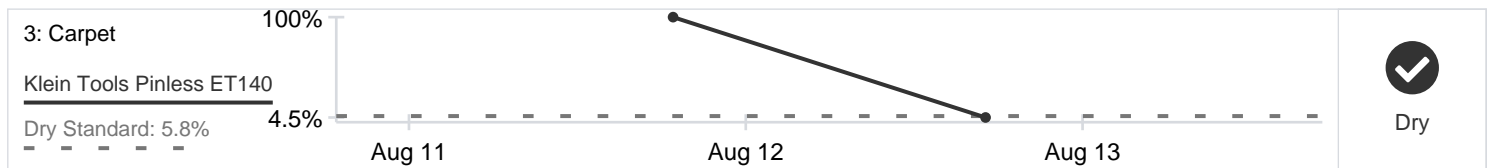Point 3:





#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 6:49 PM	Klein Tools Pinless ET140	100%	78.6°F	
2	Aug 12, 5:05 PM	Klein Tools Pinless ET140	4.5%	78.8°F	

Point 4:

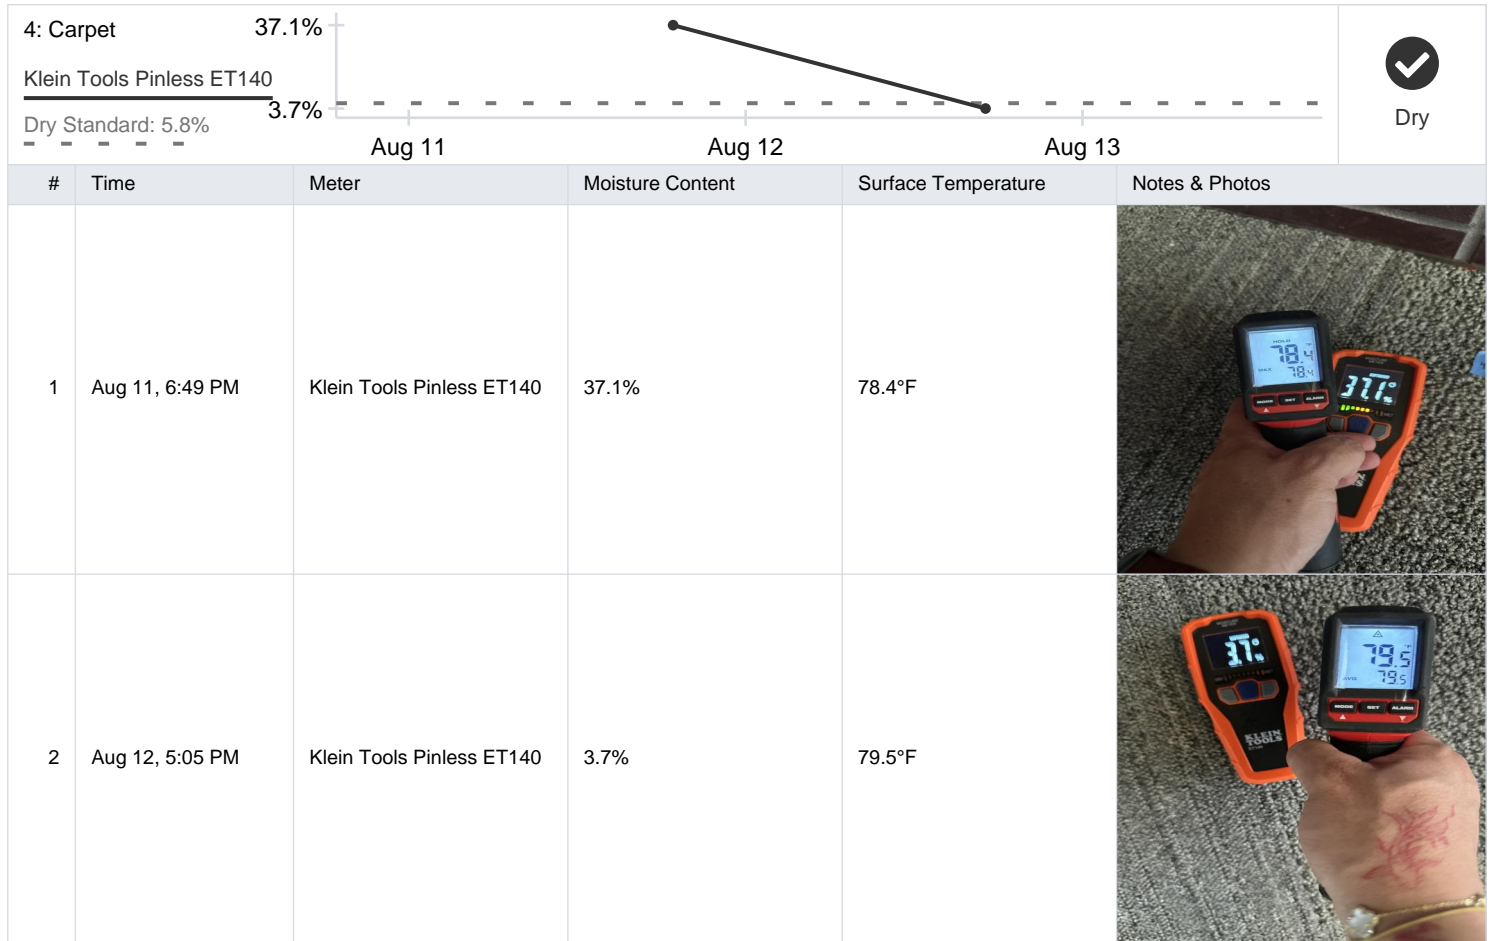

Point 5:

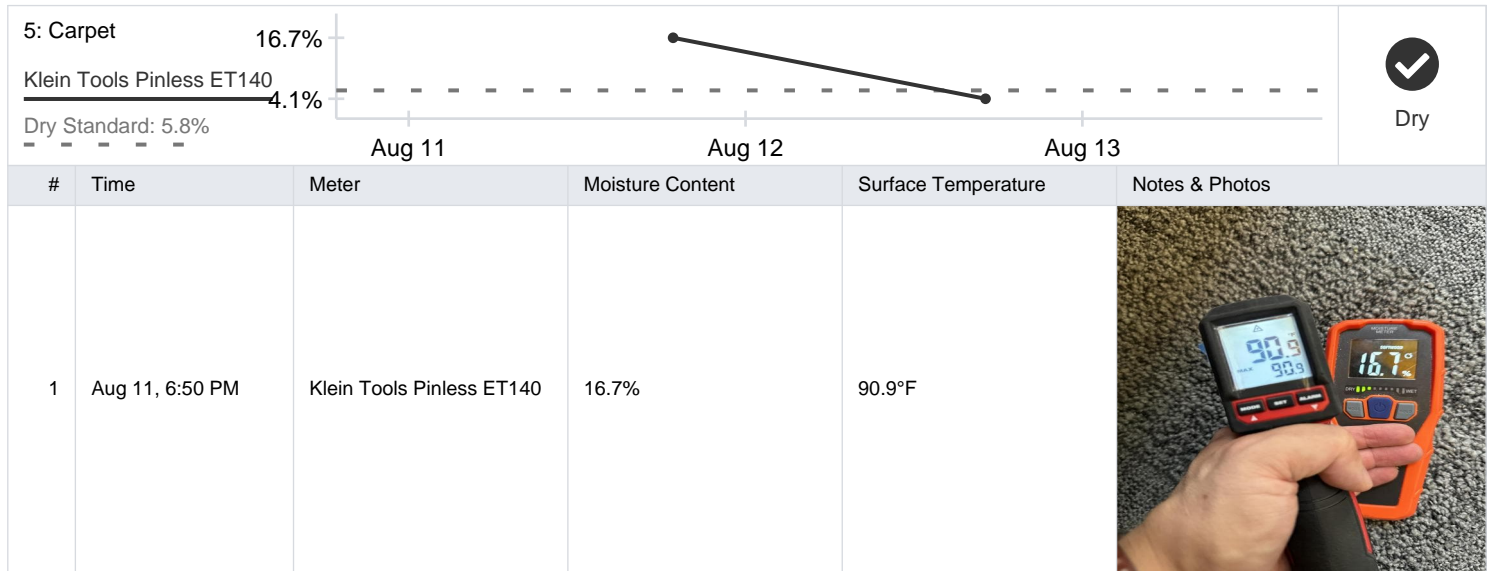




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 5:05 PM	Klein Tools Pinless ET140	4.1%	81.9°F	

Equipment List: 3rd Floor Common Area

Dehumidifier: ALORAIR Storm LGR Extreme [STORMLGREXTREME] (05)

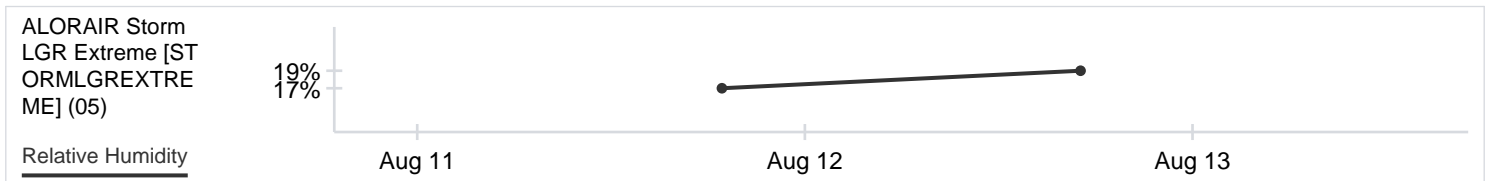Placed	Removed	Power	Energy usage	Days on site
Aug 11, 6:51 PM	Still on site	0.64 kW	55.24 kWh	4 days



#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 6:51 PM	17%	92.1 gpp	122°F	-12 gpp		
2	Aug 12, 5:04 PM	19%	66.9 gpp	107°F	19 gpp		


Air Movers: 3rd Floor Common Area

Name	Placed	Removed	Energy usage	Days on site
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (37)	Aug 11, 6:50 PM	Still on site	15.79 kWh	4 days


Name	Placed	Removed	Energy usage	Days on site
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (52)	Aug 11, 6:51 PM	Still on site	15.79 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (297)	Aug 11, 6:51 PM	Still on site	15.78 kWh	4 days

Drying Chamber: Research 314


Affected Area Readings

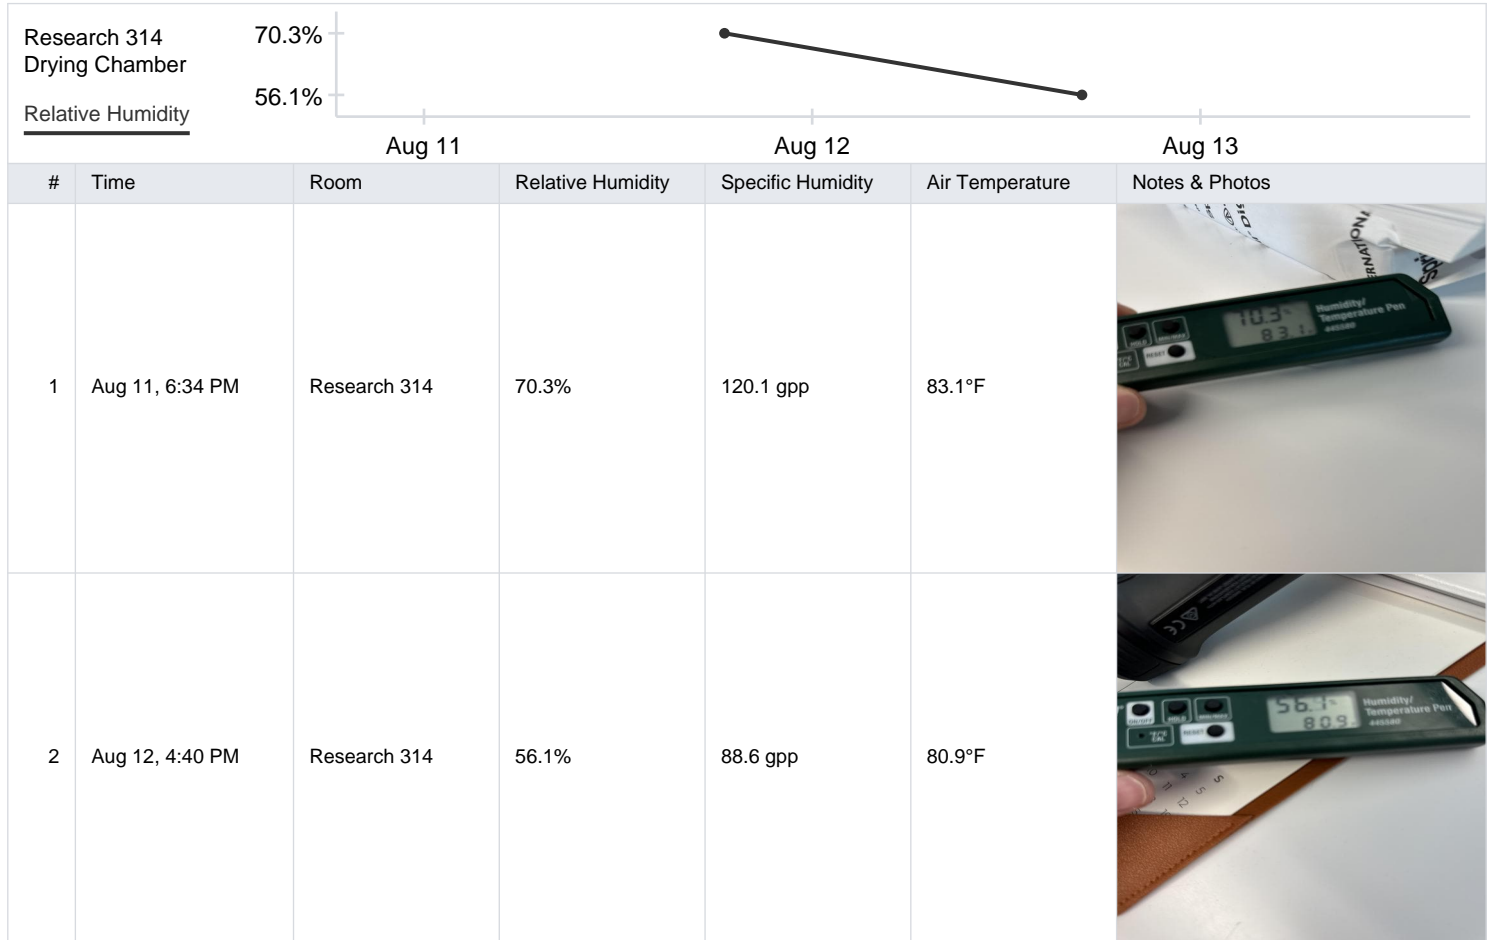


Affected Area: Research 314

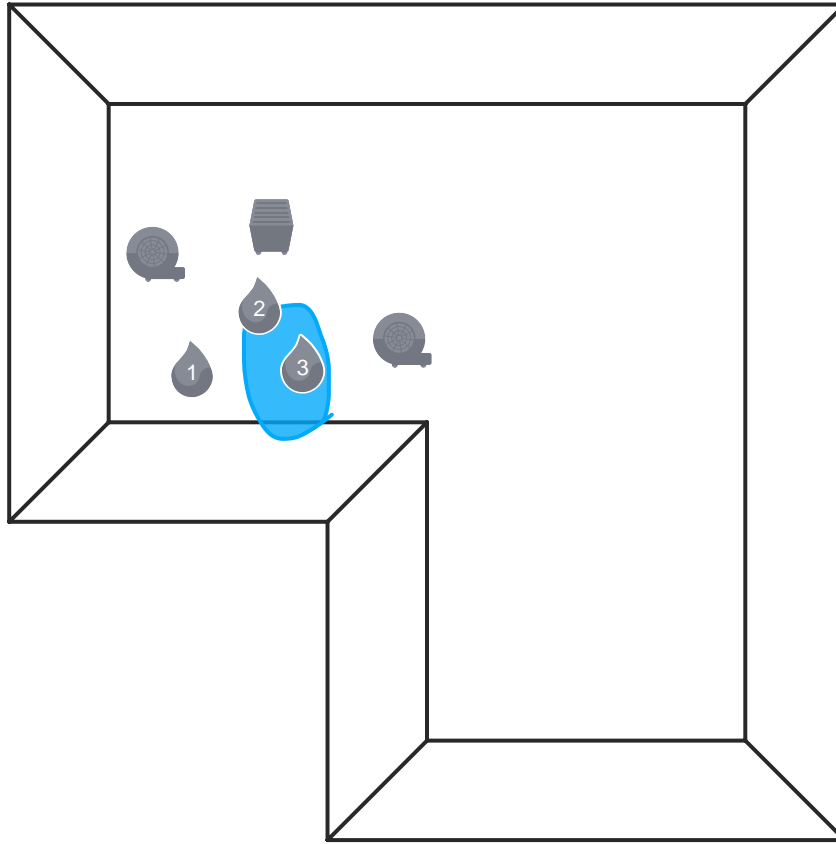


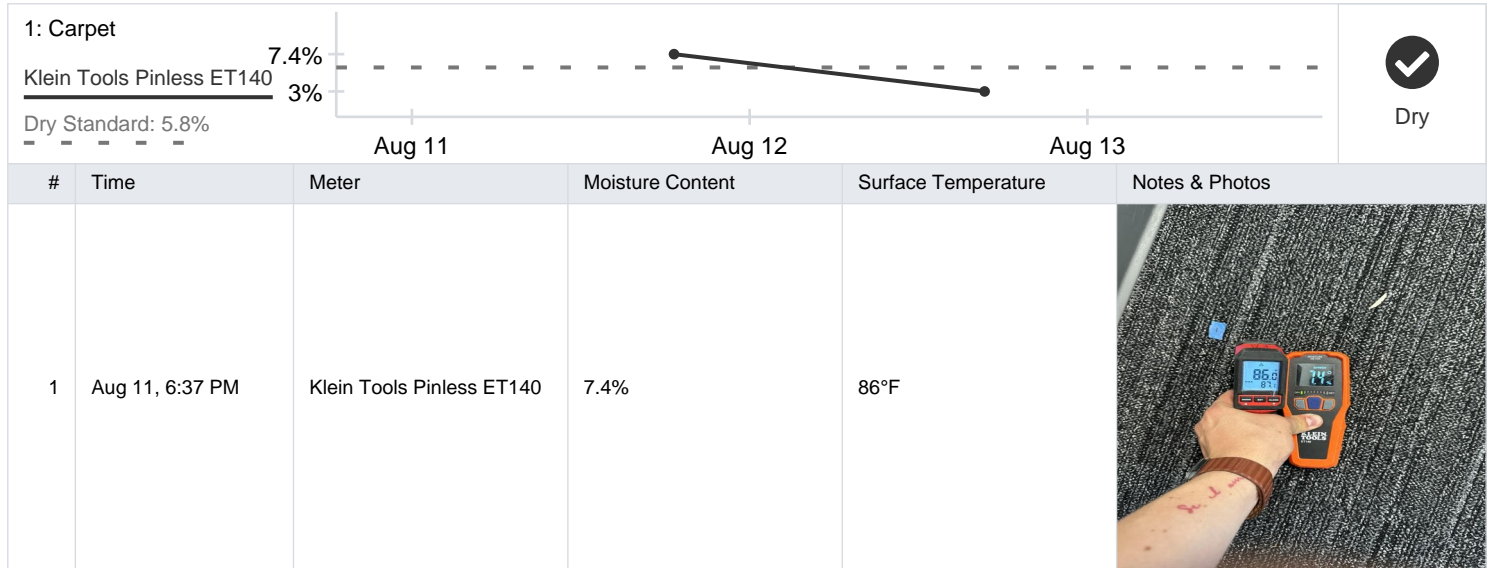

Point 1:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 4:41 PM	Klein Tools Pinless ET140	3%	83.1°F	

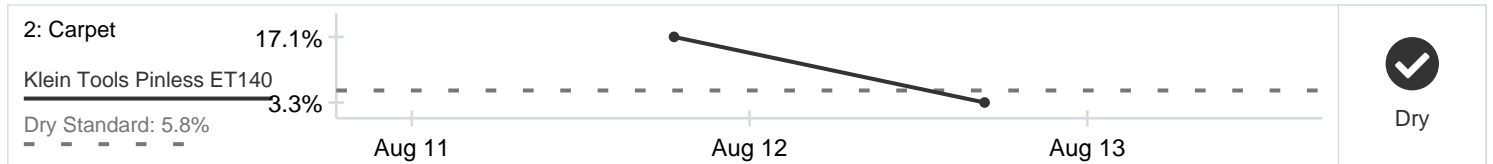Point 2:



#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 6:38 PM	Klein Tools Pinless ET140	17.1%	84.7°F	
2	Aug 12, 4:42 PM	Klein Tools Pinless ET140	3.3%	82.9°F	


Point 3:

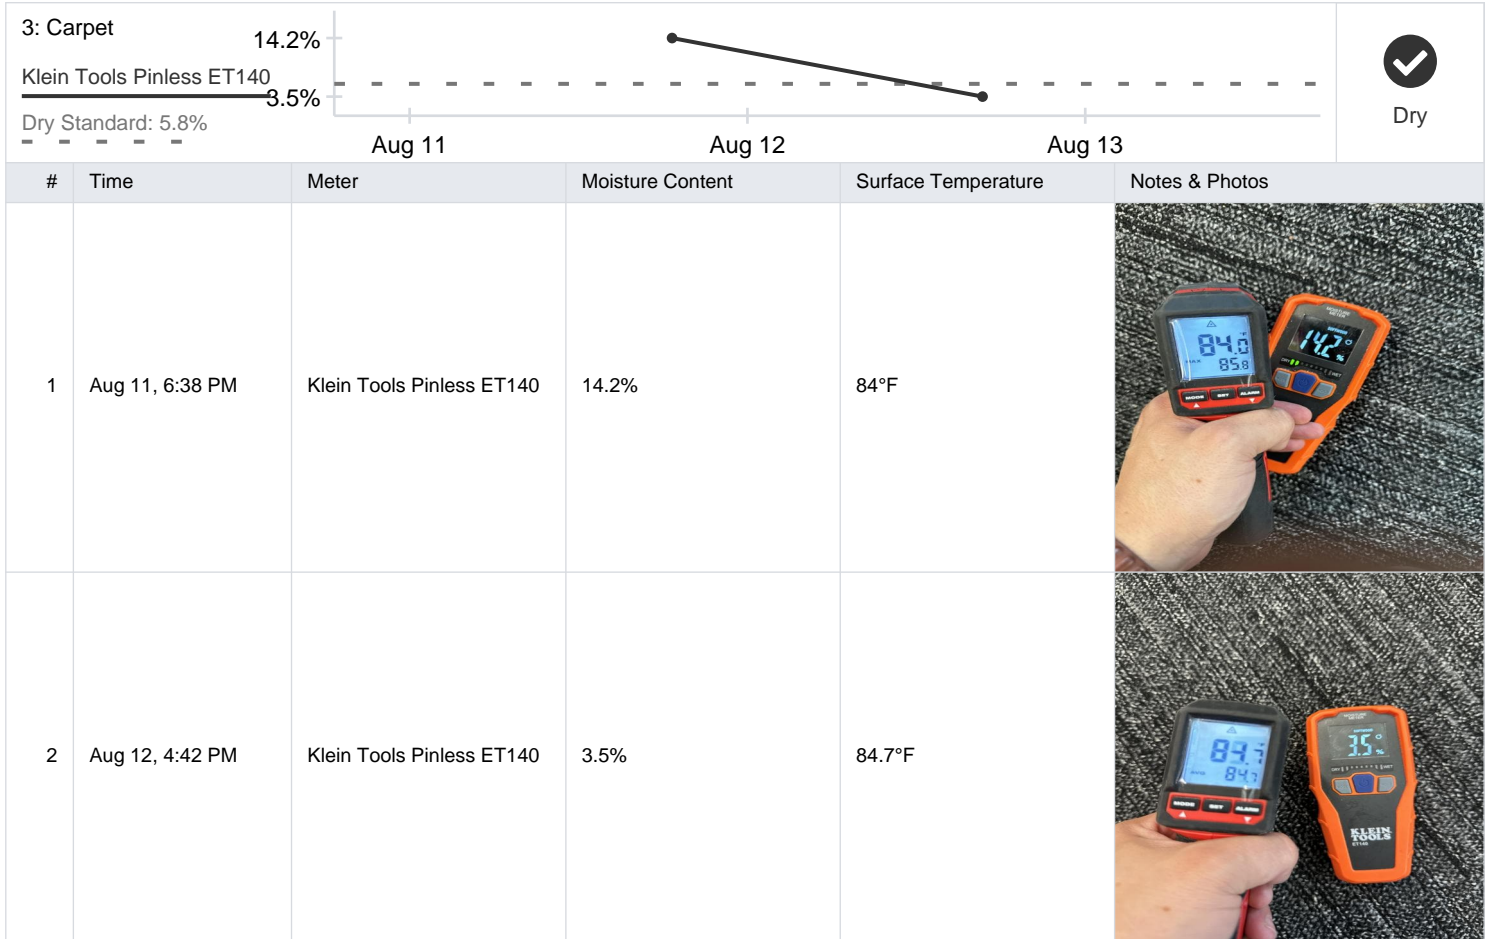



Equipment List: Research 314

Dehumidifier: ALORAIR Storm LGR Extreme [STORMLGREXTREME] (4)

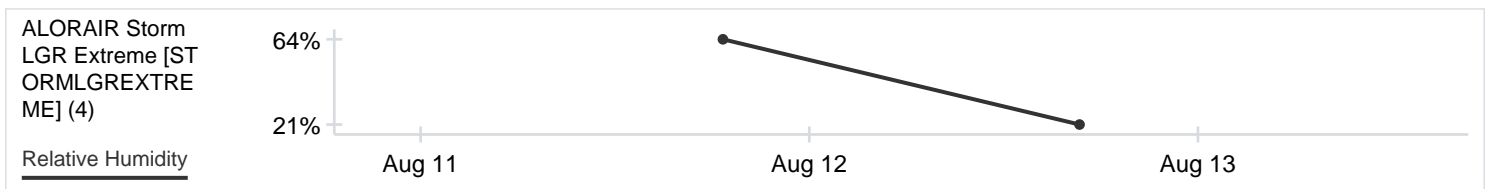Placed	Removed	Power	Energy usage	Days on site
Aug 11, 6:39 PM	Aug 11, 8:25 PM	0.64 kW	1.14 kWh	1 day




#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 6:40 PM	64%	112.4 gpp	84°F	8 gpp		
2	Aug 12, 4:41 PM	21%	63.7 gpp	102°F	25 gpp		

Air Movers: Research 314


Name	Placed	Removed	Energy usage	Days on site
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (340)	Aug 11, 6:38 PM	Aug 12, 1:21 PM	3.44 kWh	1 day
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (26)	Aug 11, 6:39 PM	Still on site	15.82 kWh	4 days

Drying Chamber: 2nd Floor Common Area

Affected Area Readings

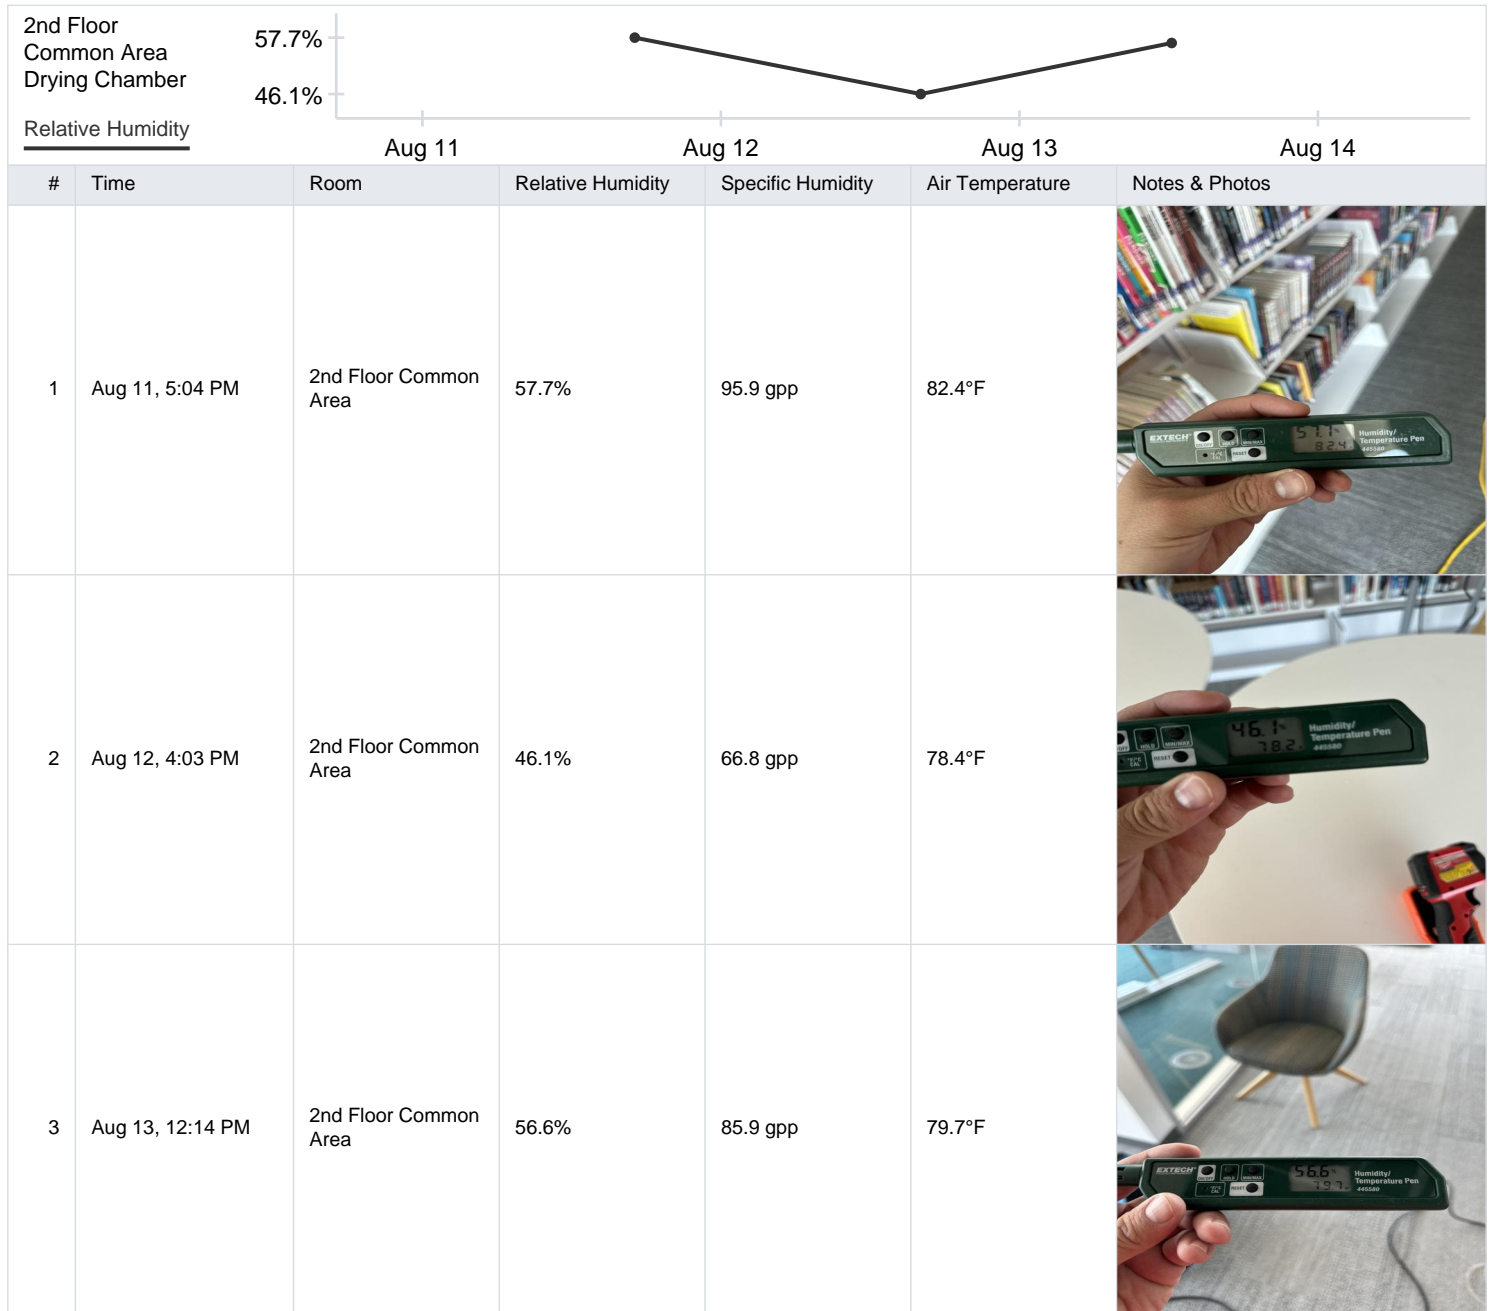


Affected Area: 2nd Floor Common Area

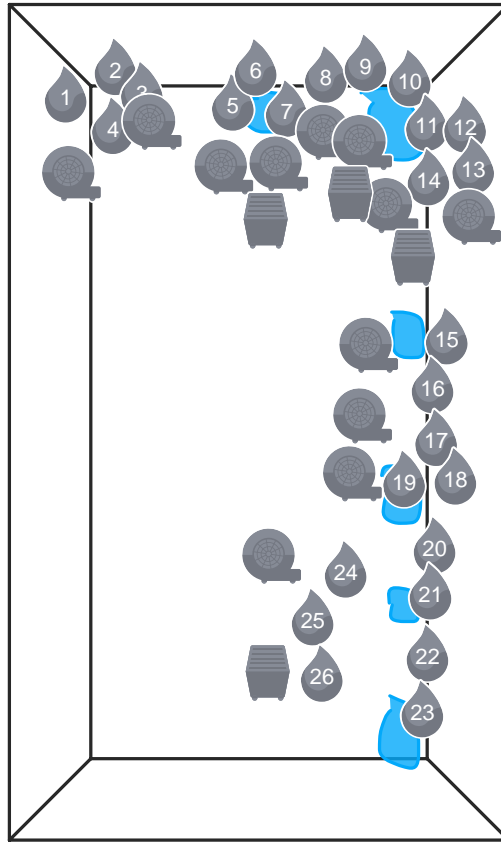


Point 1:


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 5:44 PM	Klein Tools Pinless ET140	8.9%	99.1°F	

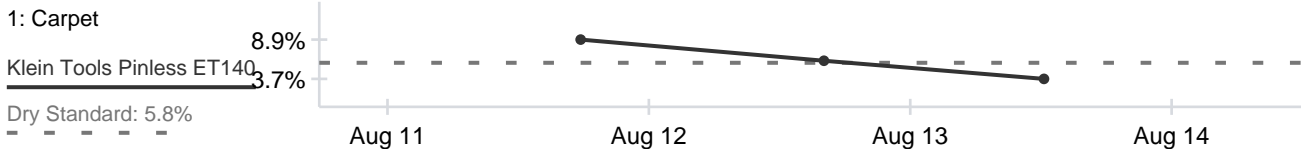


Dry

#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 4:04 PM	Klein Tools Pinless ET140	6.1%	58.5°F	
3	Aug 13, 12:16 PM	Klein Tools Pinless ET140	3.7%	78.4°F	


Point 2:

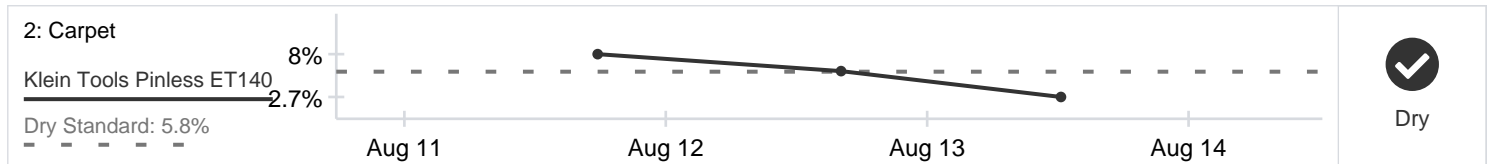



#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 5:44 PM	Klein Tools Pinless ET140	8%	99.1°F	
2	Aug 12, 4:05 PM	Klein Tools Pinless ET140	5.9%	68.2°F	


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
3	Aug 13, 12:16 PM	Klein Tools Pinless ET140	2.7%	78.4°F	

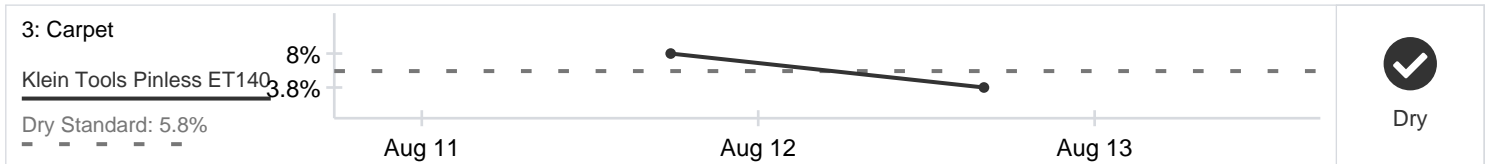Point 3:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 5:45 PM	Klein Tools Pinless ET140	8%	85.6°F	
2	Aug 12, 4:06 PM	Klein Tools Pinless ET140	3.8%	72.9°F	

Point 4:

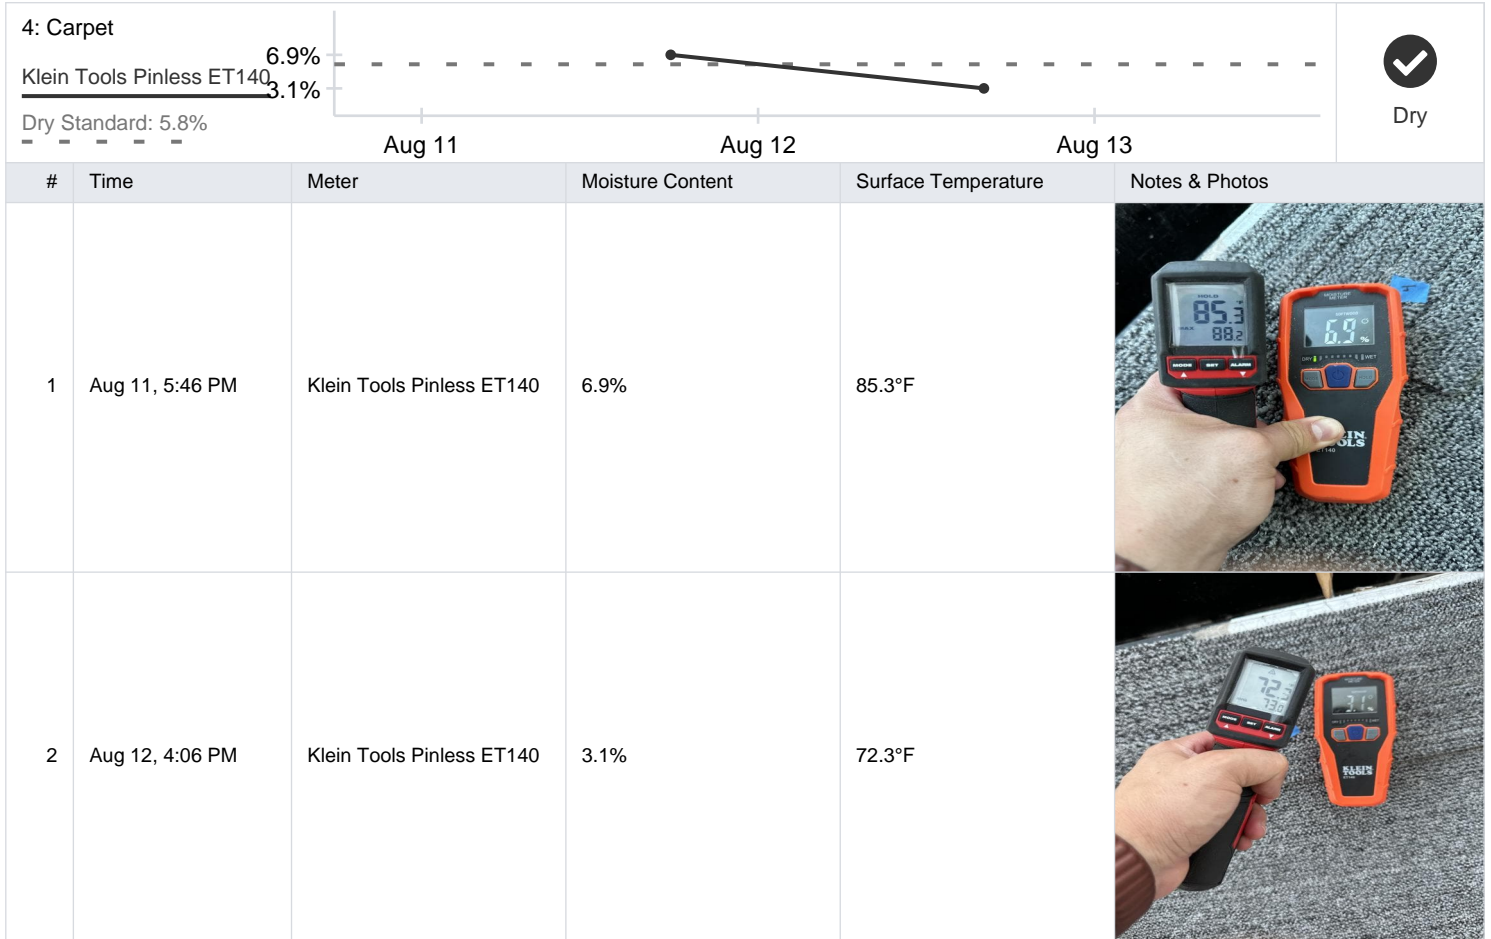


Point 5:

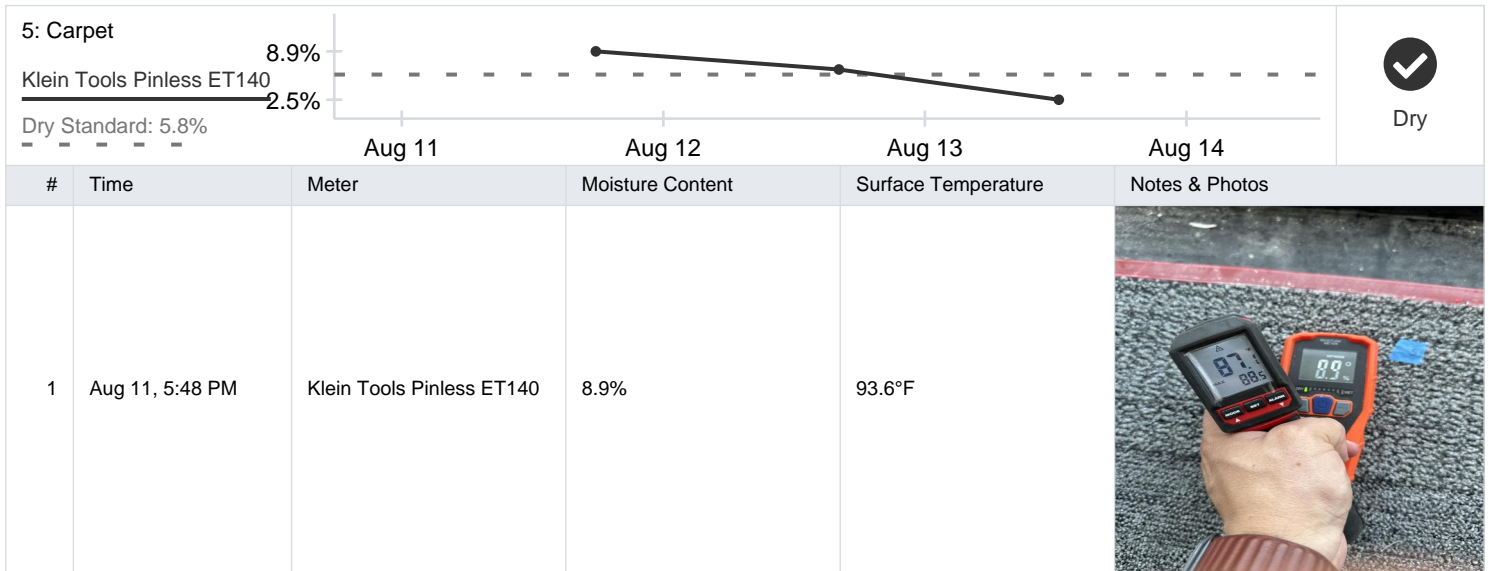


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 4:06 PM	Klein Tools Pinless ET140	6.5%	73°F	
3	Aug 13, 12:17 PM	Klein Tools Pinless ET140	2.5%	77.5°F	

Point 6:

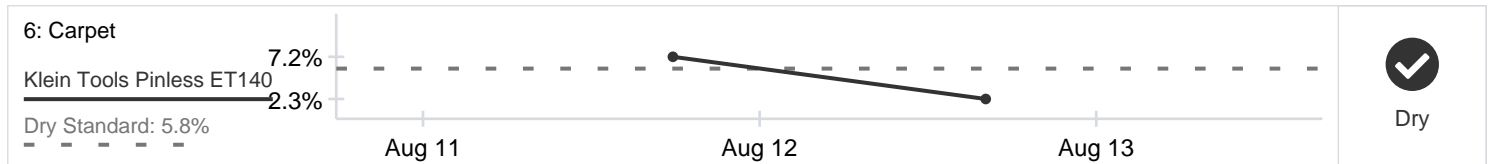


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 5:49 PM	Klein Tools Pinless ET140	7.2%	88.7°F	
2	Aug 12, 4:07 PM	Klein Tools Pinless ET140	2.3%	67.9°F	

Point 7:

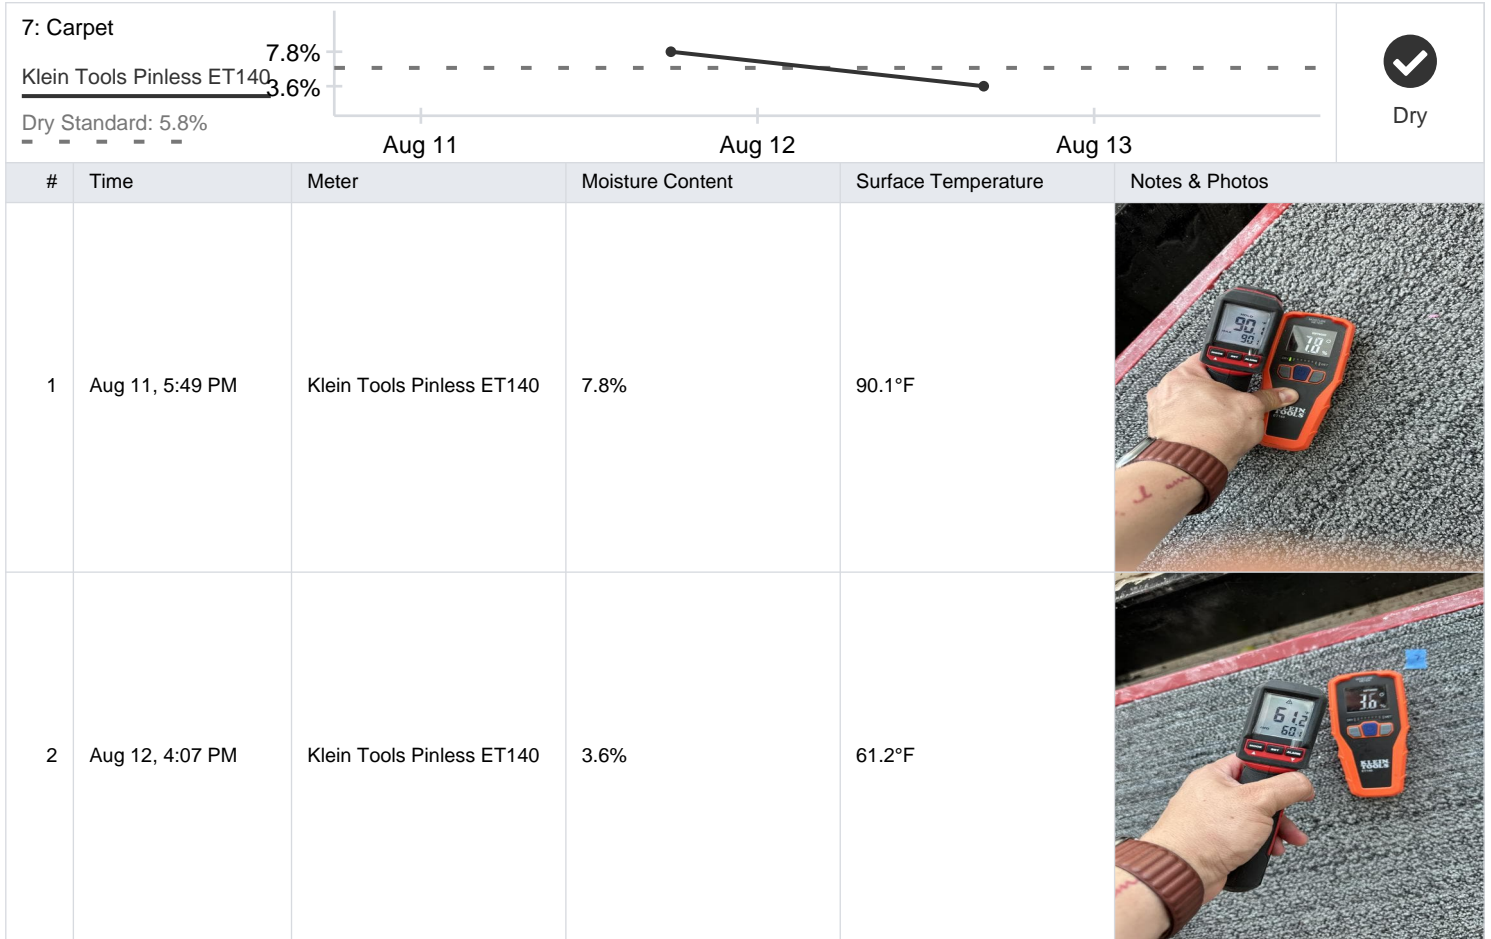


Point 8:

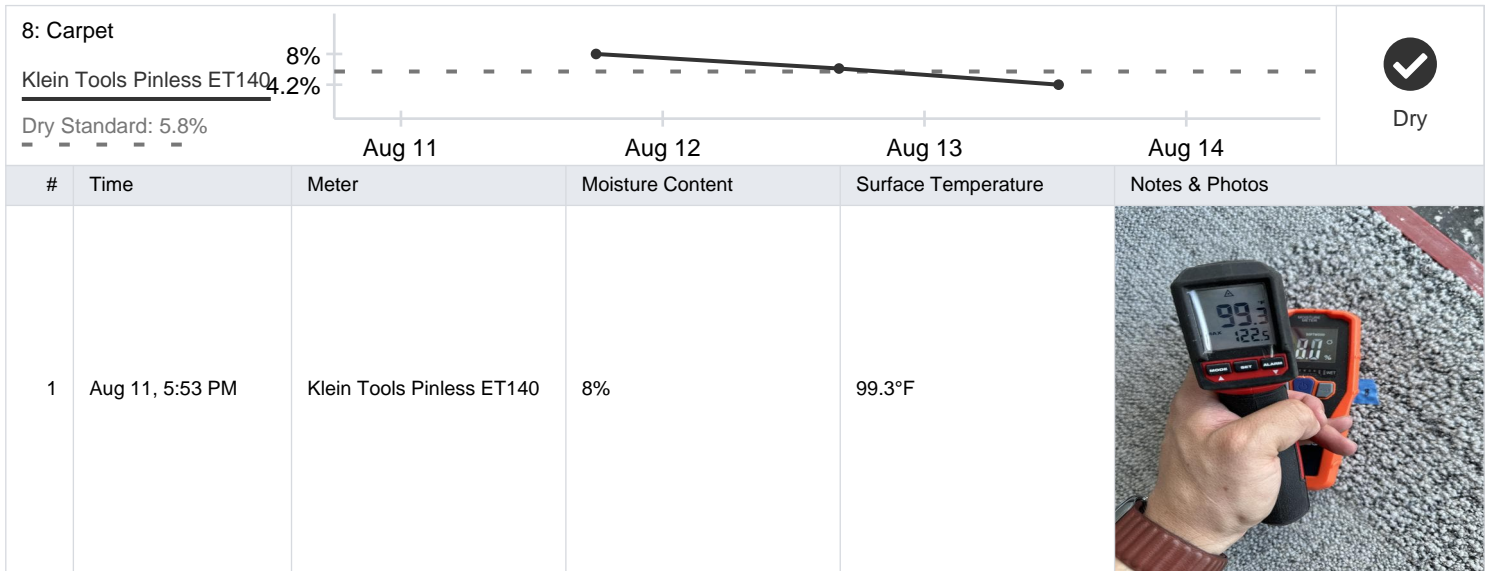


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 4:09 PM	Klein Tools Pinless ET140	6.2%	75.6°F	
3	Aug 13, 12:17 PM	Klein Tools Pinless ET140	4.2%	76.8°F	

Point 9:

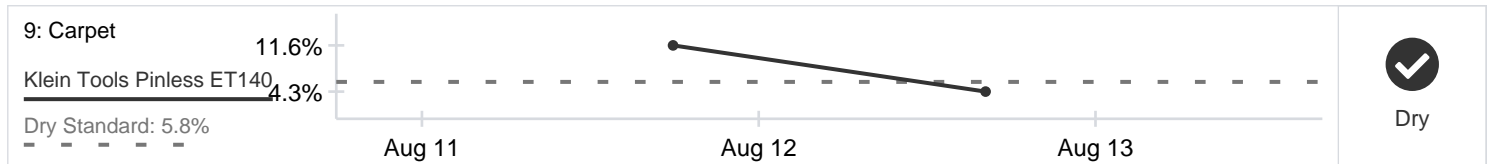



#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 5:53 PM	Klein Tools Pinless ET140	11.6%	92.5°F	
2	Aug 12, 4:10 PM	Klein Tools Pinless ET140	4.3%	75.4°F	

Point 10:

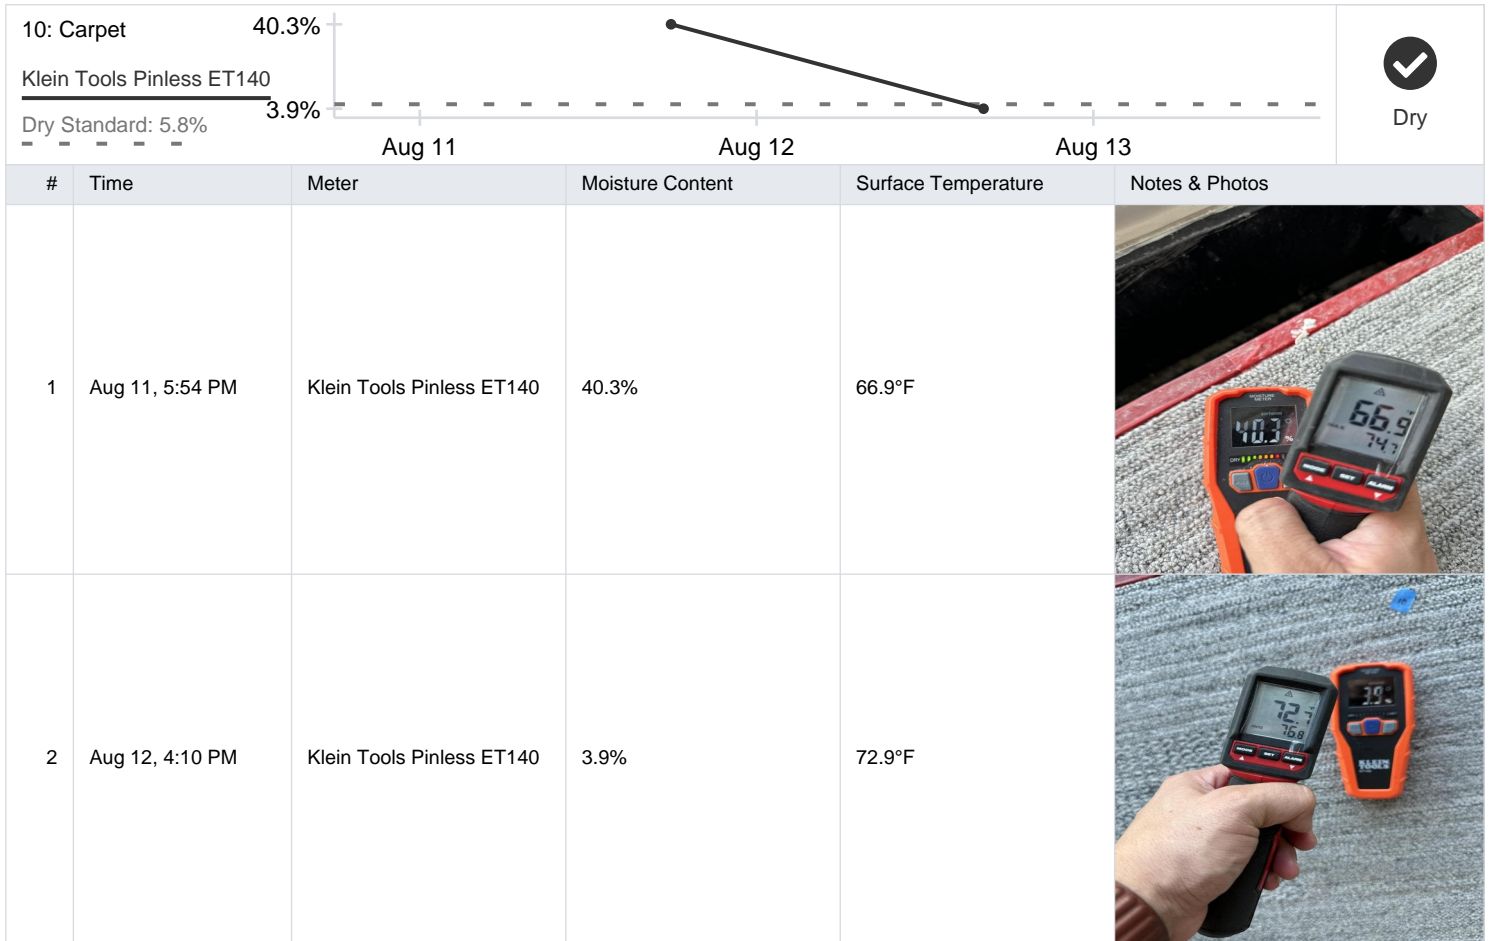


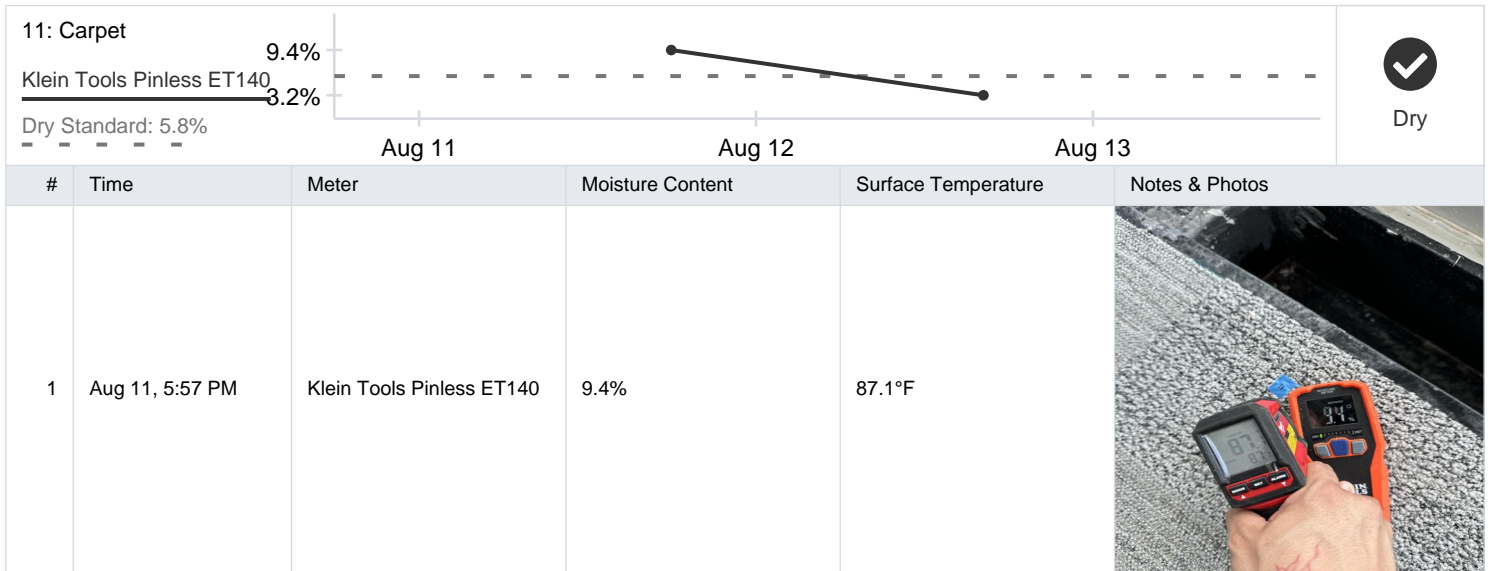

Point 11:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 4:11 PM	Klein Tools Pinless ET140	3.2%	72.9°F	

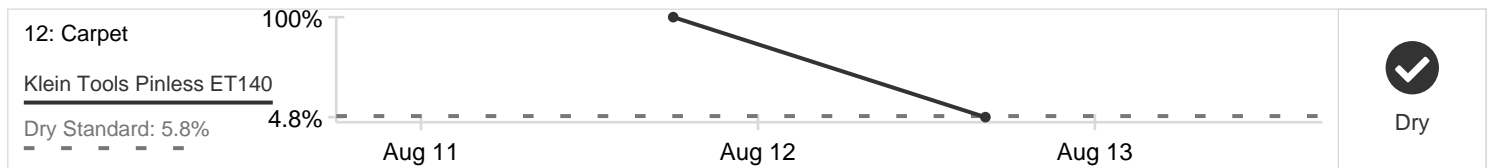Point 12:





#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 5:58 PM	Klein Tools Pinless ET140	100%	87.1°F	
2	Aug 12, 4:12 PM	Klein Tools Pinless ET140	4.8%	78.4°F	

Point 13:

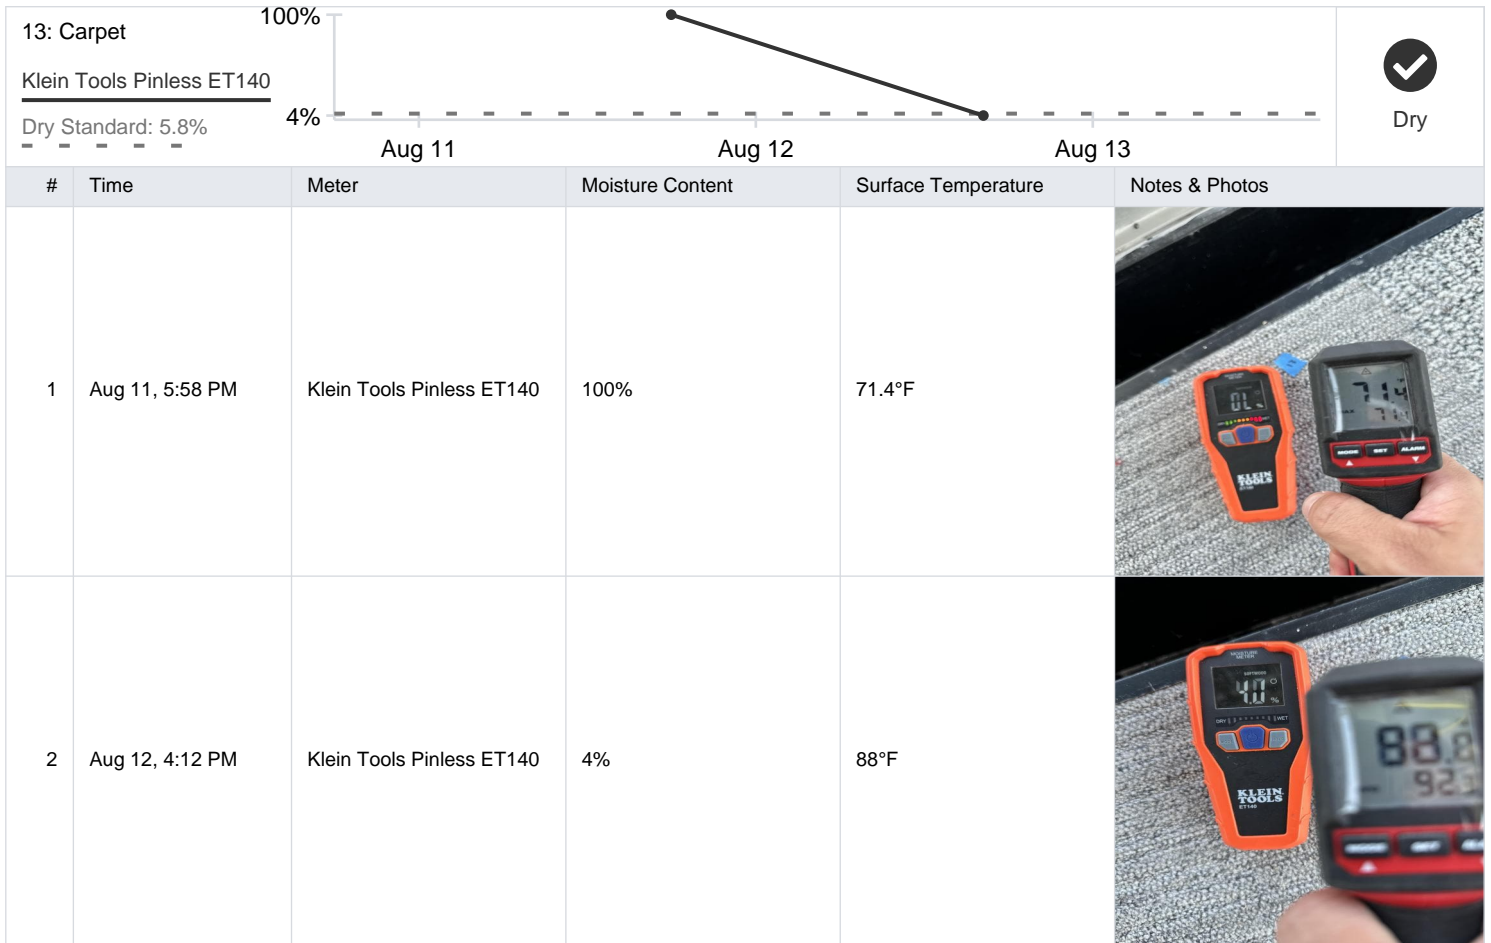


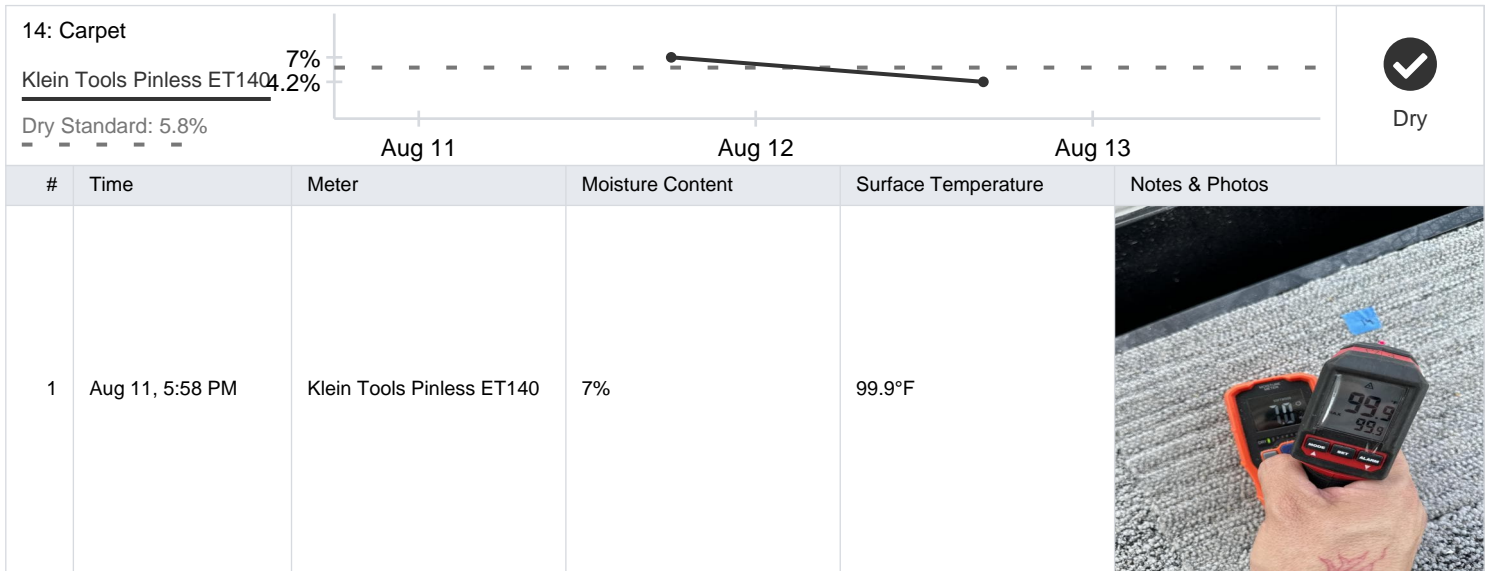

Point 14:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 4:12 PM	Klein Tools Pinless ET140	4.2%	83.7°F	

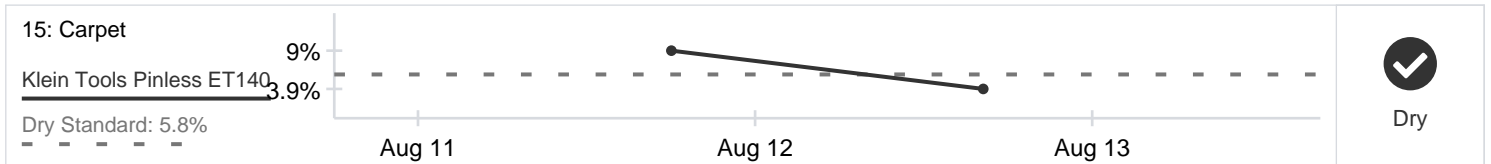Point 15:





#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 6:02 PM	Klein Tools Pinless ET140	9%	84°F	
2	Aug 12, 4:14 PM	Klein Tools Pinless ET140	3.9%	82.6°F	

Point 16:

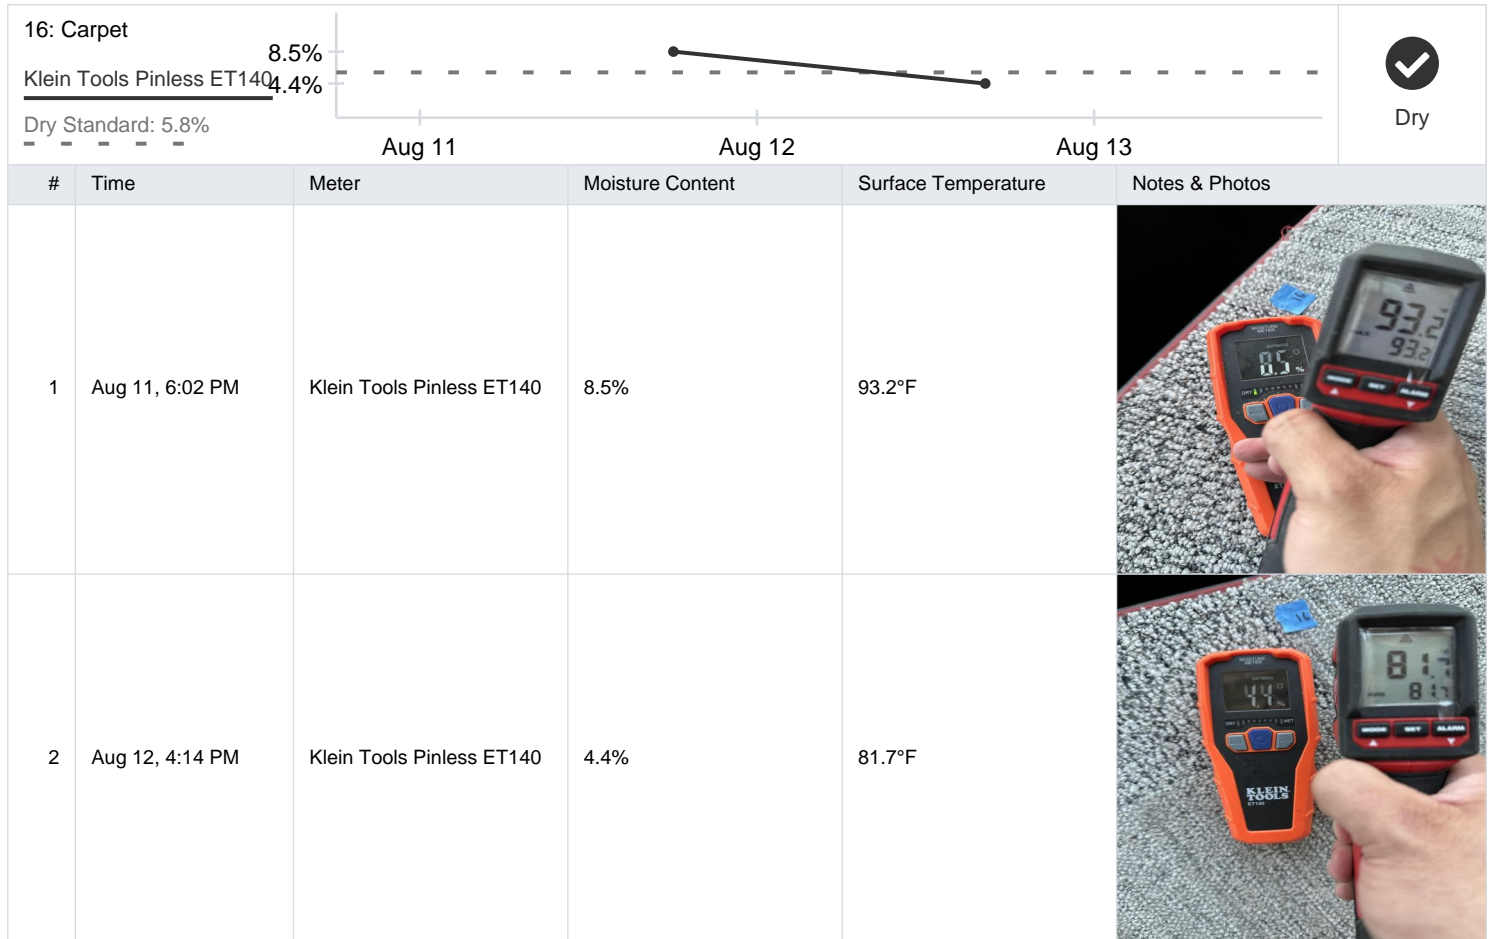


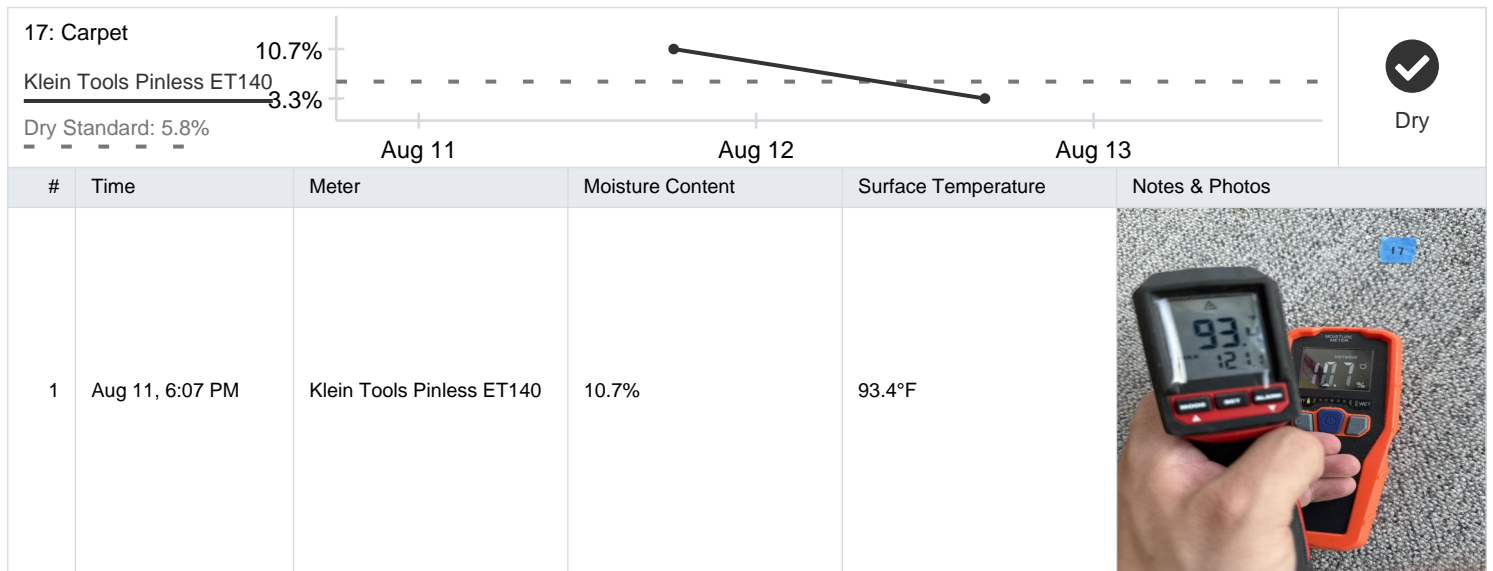

Point 17:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 4:16 PM	Klein Tools Pinless ET140	3.3%	87.8°F	

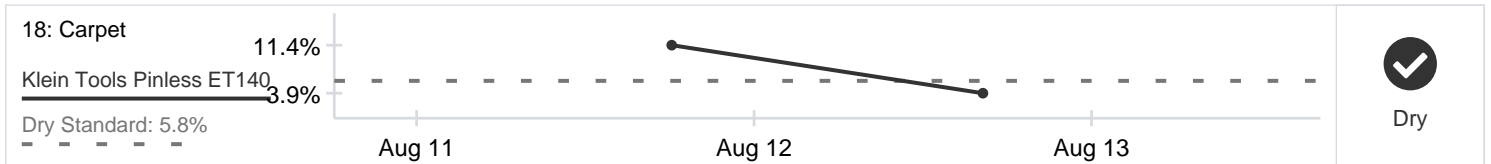Point 18:





#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 6:08 PM	Klein Tools Pinless ET140	11.4%	87.1°F	
2	Aug 12, 4:16 PM	Klein Tools Pinless ET140	3.9%	84.2°F	

Point 19:

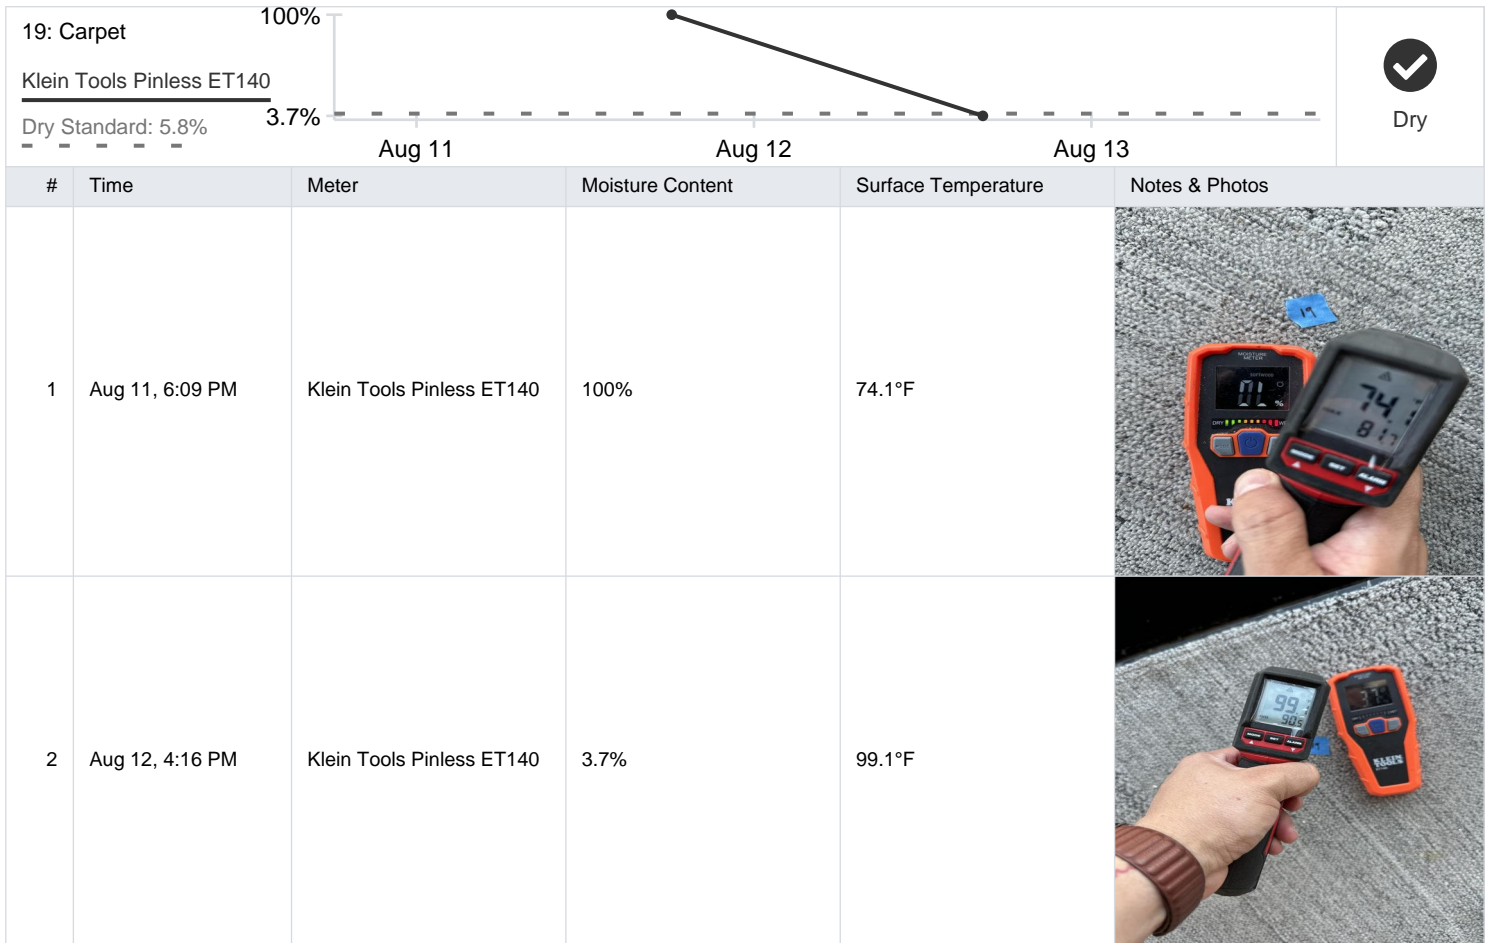


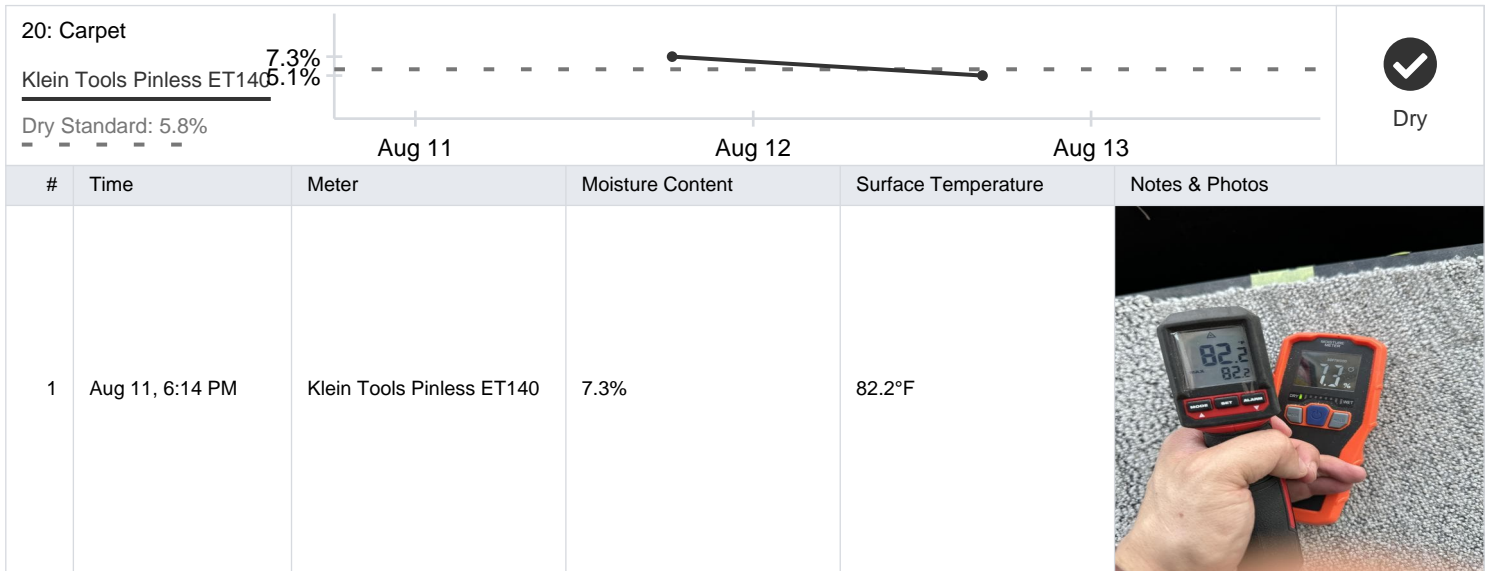

Point 20:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 4:17 PM	Klein Tools Pinless ET140	5.1%	82.4°F	

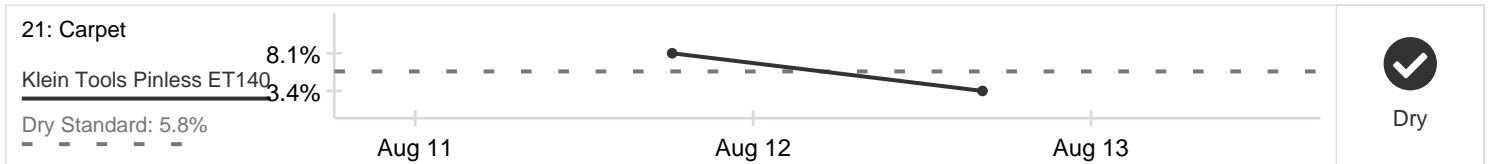Point 21:





#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 6:14 PM	Klein Tools Pinless ET140	8.1%	82.6°F	
2	Aug 12, 4:17 PM	Klein Tools Pinless ET140	3.4%	82°F	

Point 22:

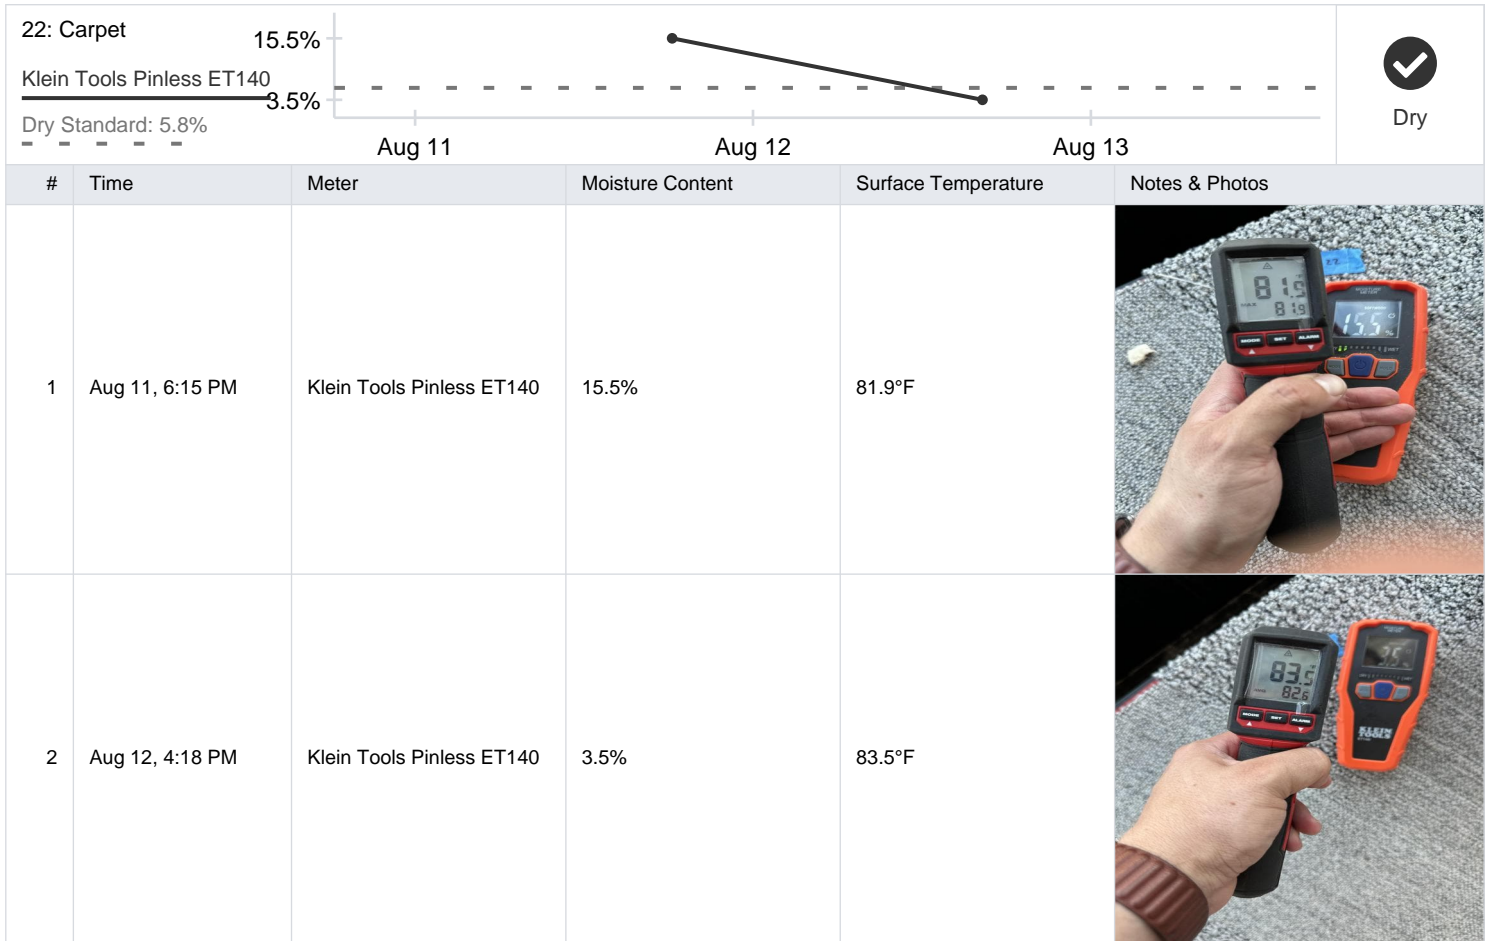


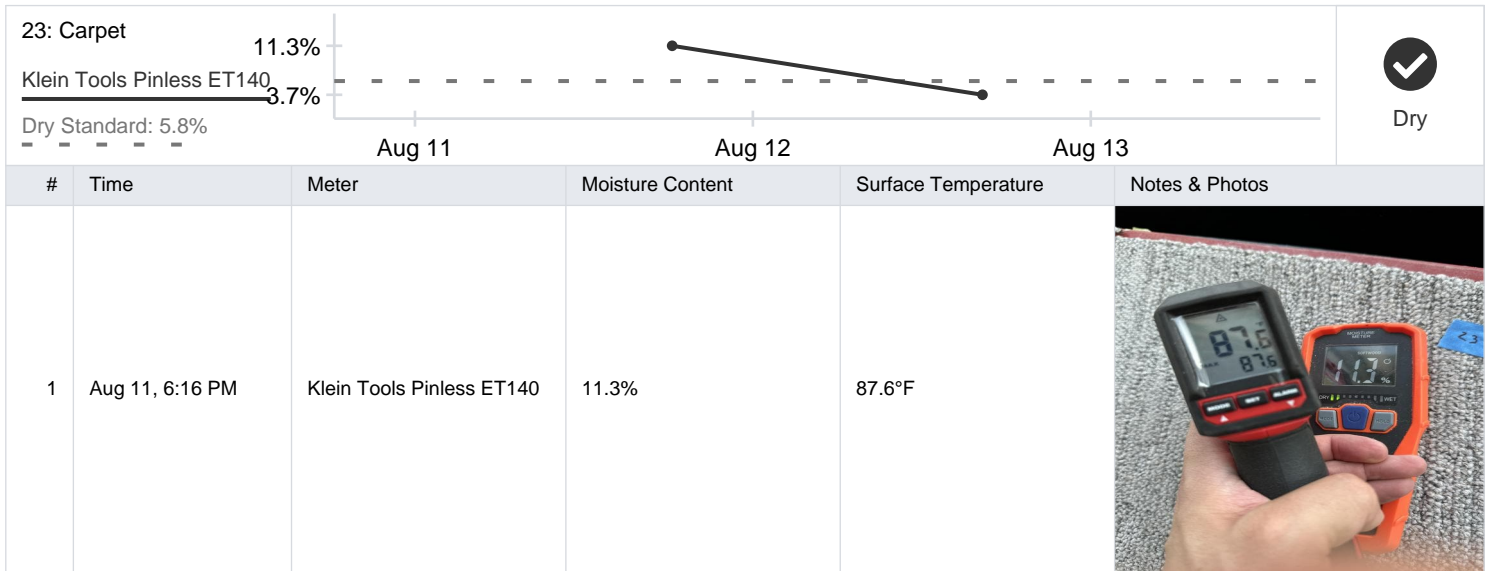

Point 23:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 4:18 PM	Klein Tools Pinless ET140	3.7%	78.3°F	

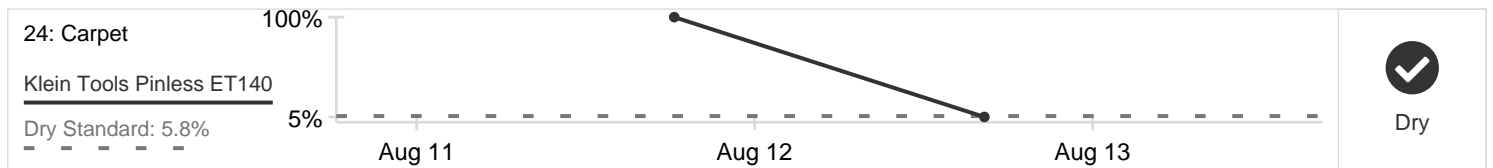Point 24:





#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 6:17 PM	Klein Tools Pinless ET140	100%	76.6°F	
2	Aug 12, 4:18 PM	Klein Tools Pinless ET140	5%	78.4°F	

Point 25:

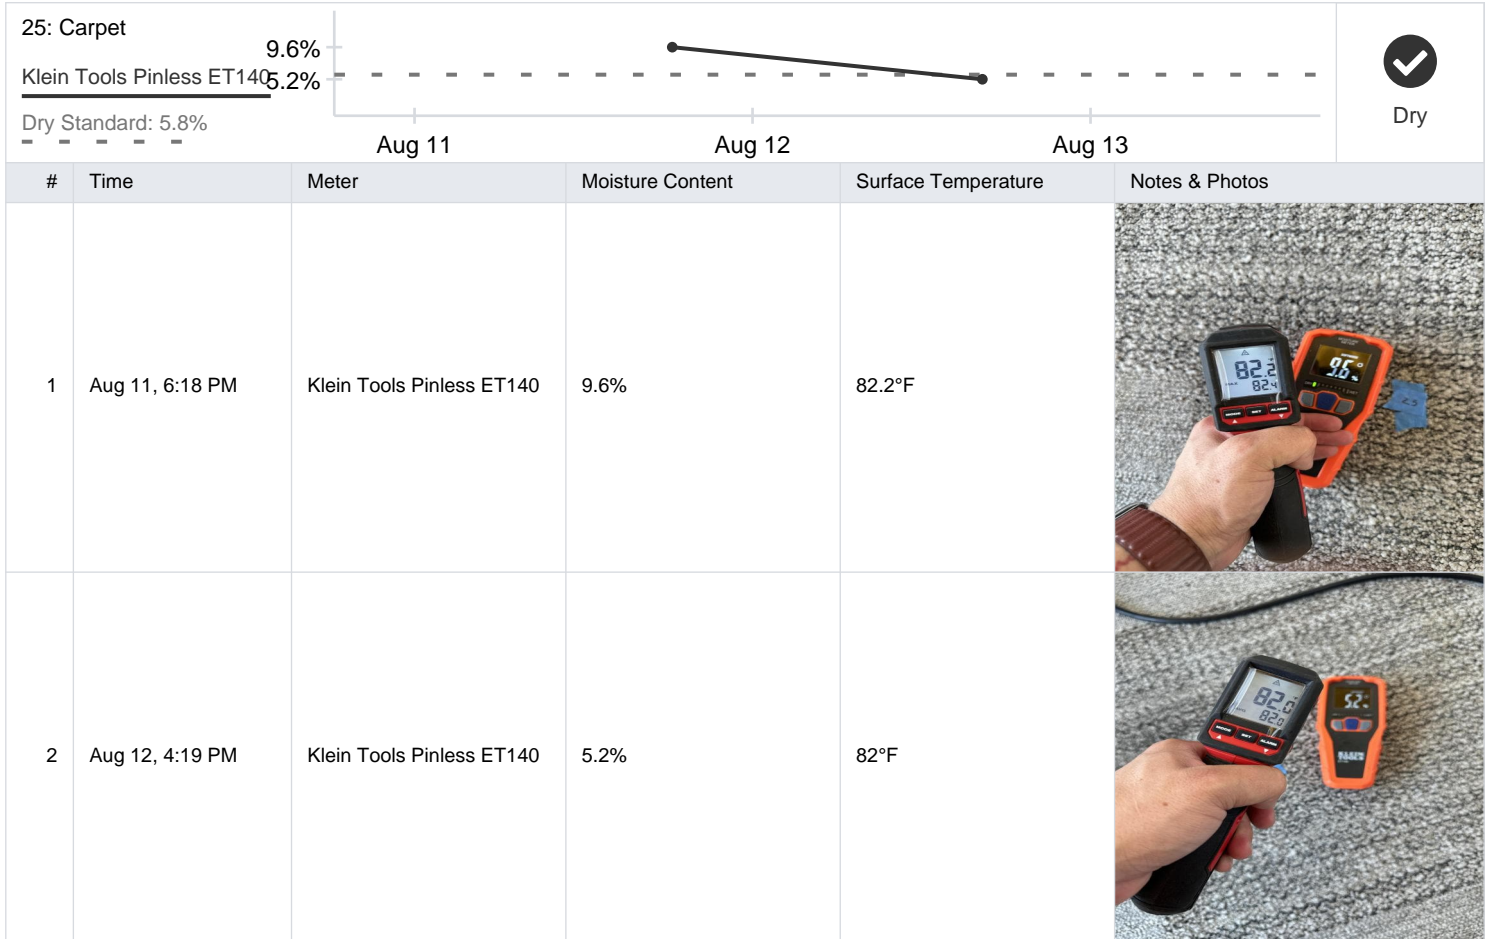

Point 26:

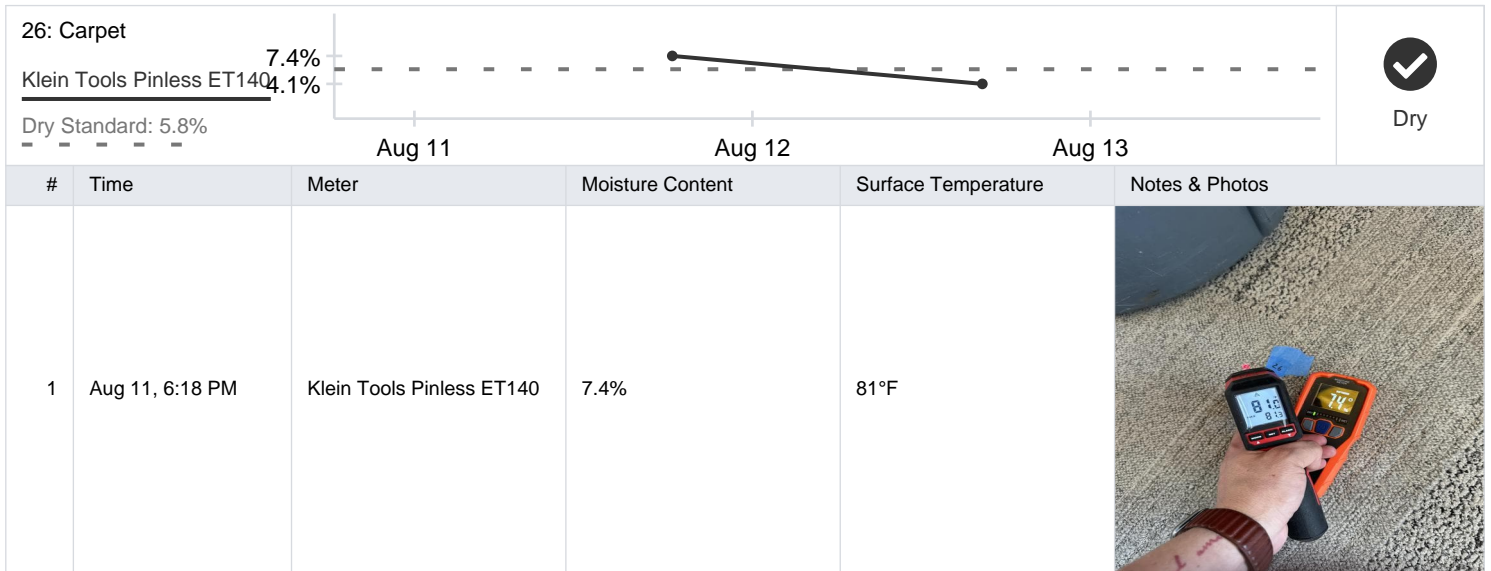




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 4:19 PM	Klein Tools Pinless ET140	4.1%	60.4°F	


Equipment List: 2nd Floor Common Area

Dehumidifier: ALORAIR Storm LGR Extreme [STORMLGREXTREME] (3)

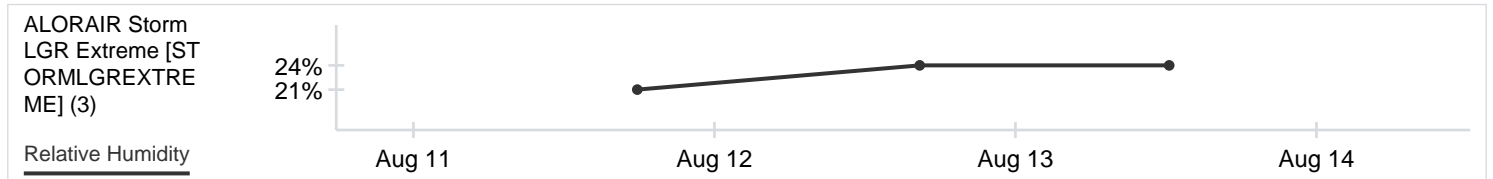Placed	Removed	Power	Energy usage	Days on site
Aug 11, 5:50 PM	Still on site	0.64 kW	55.90 kWh	4 days




#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 5:50 PM	21%	63.7 gpp	102°F	32 gpp		
2	Aug 12, 4:21 PM	24%	51.9 gpp	91°F	15 gpp		


#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
3	Aug 13, 12:15 PM	24%	51.9 gpp	91°F	34 gpp		

Dehumidifier: ALORAIR Storm LGR Extreme [STORMLGREXTREME] (3)

Placed Aug 11, 5:55 PM Removed Still on site Power 0.64 kW Energy usage 55.85 kWh Days on site 4 days

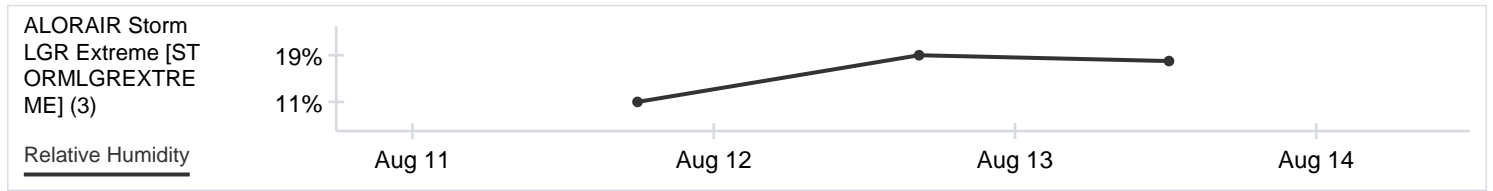




#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 5:55 PM	11%	43.2 gpp	111°F	53 gpp		
2	Aug 12, 4:21 PM	19%	47.9 gpp	96°F	19 gpp		

#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
3	Aug 13, 12:16 PM	18%	45.4 gpp	96°F	41 gpp		

Dehumidifier: ALORAIR Storm LGR Extreme [STORMLGREXTREME] (04)

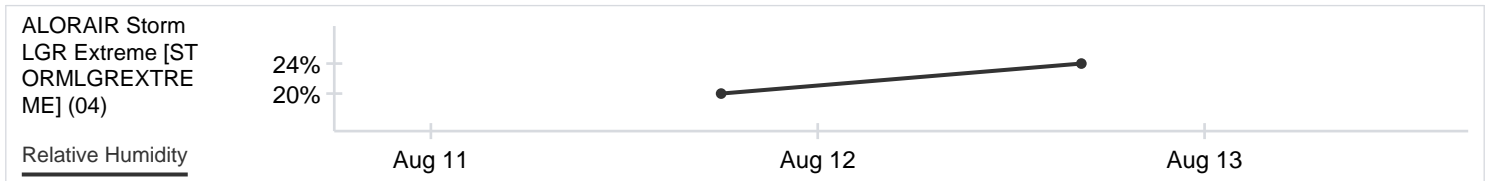
Placed Aug 11, 5:59 PM **Removed** Still on site **Power** 0.64 kW **Energy usage** 55.80 kWh **Days on site** 4 days



#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 6:00 PM	20%	66.4 gpp	105°F	29 gpp		
2	Aug 12, 4:21 PM	24%	51.9 gpp	91°F	15 gpp		

Dehumidifier: Phoenix DryMax BLE [4038500] (42)

Placed Aug 11, 6:22 PM **Removed** Still on site **Power** 0.63 kW **Energy usage** 54.09 kWh **Days on site** 4 days

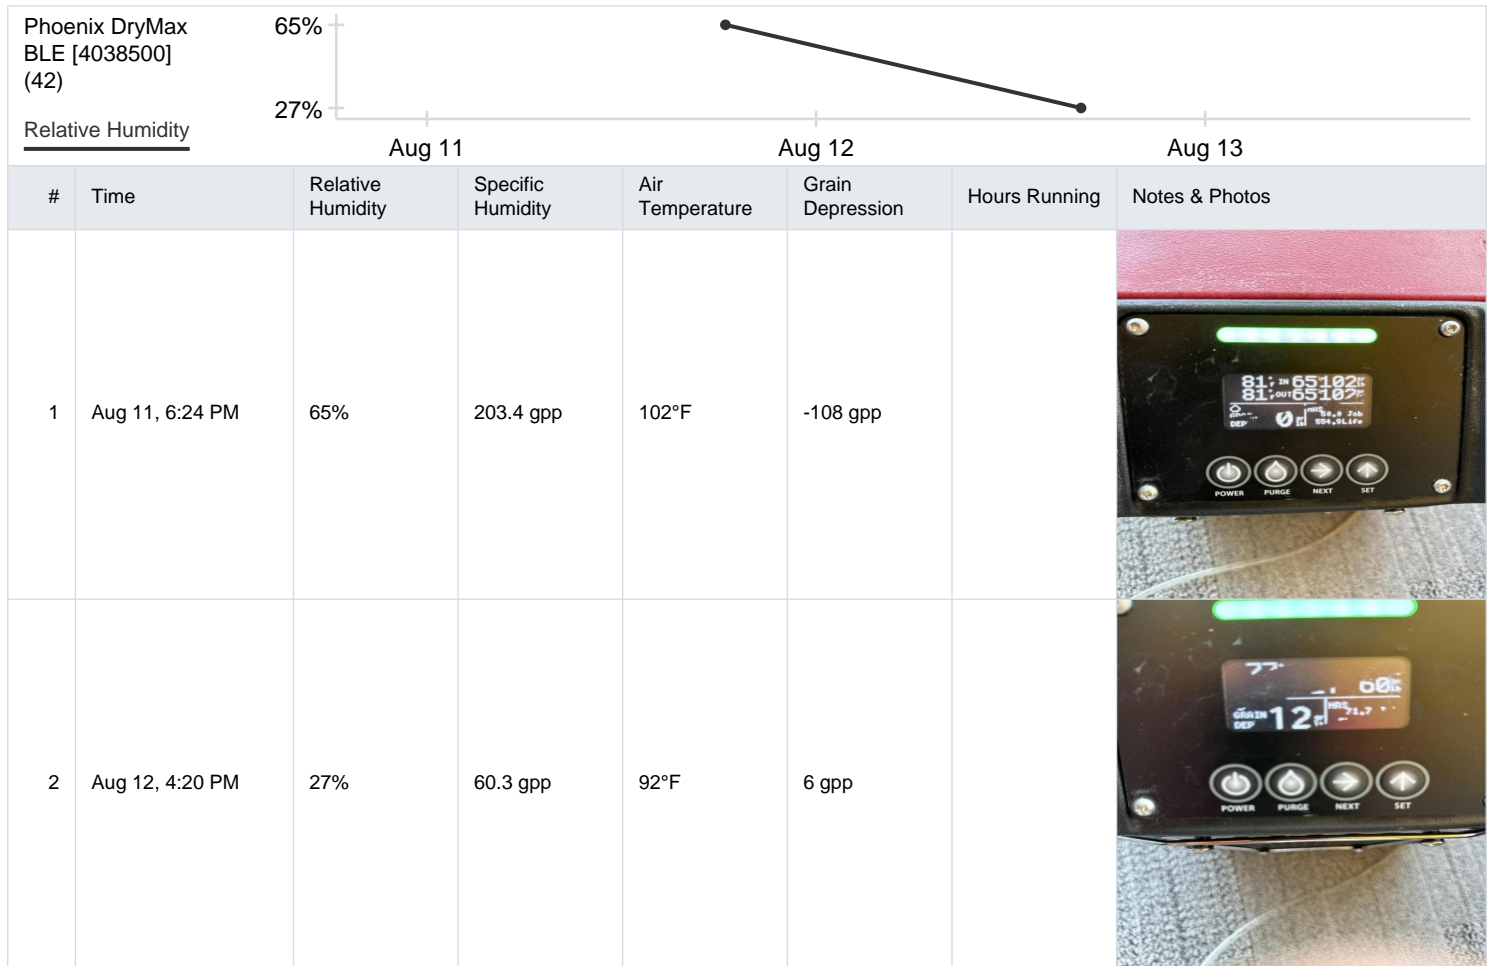


Air Movers: 2nd Floor Common Area


Name	Placed	Removed	Energy usage	Days on site
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (295)	Aug 11, 5:46 PM	Still on site	15.98 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (419)	Aug 11, 5:46 PM	Still on site	15.98 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (404)	Aug 11, 5:49 PM	Aug 11, 9:54 PM	0.75 kWh	1 day
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (2)	Aug 11, 5:50 PM	Still on site	15.97 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (58)	Aug 11, 5:54 PM	Still on site	15.96 kWh	4 days
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (363)	Aug 11, 5:54 PM	Still on site	27.93 kWh	4 days
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (445)	Aug 11, 5:59 PM	Still on site	27.90 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (417)	Aug 11, 5:59 PM	Aug 12, 4:53 PM	4.21 kWh	1 day
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (374)	Aug 11, 6:03 PM	Still on site	15.93 kWh	4 days
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (422)	Aug 11, 6:03 PM	Still on site	27.88 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (12)	Aug 11, 6:09 PM	Aug 12, 5:03 PM	4.21 kWh	1 day
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (7)	Aug 11, 6:21 PM	Aug 11, 6:59 PM	0.12 kWh	1 day

Drying Chamber: Staff Only 201A


Affected Area Readings

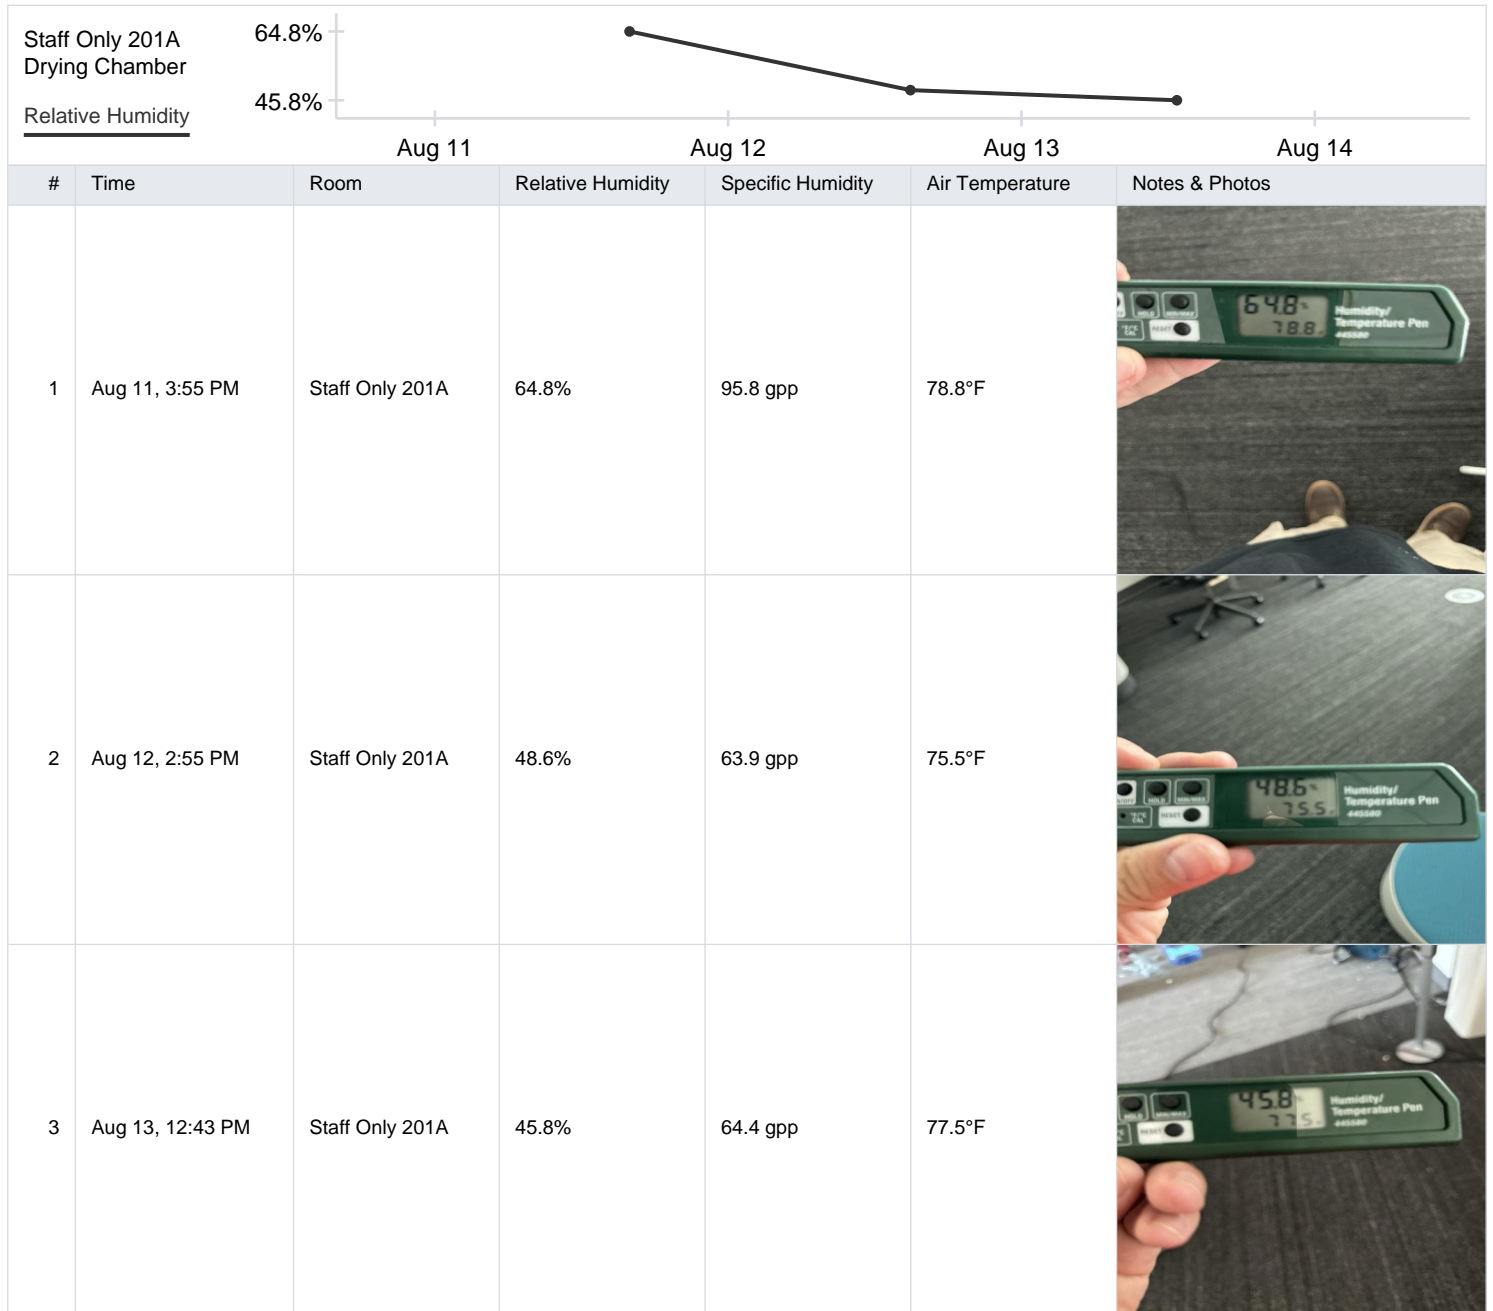

Affected Area: Staff Only 201A

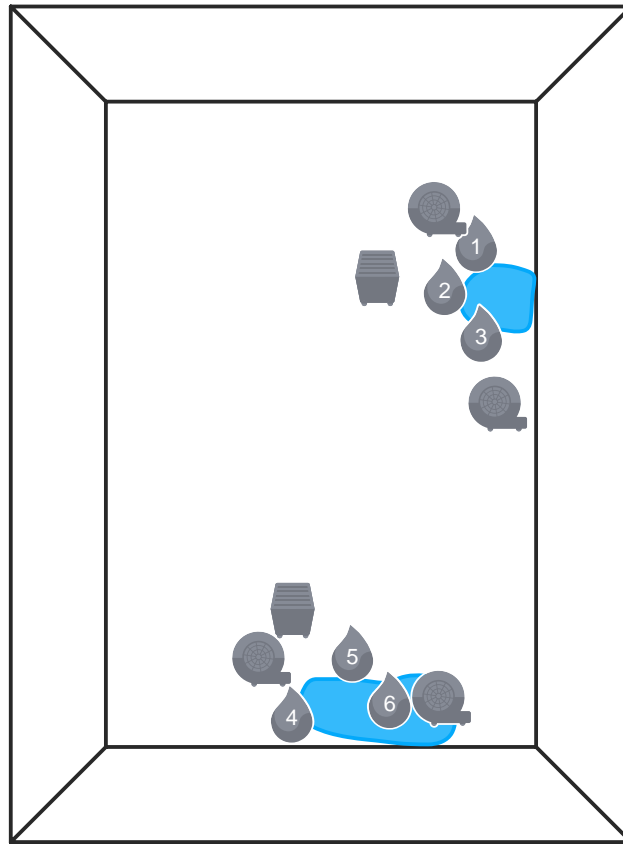


Point 1:

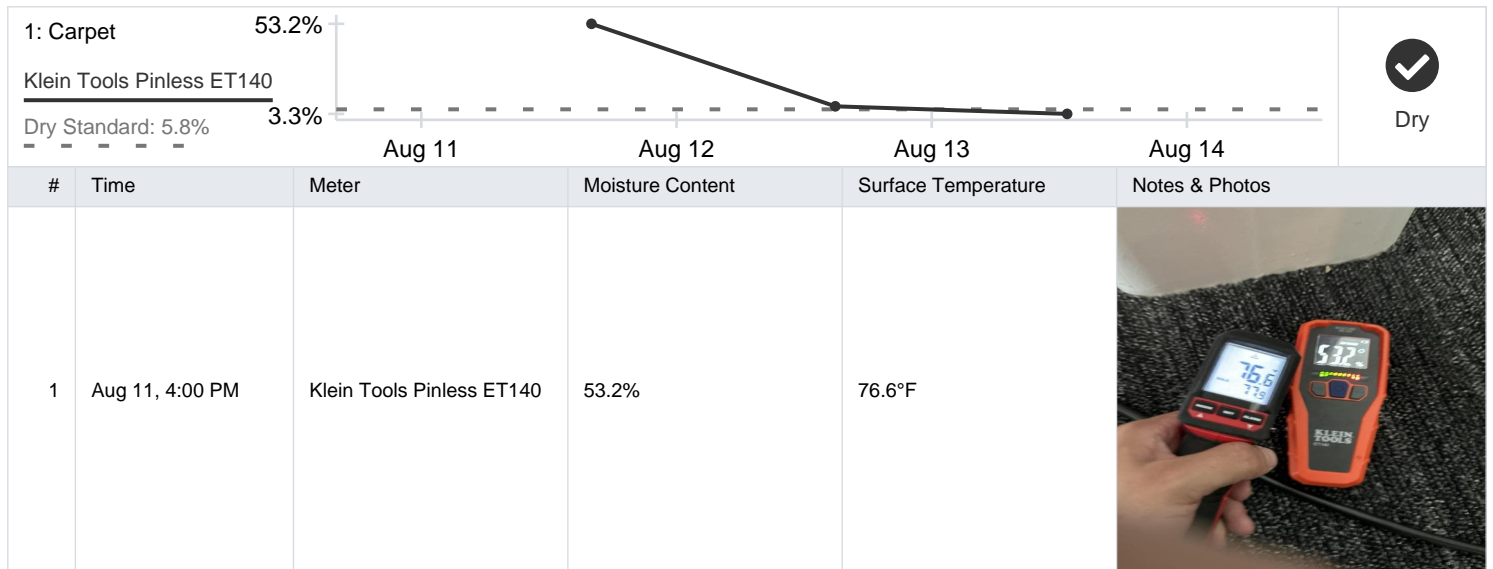


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 2:55 PM	Klein Tools Pinless ET140	7.5%	71.6°F	
3	Aug 13, 12:44 PM	Klein Tools Pinless ET140	3.3%	75°F	

Point 2:

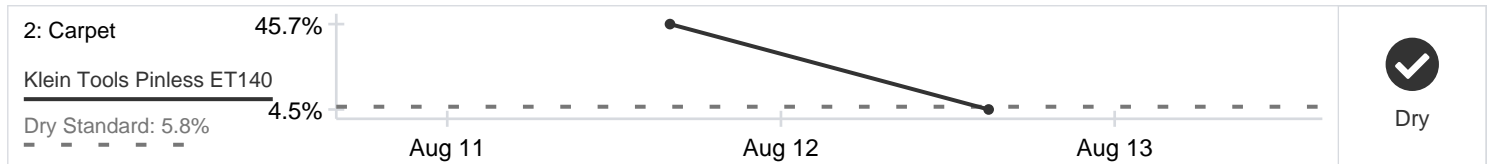



#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 4:01 PM	Klein Tools Pinless ET140	45.7%	79.9°F	
2	Aug 12, 2:56 PM	Klein Tools Pinless ET140	4.5%	76.6°F	

Point 3:

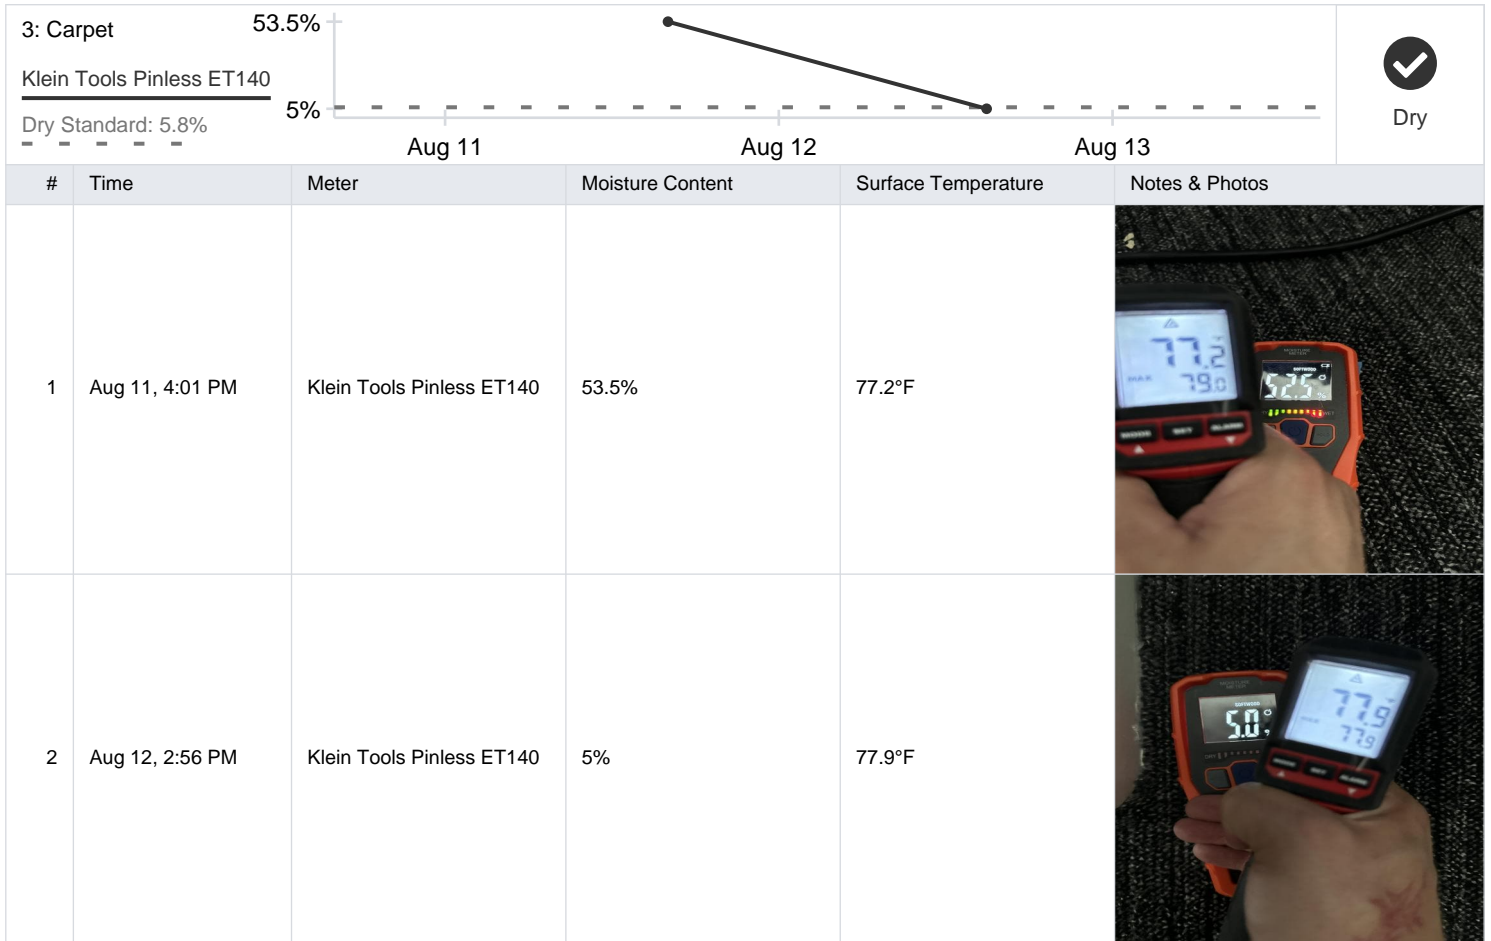

Point 4:

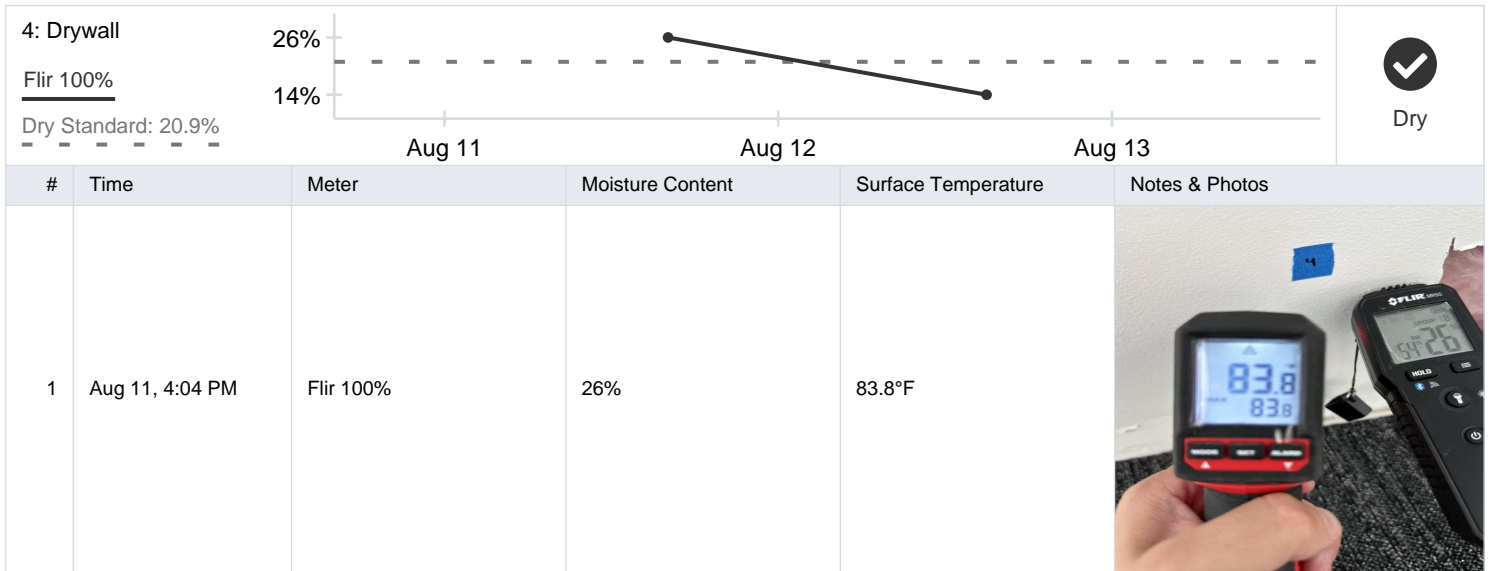


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 2:58 PM	Flir 100%	14%	75.4°F	


Point 5:


5: Drywall

Flir 100%

Dry Standard: 20.9%

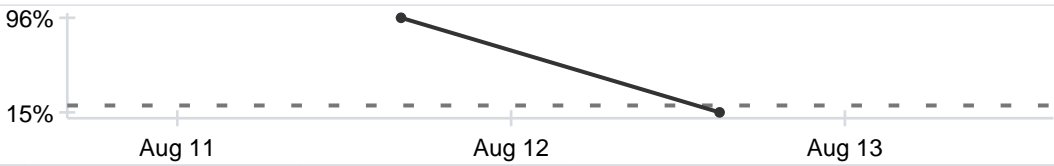


Dry

#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 4:05 PM	Flir 100%	96%	83.8°F	
2	Aug 12, 2:59 PM	Flir 100%	15%	75.7°F	

Point 6:






Equipment List: Staff Only 201A

Dehumidifier: Phoenix DryMax BLE [4038500] (73)


Placed	Removed	Power	Energy usage	Days on site
Aug 11, 4:07 PM	Still on site	0.63 kW	55.50 kWh	4 days




#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 4:09 PM	27%	72.8 gpp	98°F	23 gpp		
2	Aug 12, 3:00 PM	26%	52.8 gpp	89°F	11 gpp		
3	Aug 13, 12:43 PM	25%	52.4 gpp	90°F	12 gpp		

Dehumidifier: Phoenix DryMax BLE [4038500] (71)

Placed Aug 11, 4:08 PM Removed Still on site Power 0.63 kW Energy usage 55.49 kWh Days on site 4 days

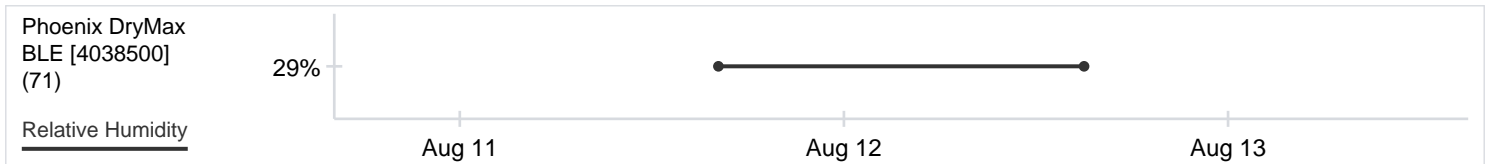

#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 4:09 PM	29%	71.3 gpp	95°F	25 gpp		
2	Aug 12, 3:00 PM	29%	53.6 gpp	86°F	10 gpp		

Dehumidifier: Phoenix DryMax BLE [4038500] (69)

Placed	Removed	Power	Energy usage	Days on site
Aug 11, 4:08 PM	Aug 11, 4:09 PM	0.63 kW	0.01 kWh	1 day

Dehumidifier: Phoenix DryMax BLE [4038500] (42)


Placed	Removed	Power	Energy usage	Days on site
Aug 11, 4:08 PM	Aug 11, 4:08 PM	0.63 kW	0 kWh	1 day

Air Movers: Staff Only 201A


Name	Placed	Removed	Energy usage	Days on site
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (14)	Aug 11, 4:06 PM	Still on site	28.51 kWh	4 days
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (45)	Aug 11, 4:06 PM	Still on site	28.51 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (47)	Aug 11, 4:07 PM	Still on site	16.29 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (45)	Aug 11, 4:07 PM	Still on site	16.29 kWh	4 days

Drying Chamber: Study Room 231

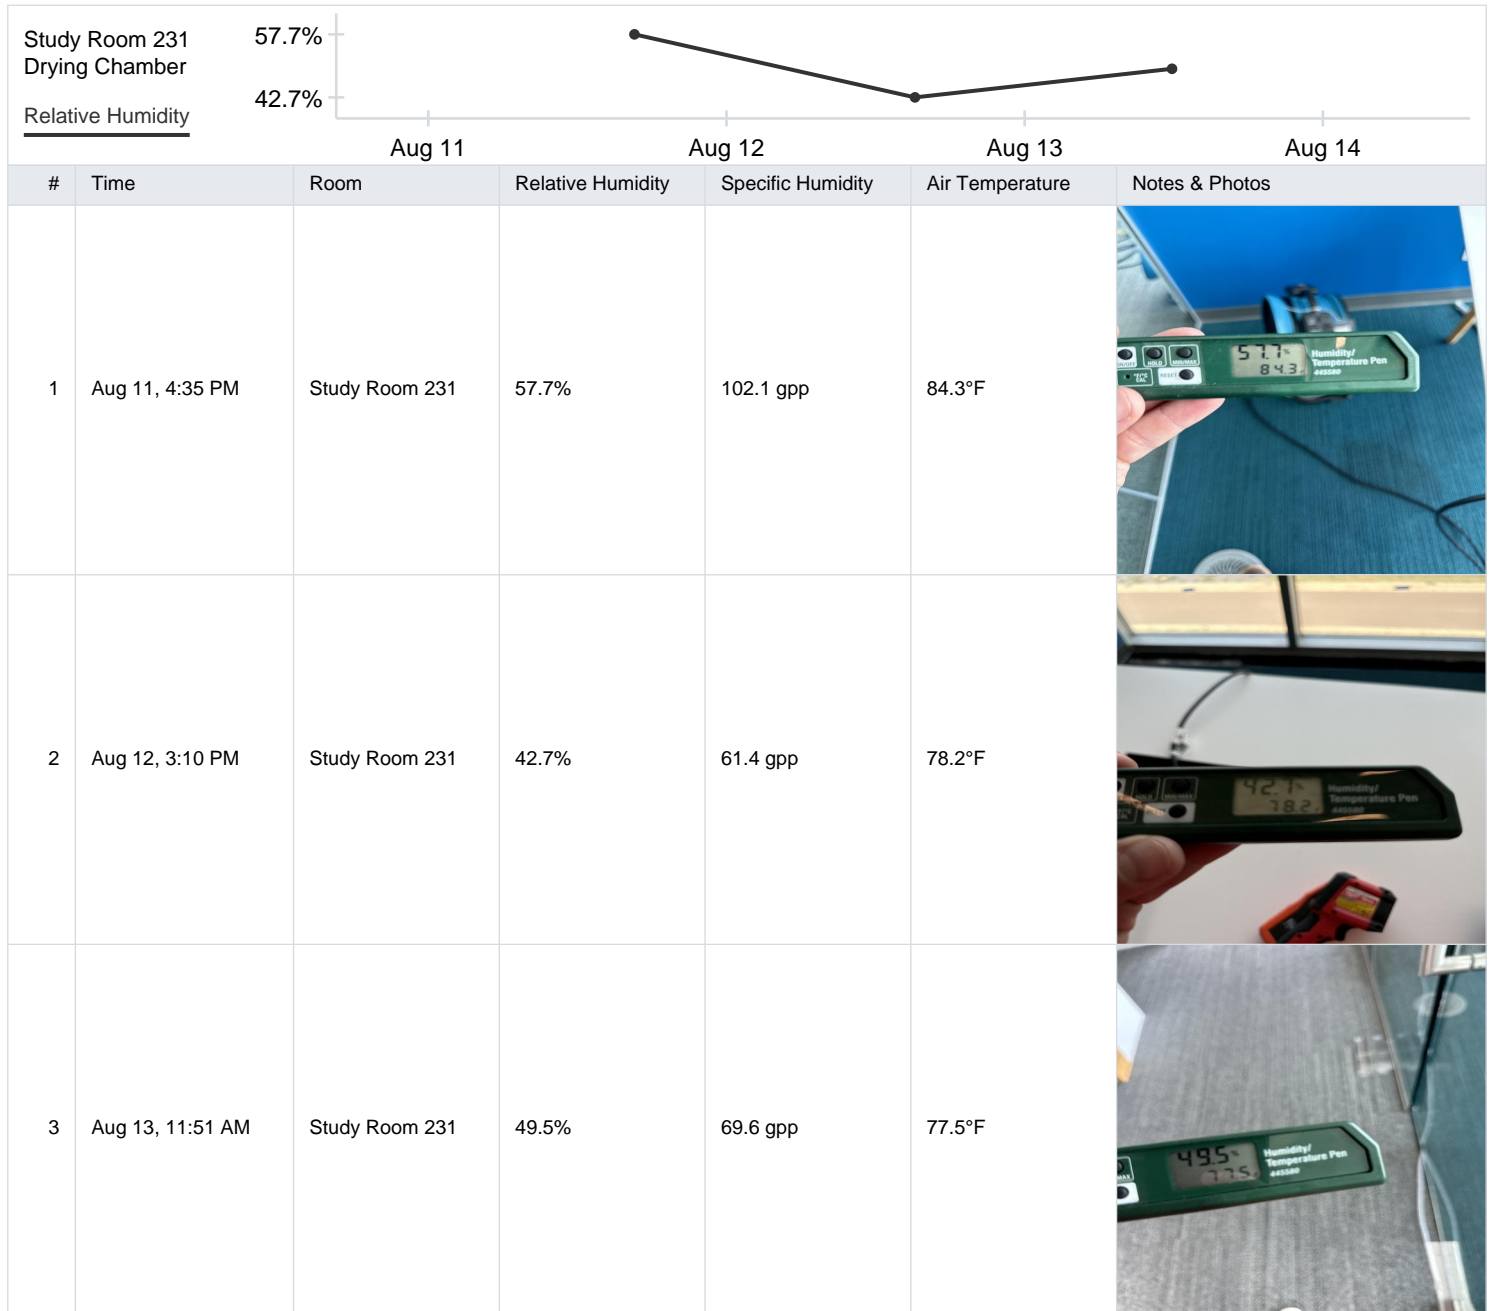

Affected Area Readings

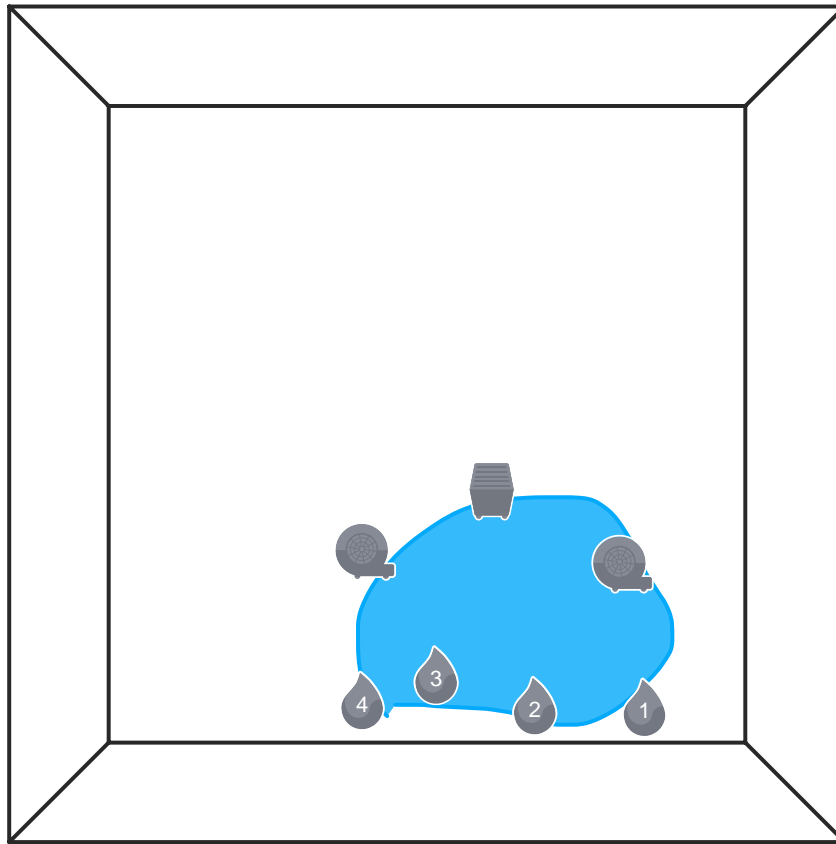

Affected Area: Study Room 231




Point 1:


<p>1: Carpet</p> <p>Klein Tools Pinless ET140 8.3%</p> <p>Dry Standard: 5.8%</p>					 Dry
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 4:39 PM	Klein Tools Pinless ET140	8.3%	84°F	

#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 3:11 PM	Klein Tools Pinless ET140	7.2%	78.6°F	
3	Aug 13, 11:52 AM	Klein Tools Pinless ET140	5%	89.3°F	


Point 2:

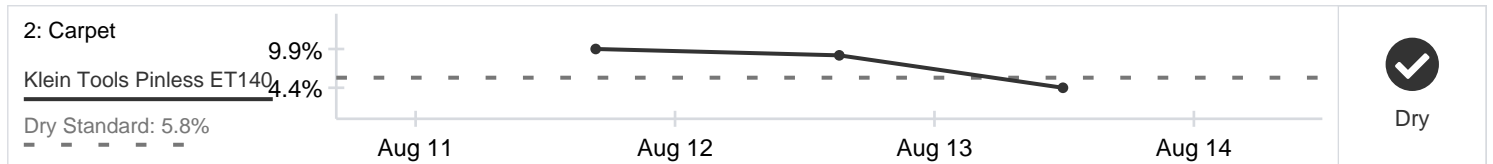




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 4:39 PM	Klein Tools Pinless ET140	9.9%	105.4°F	
2	Aug 12, 3:11 PM	Klein Tools Pinless ET140	9%	85.1°F	

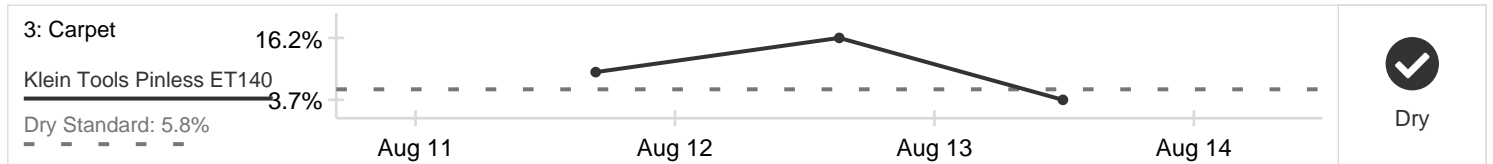


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
3	Aug 13, 11:53 AM	Klein Tools Pinless ET140	4.4%	82.8°F	

Point 3:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 4:40 PM	Klein Tools Pinless ET140	9.3%	90.9°F	
2	Aug 12, 3:11 PM	Klein Tools Pinless ET140	16.2%	86°F	
3	Aug 13, 11:53 AM	Klein Tools Pinless ET140	3.7%	82.8°F	

Point 4:

#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 4:40 PM	Klein Tools Pinless ET140	8%	91.8°F	
2	Aug 12, 3:12 PM	Klein Tools Pinless ET140	9.7%	95°F	
3	Aug 13, 11:53 AM	Klein Tools Pinless ET140	5.3%	83.3°F	

4: Carpet
 Klein Tools Pinless ET140 9.7%
 Dry Standard: 5.8%

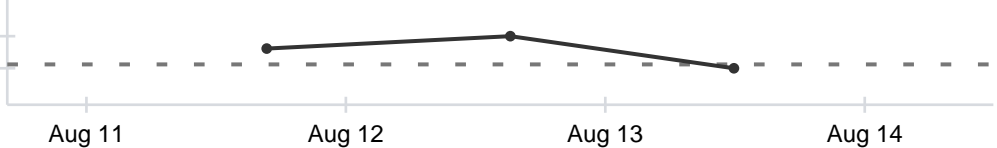


Dry

Equipment List: Study Room 231

Dehumidifier: Phoenix DryMax LGR (72)

Placed Aug 11, 4:45 PM Removed Still on site Power 0.68 kW Energy usage 60.11 kWh Days on site 4 days

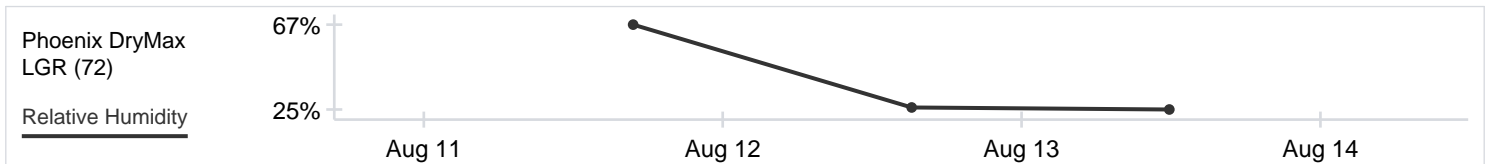

#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 4:48 PM	67%	103.1 gpp	80°F	-1 gpp		
2	Aug 12, 3:10 PM	26%	56.3 gpp	91°F	5 gpp		
3	Aug 13, 11:51 AM	25%	57.6 gpp	93°F	12 gpp		

Air Movers: Study Room 231


Name	Placed	Removed	Energy usage	Days on site
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (294)	Aug 11, 4:45 PM	Still on site	28.30 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (56)	Aug 11, 4:45 PM	Still on site	16.17 kWh	4 days

Drying Chamber: Staff Only 105


Affected Area Readings



Affected Area: Staff Only 115

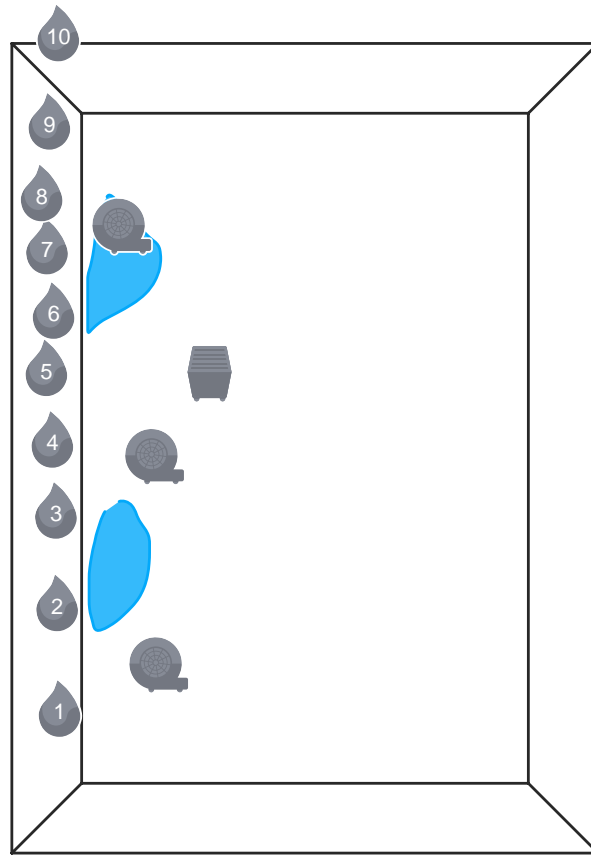


Point 1:

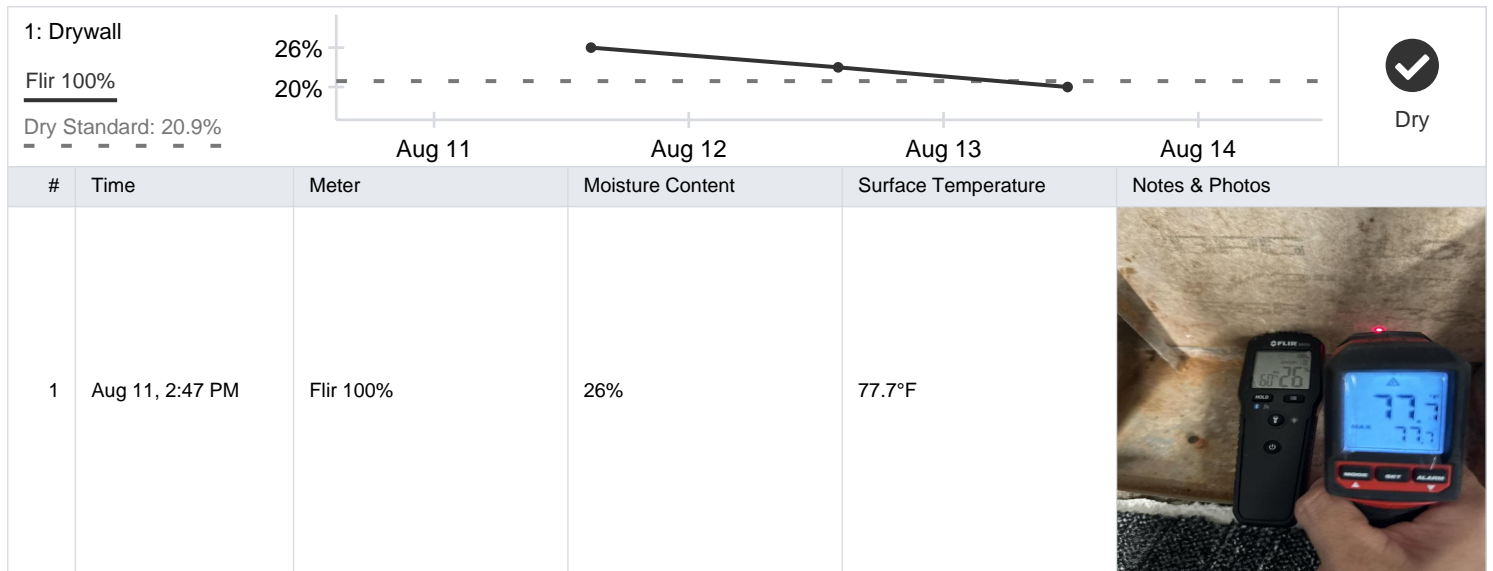


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 2:04 PM	Flir 100%	23%	75.6°F	
3	Aug 13, 11:41 AM	Flir 100%	20%	76.8°F	

Point 2:

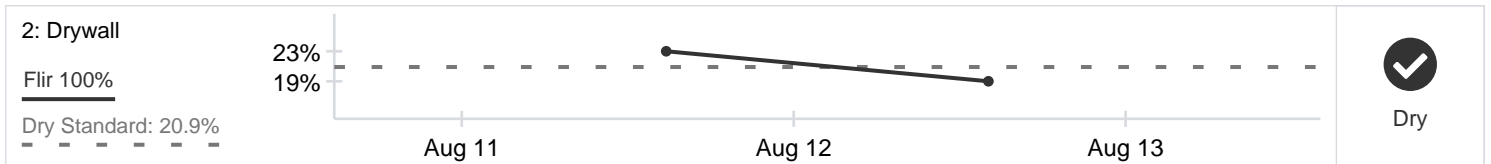



#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 2:46 PM	Flir 100%	23%	76.3°F	
2	Aug 12, 2:04 PM	Flir 100%	19%	75.7°F	

Point 3:

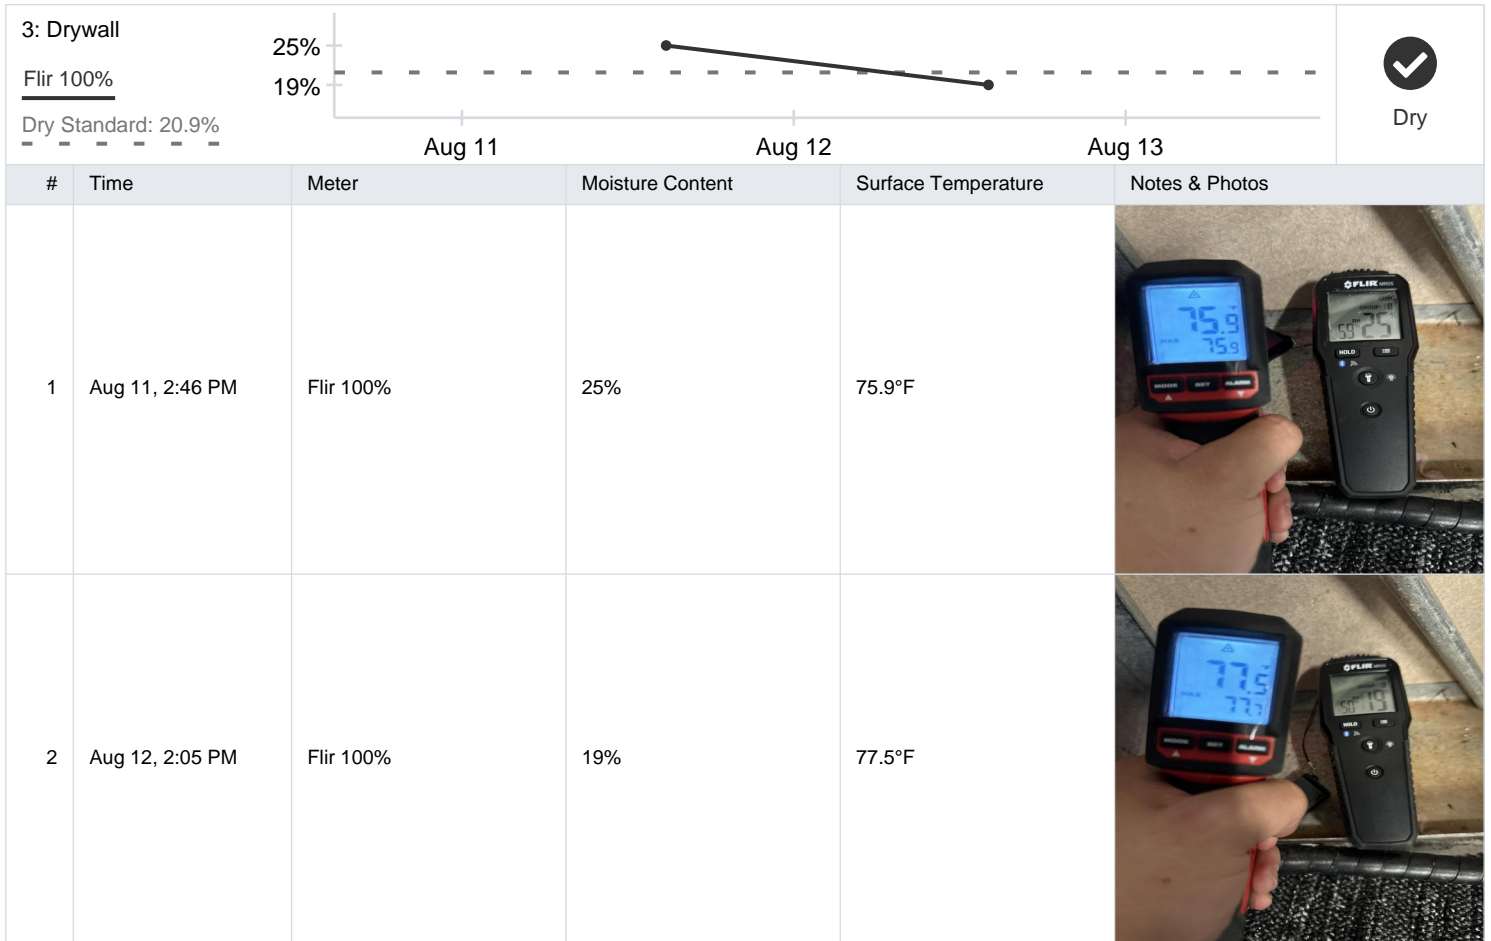

Point 4:

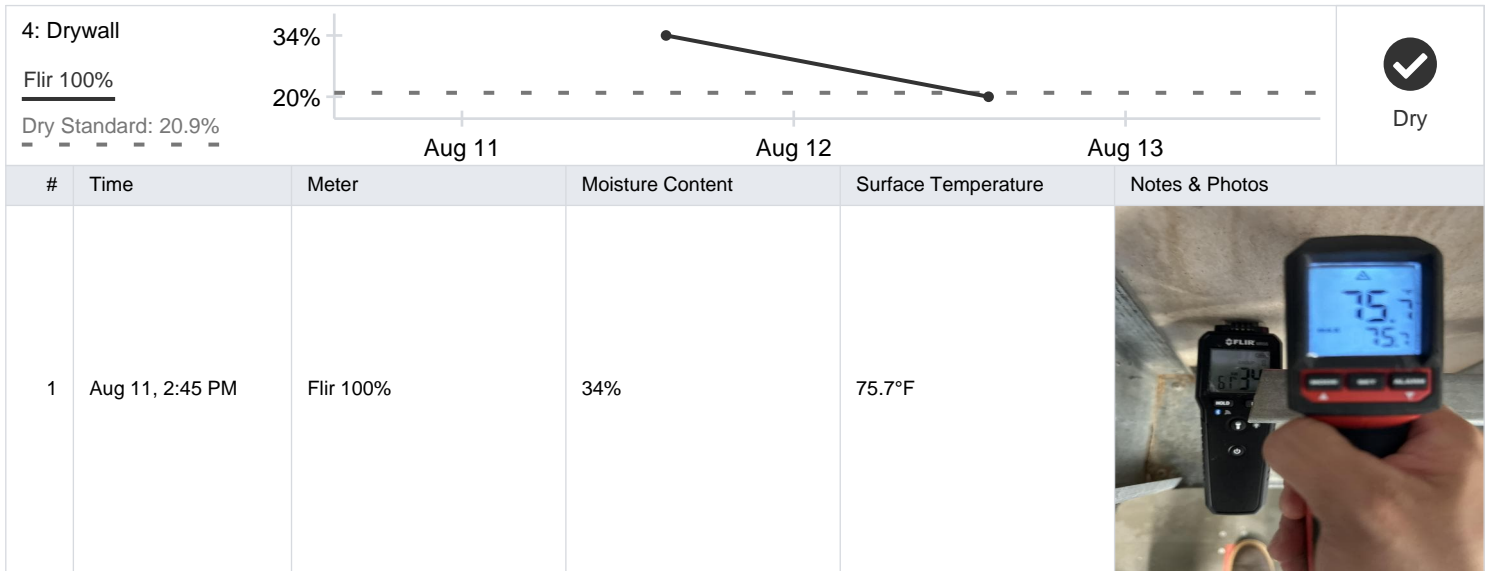

#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 2:05 PM	Flir 100%	20%	76.8°F	

Point 5:

5: Drywall

Flir 100%

Dry Standard: 20.9%





 Dry

#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 2:45 PM	Flir 100%	95%	75.9°F	
2	Aug 12, 2:05 PM	Flir 100%	18%	76.8°F	

Point 6:


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 2:44 PM	Flir 100%	27%	76.5°F	
2	Aug 12, 2:06 PM	Flir 100%	21%	77.4°F	
3	Aug 13, 11:42 AM	Flir 100%	21%	74.3°F	
4	Aug 13, 11:42 AM	Flir 100%	20%	76.3°F	

6: Drywall
 Flir 100%
 Dry Standard: 20.9%

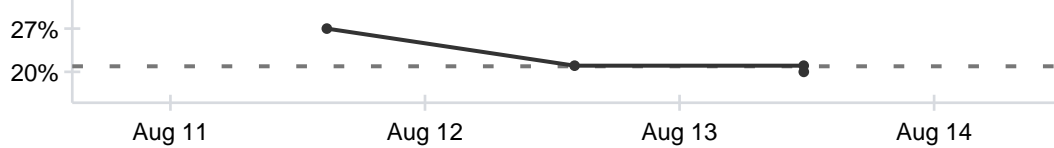



Dry

Point 7:

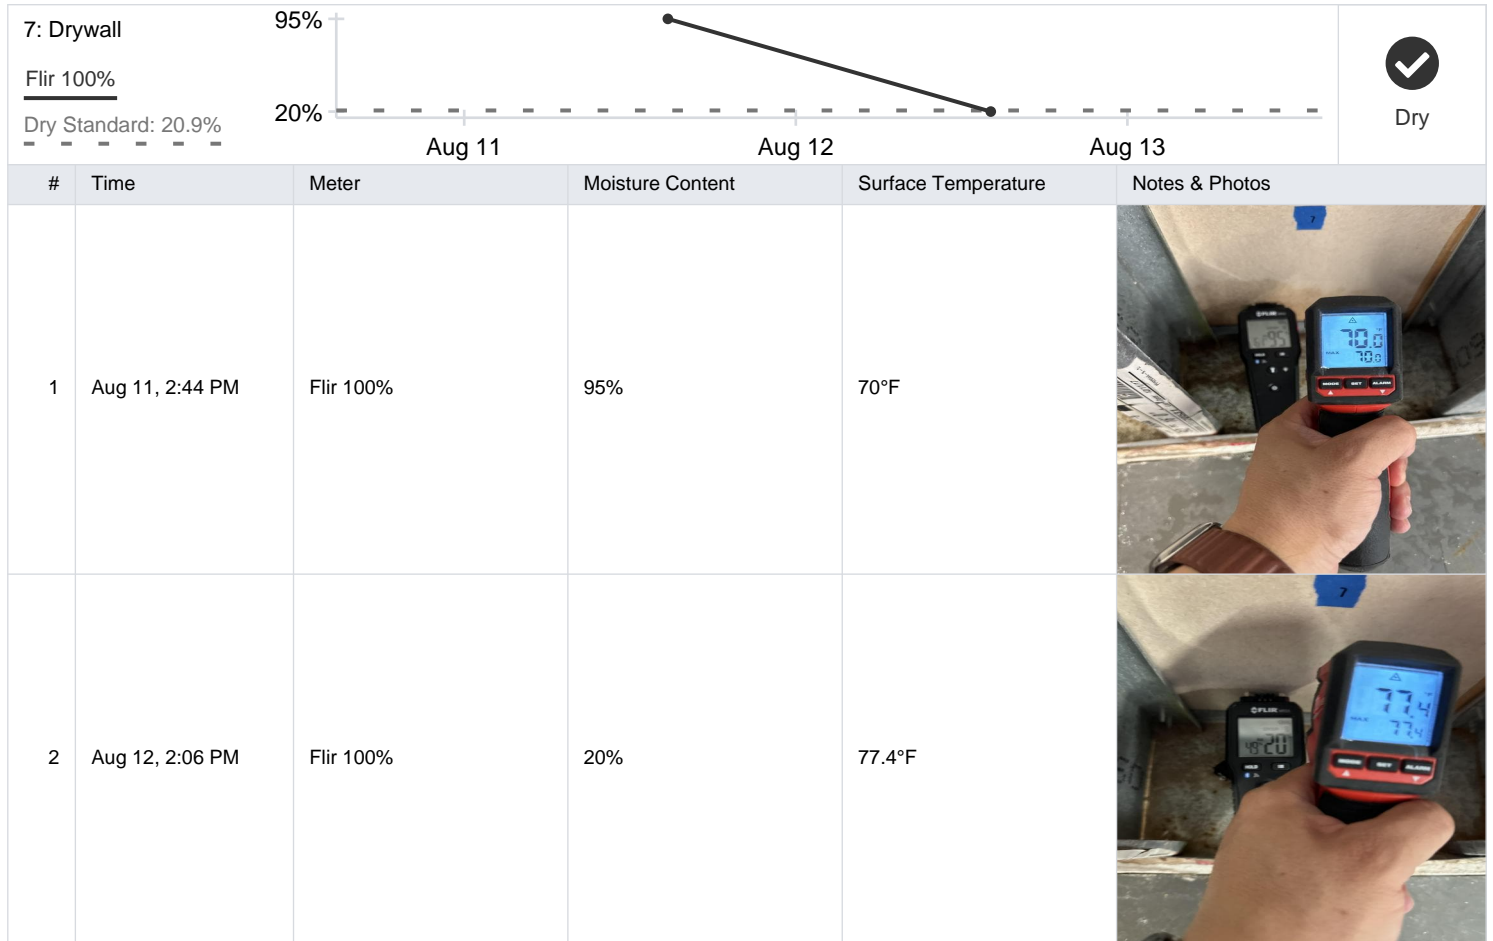


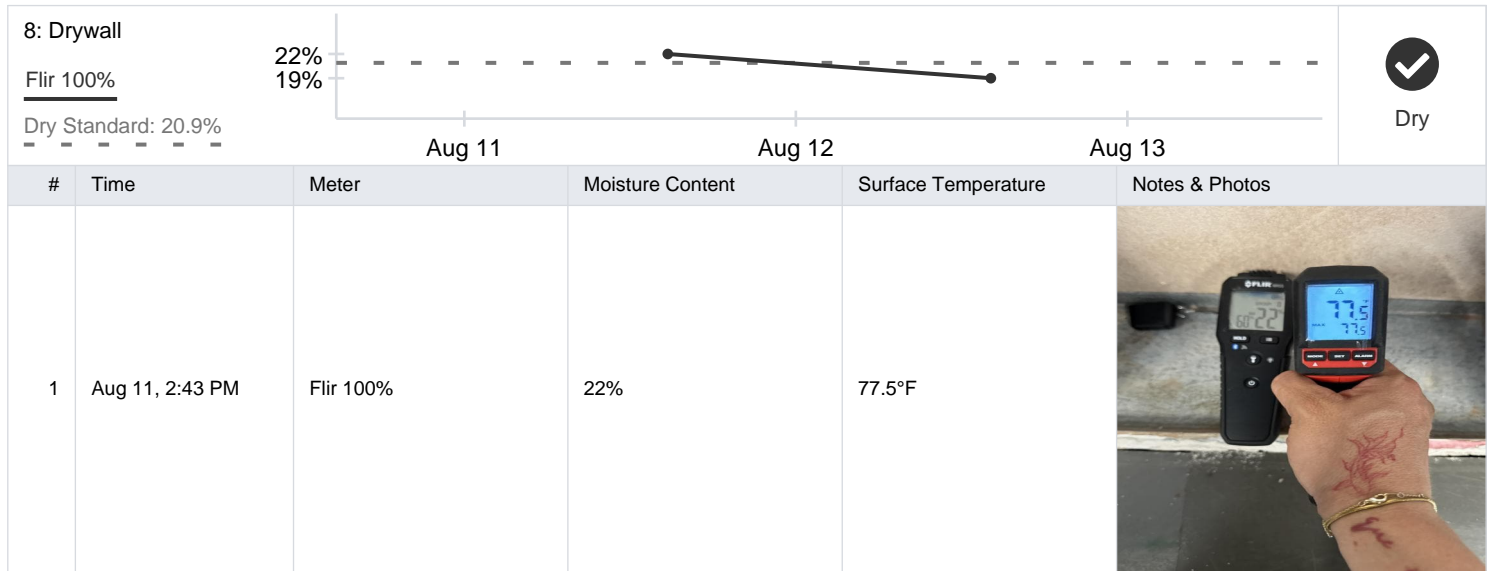


Point 8:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 2:06 PM	Flir 100%	19%	76.6°F	

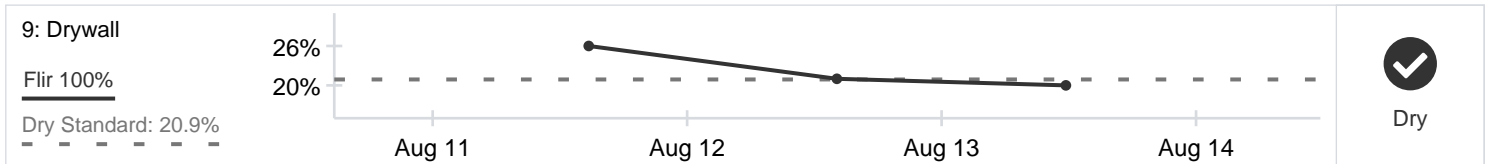Point 9:



#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 2:43 PM	Flir 100%	26%	77.5°F	
2	Aug 12, 2:07 PM	Flir 100%	21%	76.6°F	
3	Aug 13, 11:43 AM	Flir 100%	20%	73.2°F	


Point 10:

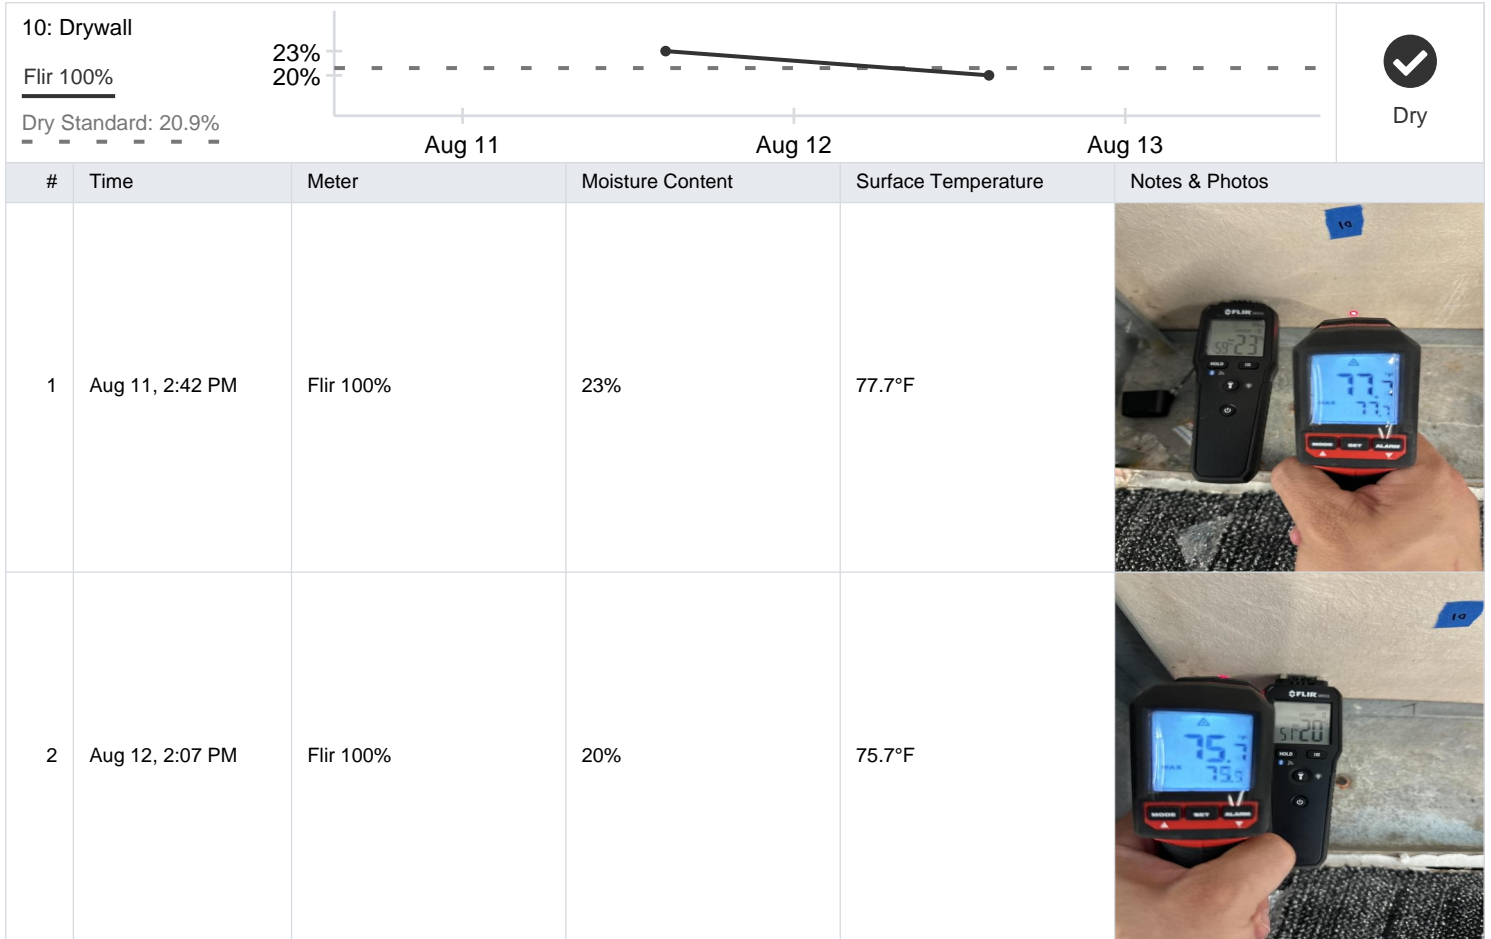

Equipment List: Staff Only 115

Dehumidifier: ALORAIR Storm LGR Extreme [STORMLGREXTREME] (01)

Placed	Removed	Power	Energy usage	Days on site
Aug 11, 2:48 PM	Still on site	0.64 kW	57.85 kWh	4 days

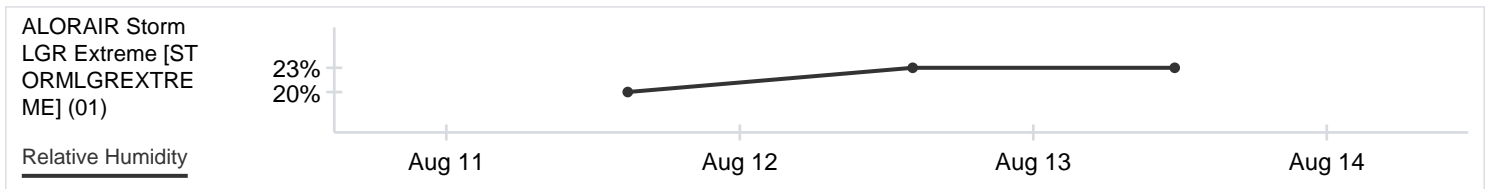


#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 2:50 PM	20%	57.1 gpp	100°F	38 gpp		
2	Aug 12, 2:08 PM	23%	46.7 gpp	89°F	31 gpp		
3	Aug 13, 11:33 AM	23%	46.7 gpp	89°F	52 gpp		

Air Movers: Staff Only 115


Name	Placed	Removed	Energy usage	Days on site
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (5)	Aug 11, 2:49 PM	Still on site	28.92 kWh	4 days
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (2)	Aug 11, 2:49 PM	Aug 13, 11:53 AM	14.51 kWh	2 days
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (1)	Aug 11, 2:49 PM	Aug 13, 11:53 AM	14.51 kWh	2 days

Drying Chamber: Childrens Area


Affected Area Readings

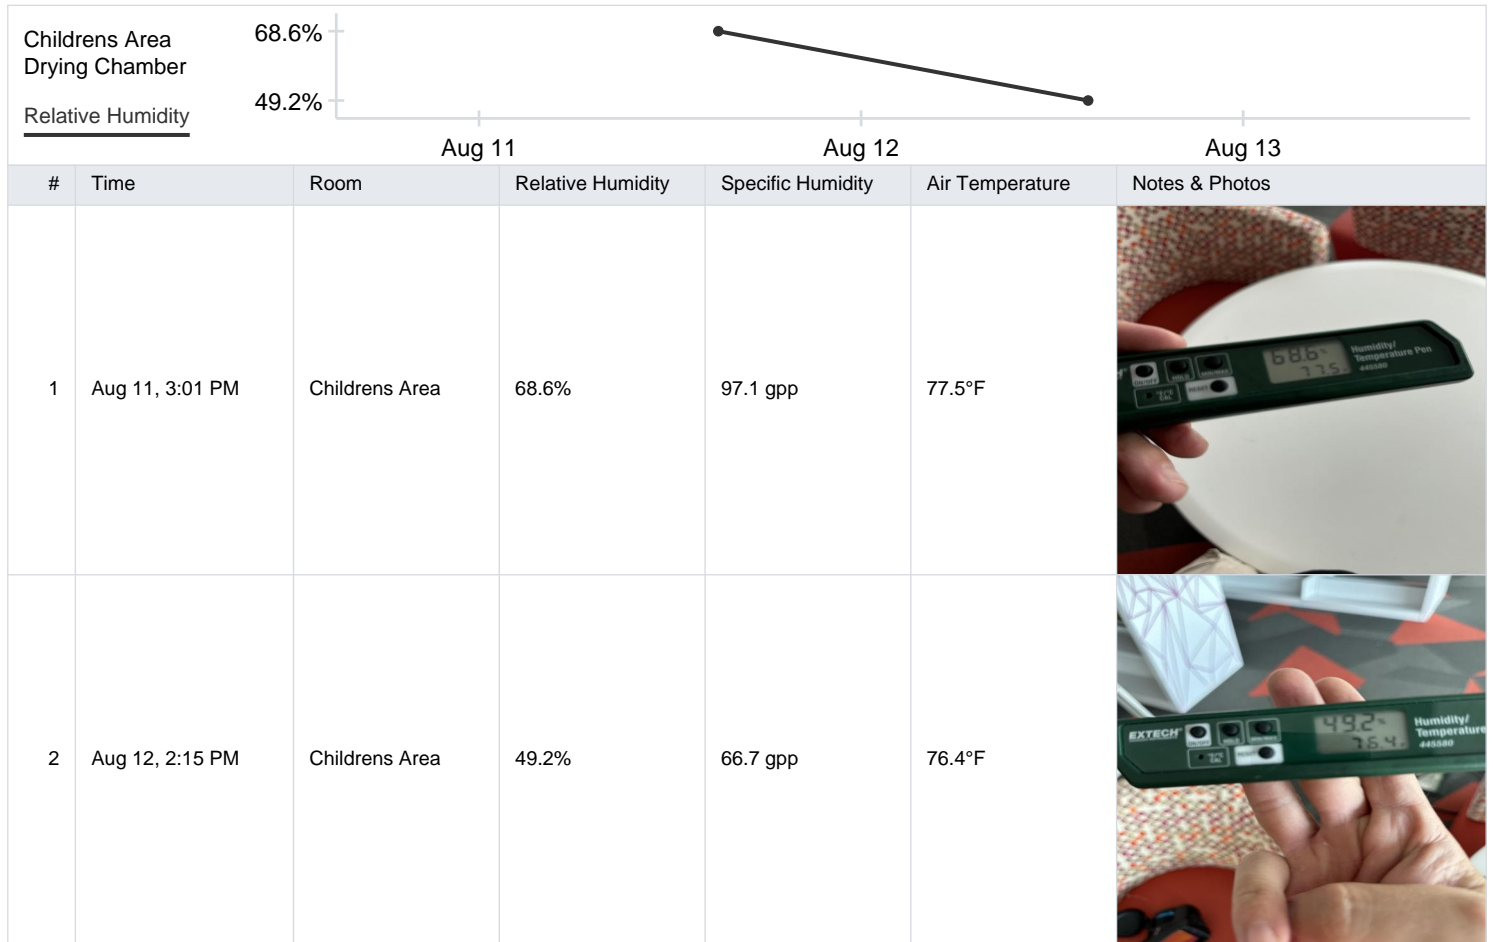


Affected Area: Childrens Area

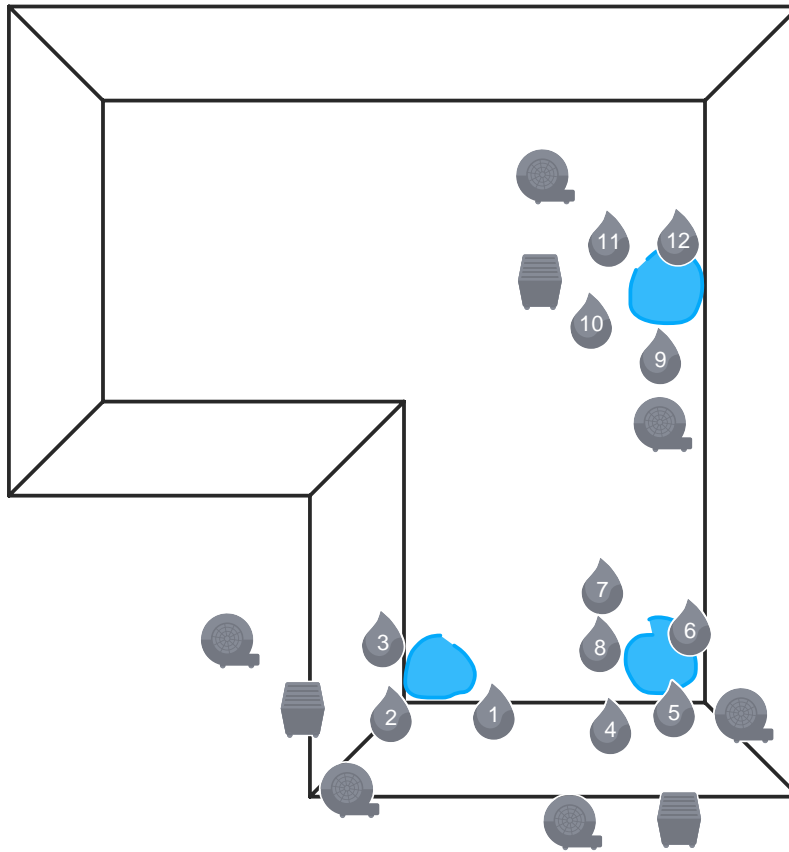


Point 1:

#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 3:10 PM	Klein Tools Pinless ET140	100%	82.2°F	


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 2:24 PM	Klein Tools Pinless ET140	17.2%	78.4°F	

Point 2:

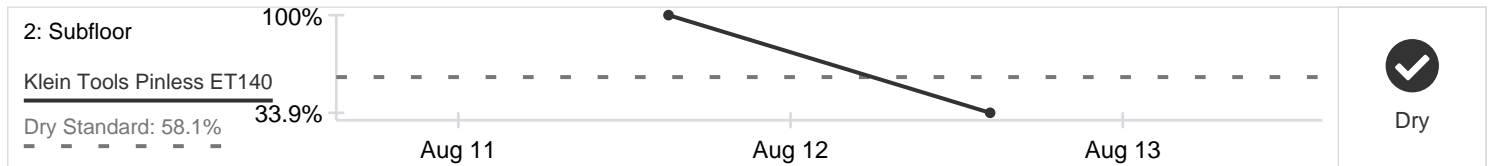



#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 3:11 PM	Klein Tools Pinless ET140	100%	82.2°F	
2	Aug 12, 2:25 PM	Klein Tools Pinless ET140	33.9%	77.5°F	

Point 3:

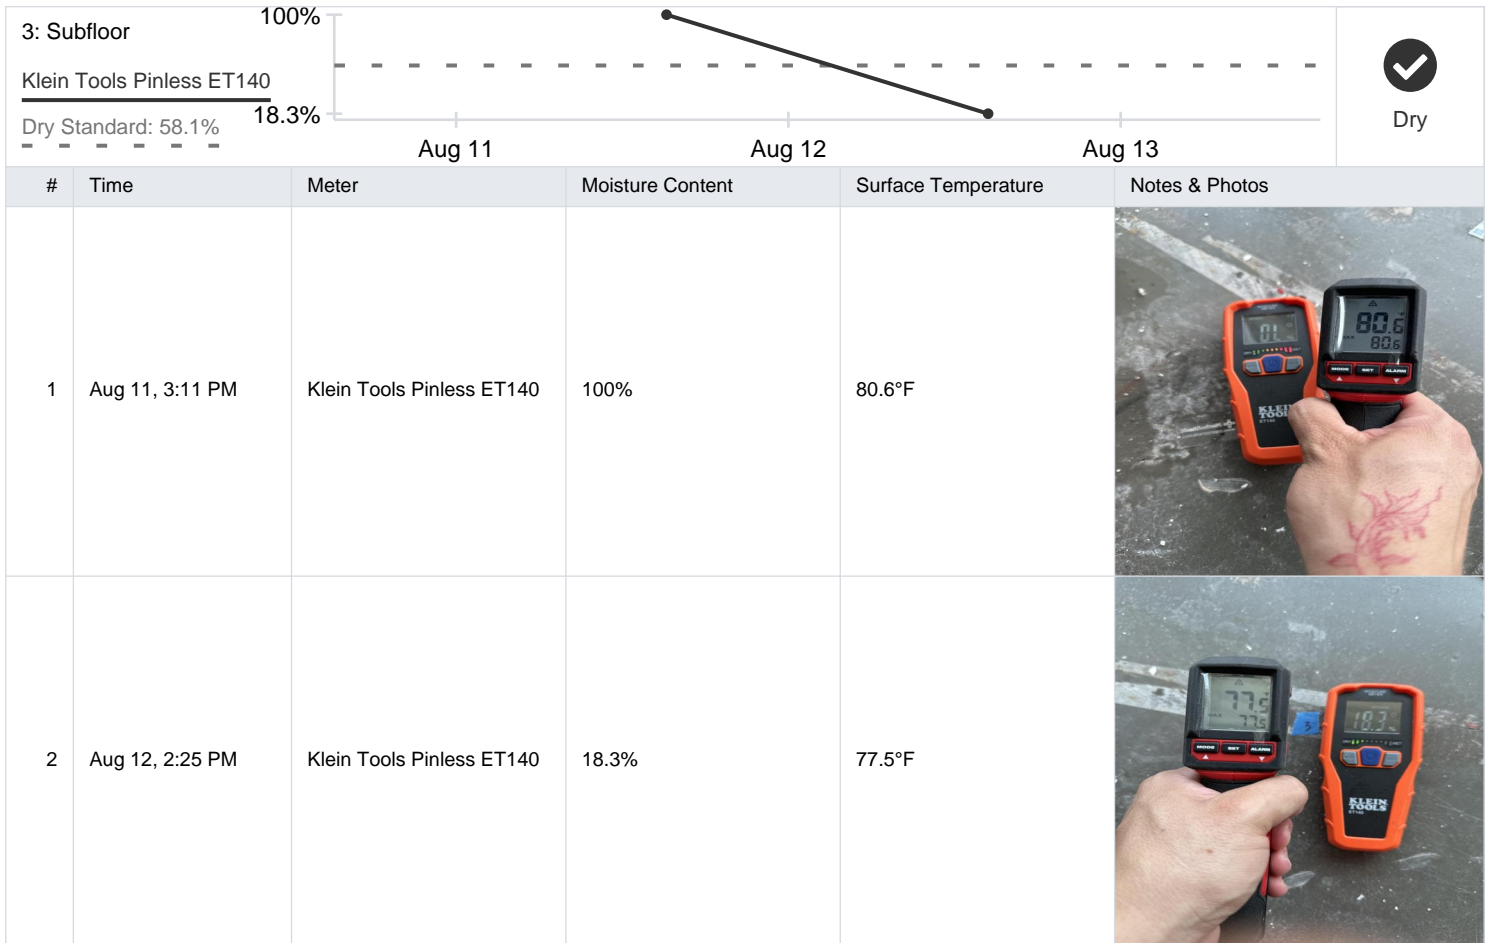


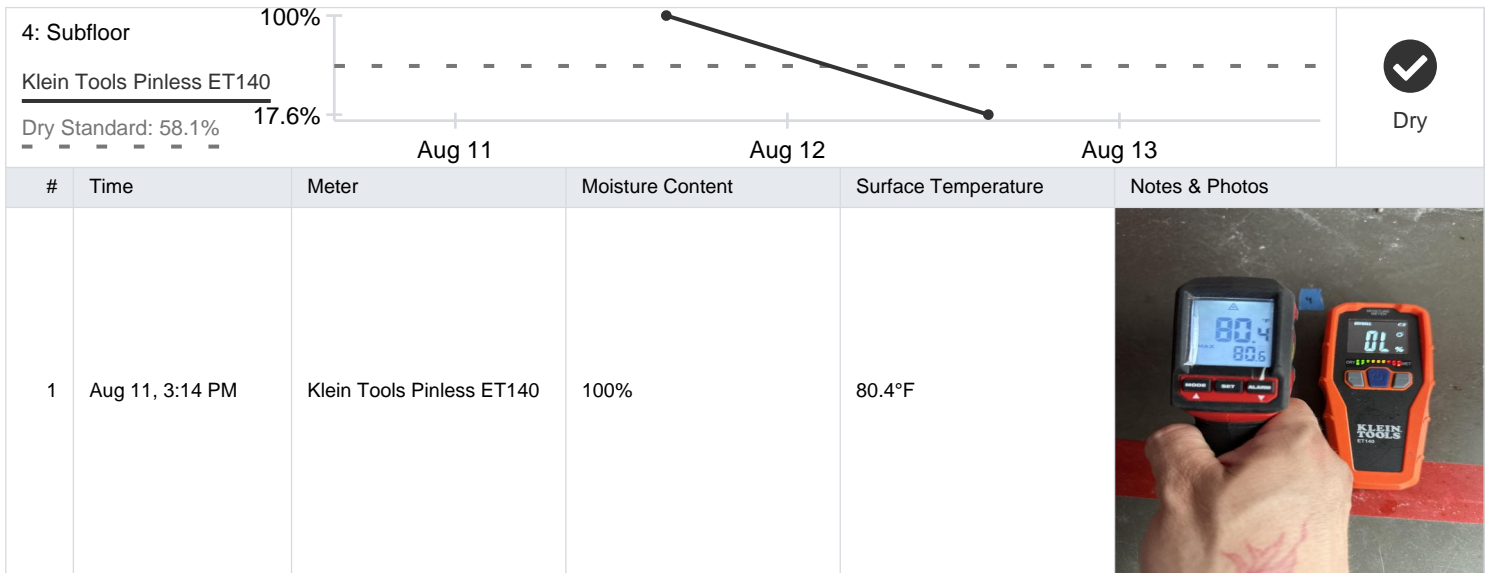

Point 4:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 2:31 PM	Klein Tools Pinless ET140	17.6%	81.1°F	

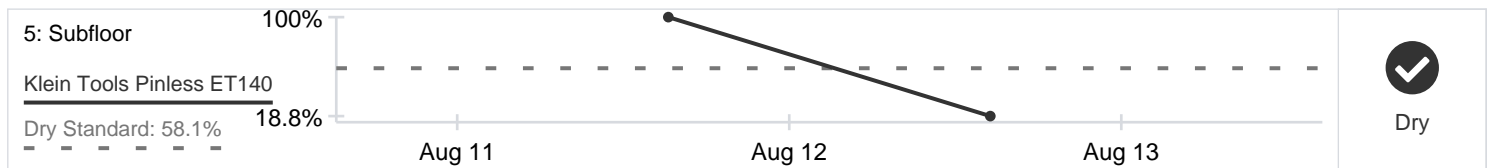Point 5:





#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 3:15 PM	Klein Tools Pinless ET140	100%	75.7°F	
2	Aug 12, 2:31 PM	Klein Tools Pinless ET140	18.8%	79°F	

Point 6:

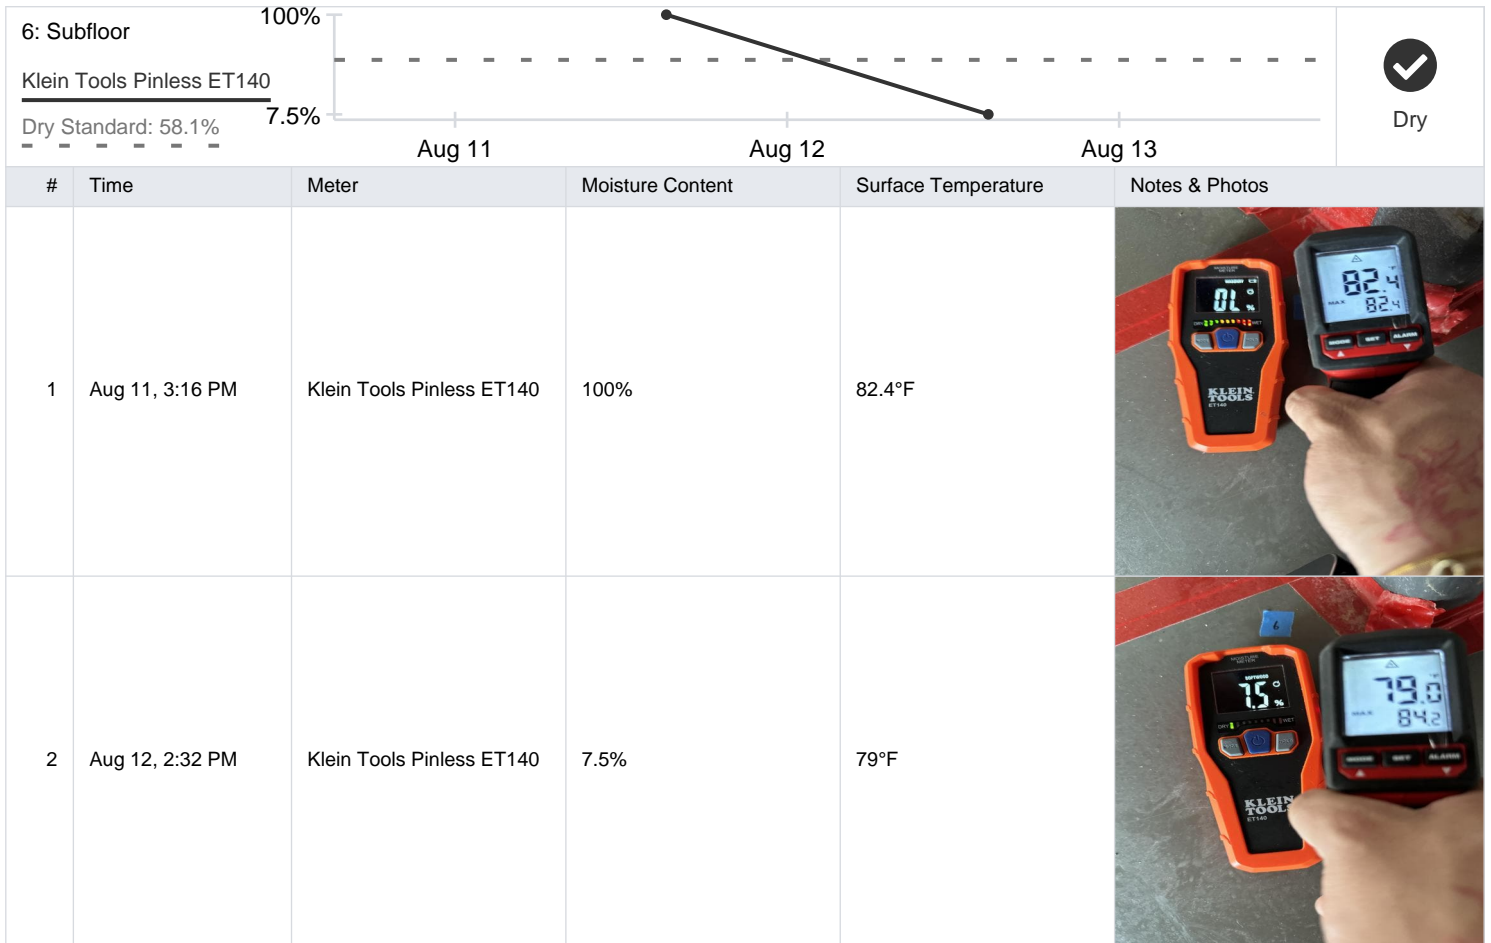


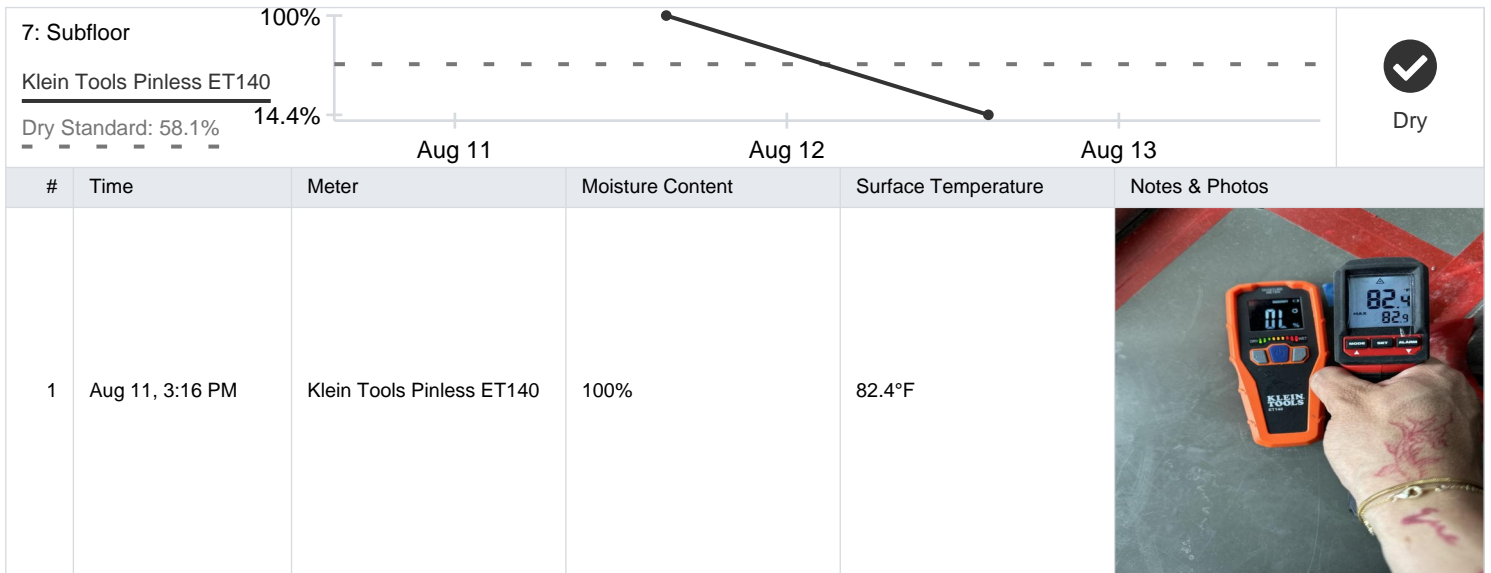

Point 7:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 2:33 PM	Klein Tools Pinless ET140	14.4%	79°F	

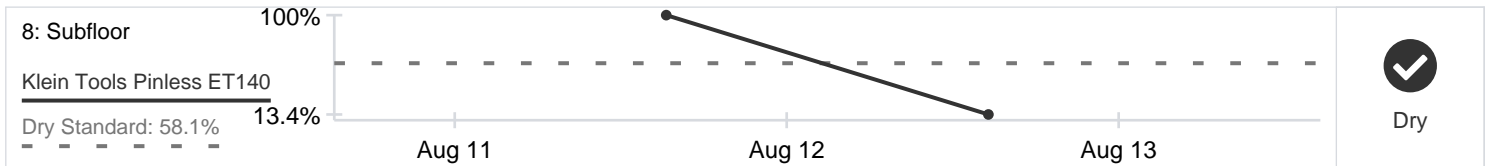Point 8:





#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 3:17 PM	Klein Tools Pinless ET140	100%	81.1°F	
2	Aug 12, 2:34 PM	Klein Tools Pinless ET140	13.4%	79.3°F	

Point 9:

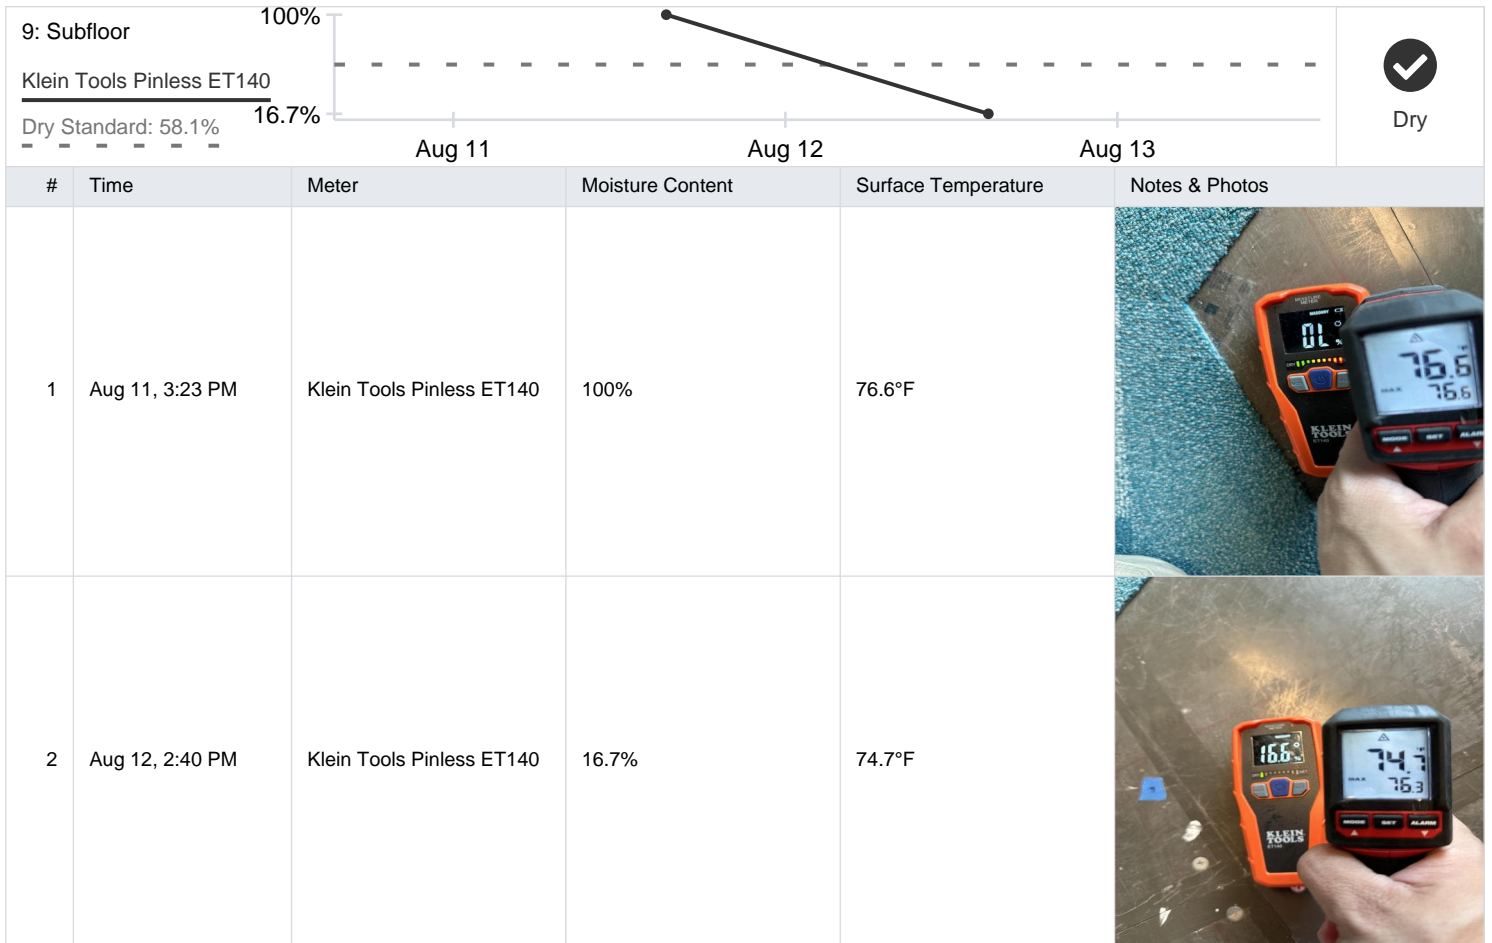


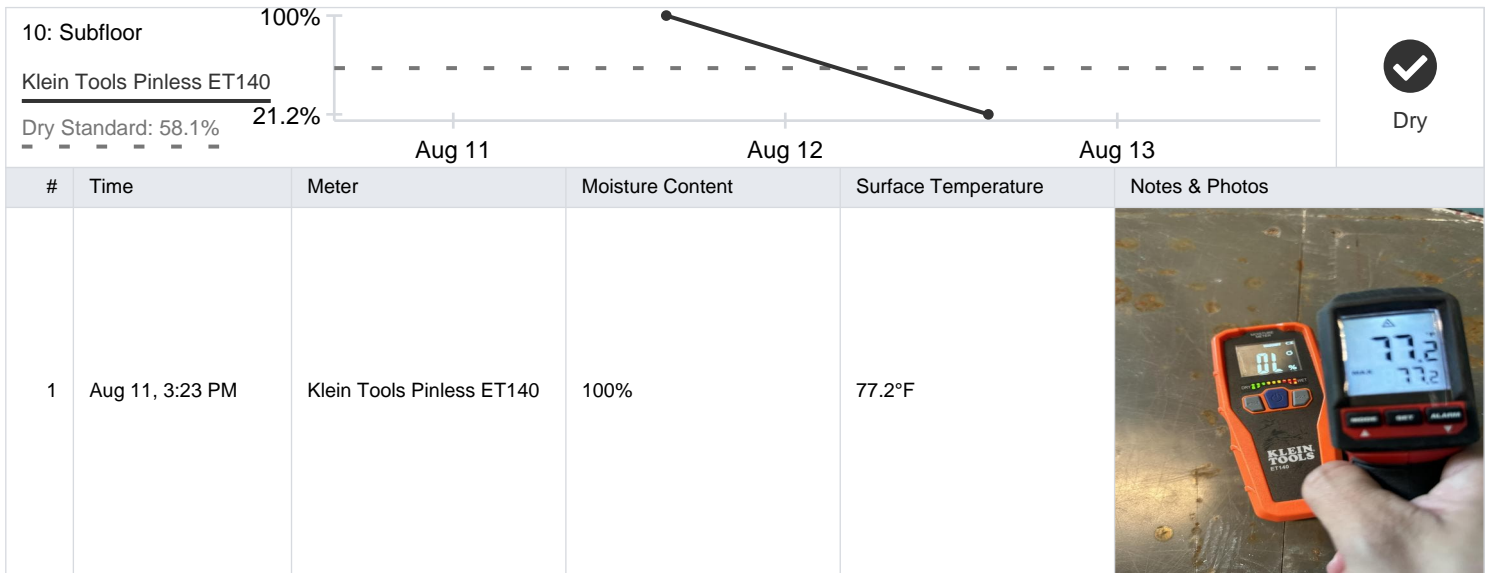

Point 10:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 2:40 PM	Klein Tools Pinless ET140	21.2%	75.4°F	

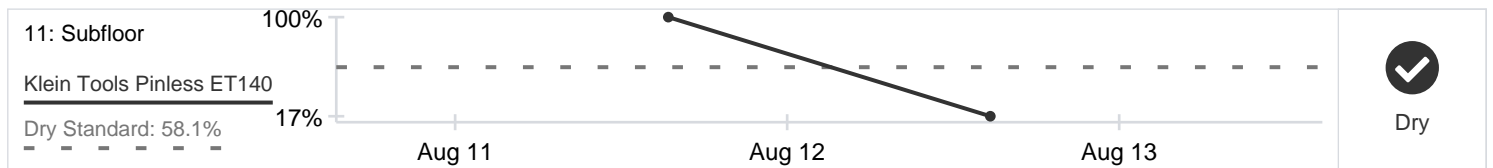Point 11:



#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 3:24 PM	Klein Tools Pinless ET140	100%	77.2°F	
2	Aug 12, 2:41 PM	Klein Tools Pinless ET140	17%	75.9°F	


Point 12:

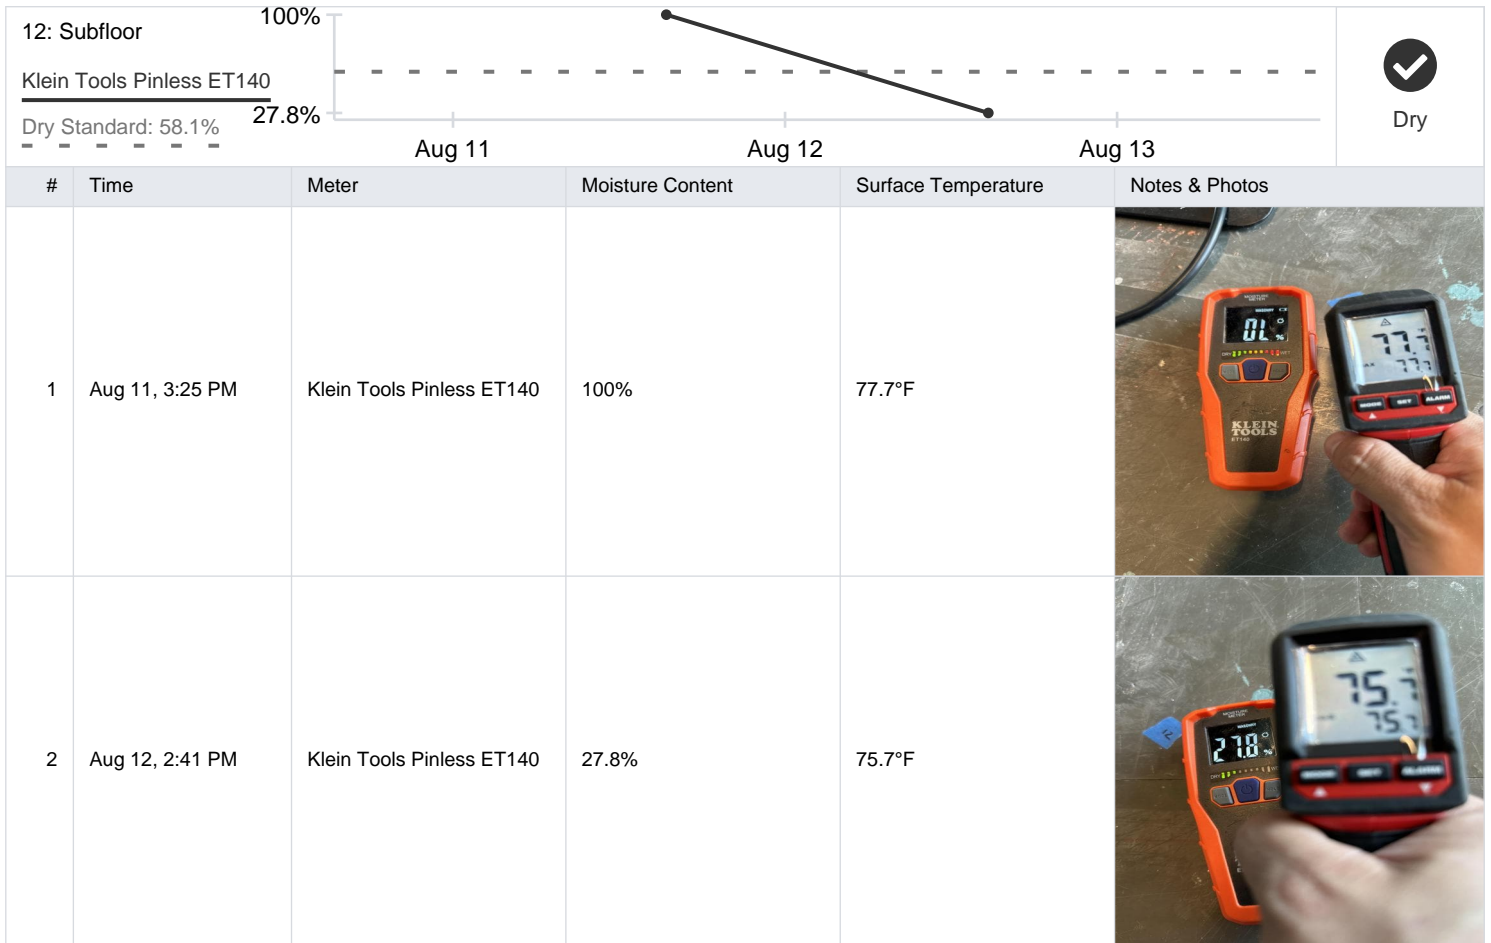



Equipment List: Childrens Area

Dehumidifier: ALORAIR Storm LGR Extreme [STORMLGREXTREME] (1)

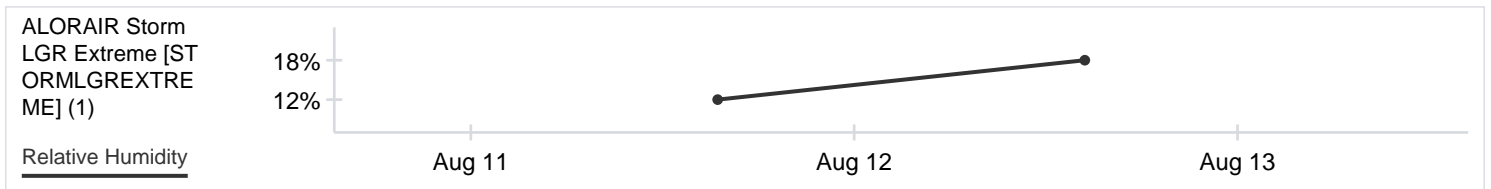Placed	Removed	Power	Energy usage	Days on site
Aug 11, 3:26 PM	Still on site	0.64 kW	57.44 kWh	4 days




#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 3:27 PM	12%	44.5 gpp	109°F	53 gpp		
2	Aug 12, 2:26 PM	18%	45.4 gpp	96°F	21 gpp		


Dehumidifier: ALORAIR Storm LGR Extreme [STORMLGREXTREME] (02)


Placed Aug 11, 3:28 PM Removed Still on site Power 0.64 kW Energy usage 57.43 kWh Days on site 4 days

ALORAIR Storm LGR Extreme [STORMLGREXTREME] (02)

Relative Humidity

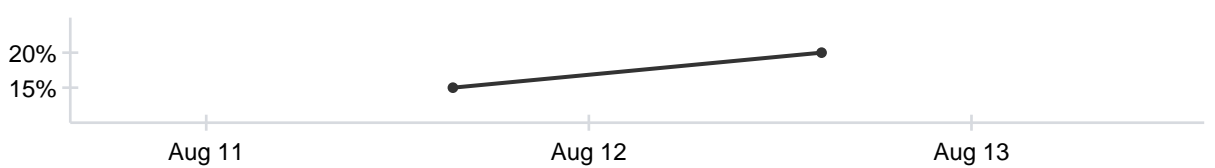




#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 3:28 PM	15%	55.8 gpp	109°F	41 gpp		


#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
2	Aug 12, 2:35 PM	20%	48.9 gpp	95°F	18 gpp		

Dehumidifier: ALORAIR Storm LGR Extreme [STORMLGREXTREME] (2)

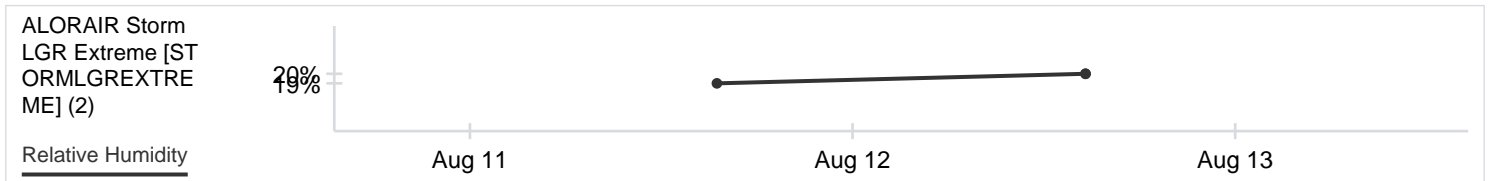Placed Aug 11, 3:29 PM Removed Still on site Power 0.64 kW Energy usage 57.42 kWh Days on site 4 days



#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 3:29 PM	19%	75.2 gpp	111°F	22 gpp		
2	Aug 12, 2:36 PM	20%	53.7 gpp	98°F	13 gpp		


#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
3	Aug 12, 2:36 PM	20%	53.7 gpp	98°F	13 gpp		

Air Movers: Childrens Area


Name	Placed	Removed	Energy usage	Days on site
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (3)	Aug 11, 3:26 PM	Still on site	28.72 kWh	4 days
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (4)	Aug 11, 3:26 PM	Still on site	28.72 kWh	4 days
Xpower XL-760AM (34)	Aug 11, 3:27 PM	Still on site	23.59 kWh	4 days
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (43)	Aug 11, 3:27 PM	Still on site	28.72 kWh	4 days
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (48)	Aug 11, 3:28 PM	Still on site	28.71 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (38)	Aug 11, 3:28 PM	Still on site	16.41 kWh	4 days

Drying Chamber: Staff Only 212


Affected Area Readings

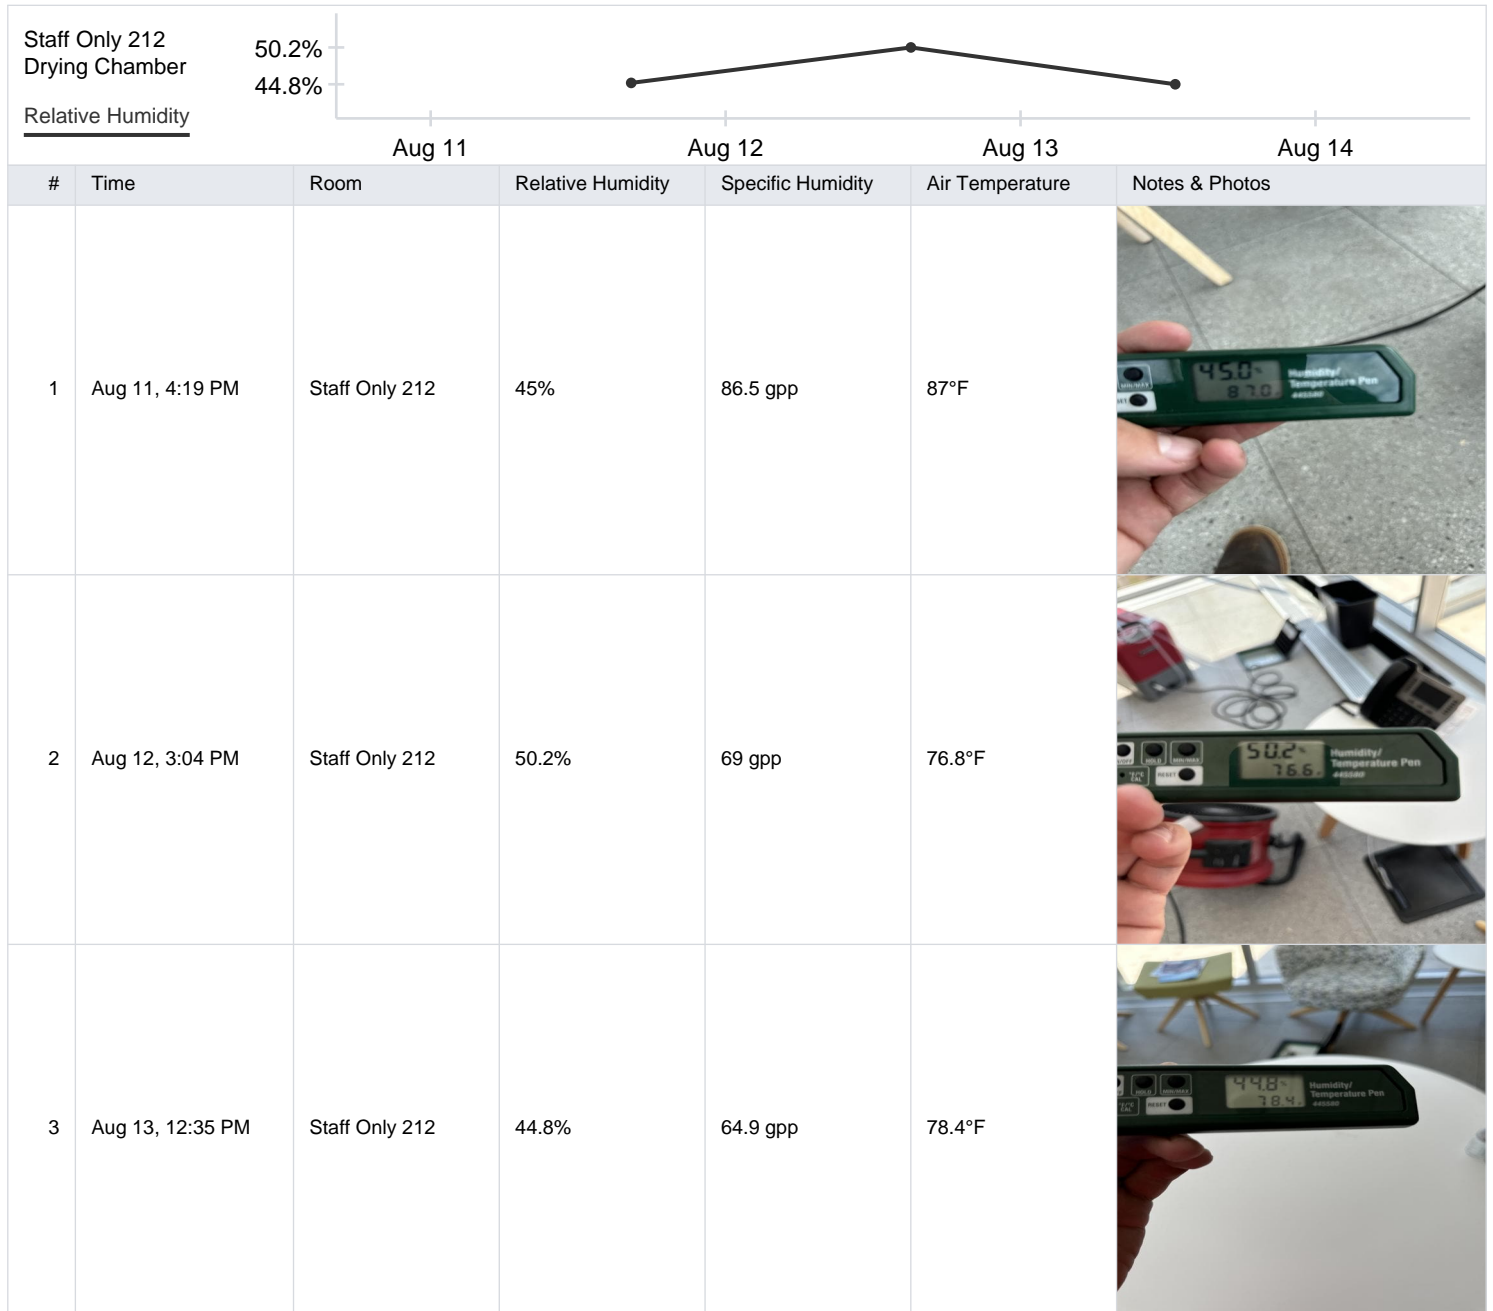



Affected Area: Staff Only 212

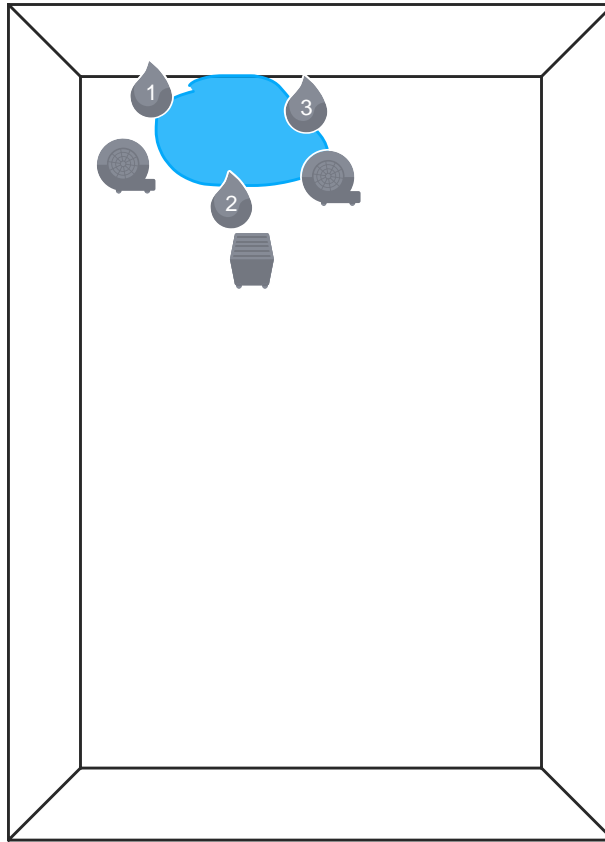


Point 1:


#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 4:24 PM	Klein Tools Pinless ET140	55.2%	102.2°F	

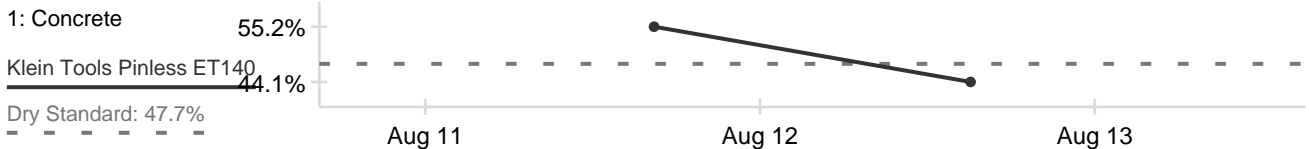





Dry

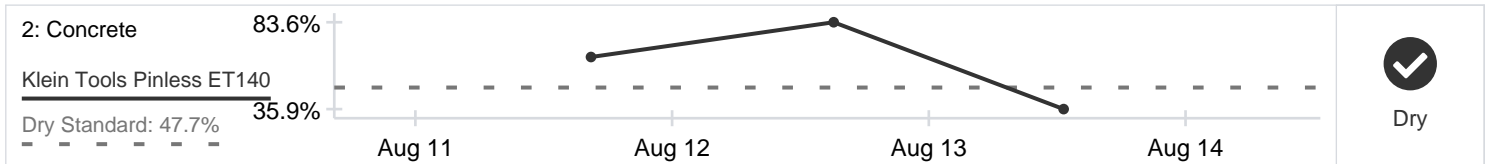
#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 3:05 PM	Klein Tools Pinless ET140	44.1%	80.8°F	

Point 2:



#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 4:25 PM	Klein Tools Pinless ET140	64.5%	97.2°F	
2	Aug 12, 3:06 PM	Klein Tools Pinless ET140	83.6%	75.6°F	
3	Aug 13, 12:36 PM	Klein Tools Pinless ET140	35.9%	66.9°F	


Point 3:

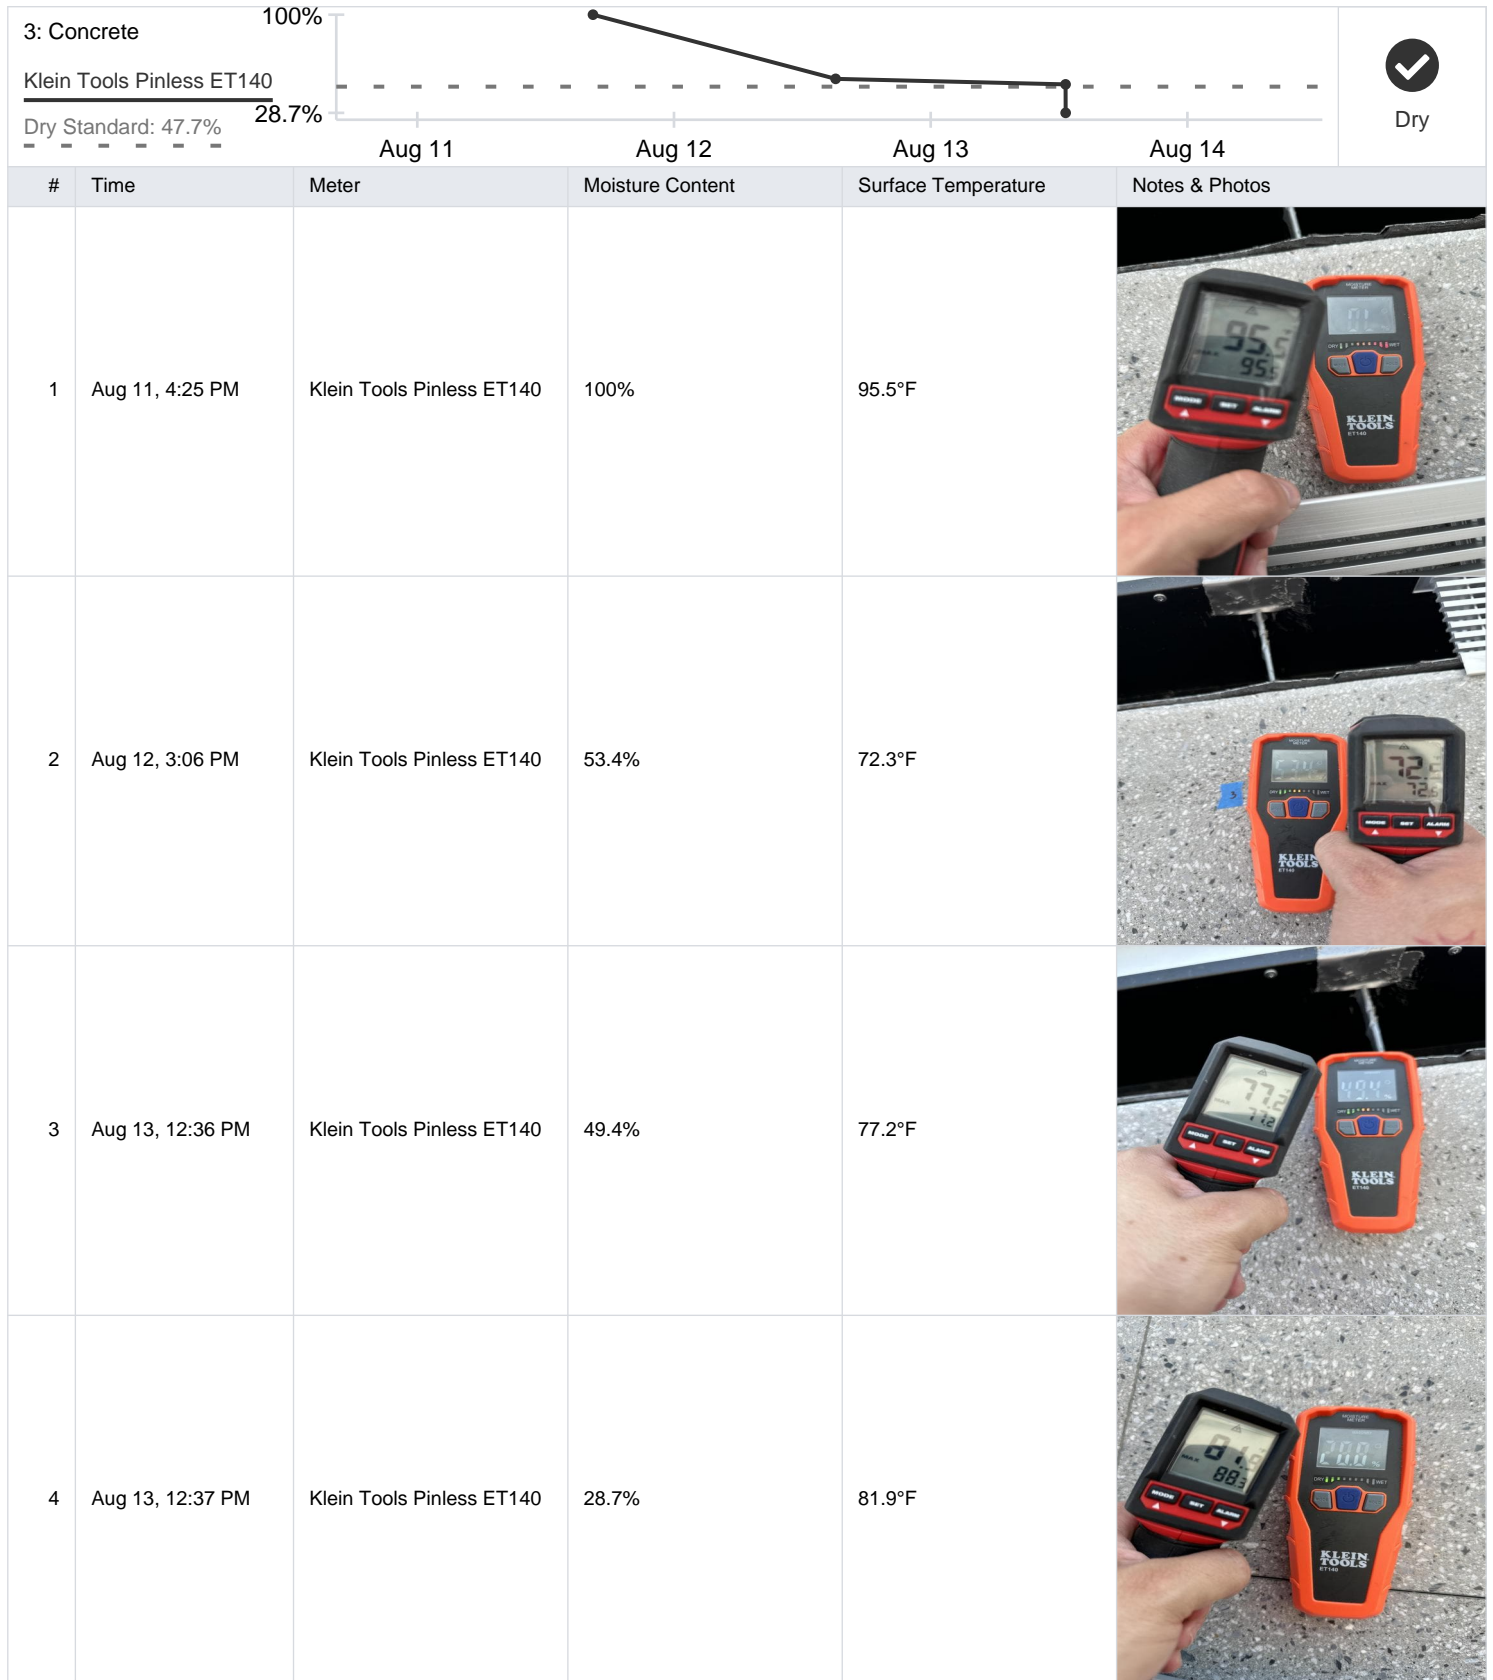

Equipment List: Staff Only 212

Dehumidifier: ALORAIR Storm LGR Extreme [STORMLGREXTREME] (2)

Placed Aug 11, 4:26 PM Removed Still on site Power 0.64 kW Energy usage 56.80 kWh Days on site 4 days

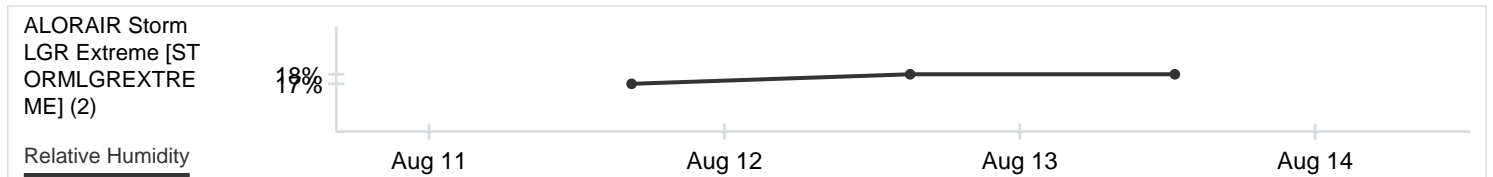


#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 4:27 PM	17%	82.3 gpp	118°F	4 gpp		
2	Aug 12, 3:05 PM	18%	57.9 gpp	104°F	11 gpp		
3	Aug 13, 12:35 PM	18%	51.3 gpp	100°F	14 gpp		

Air Movers: Staff Only 212


Name	Placed	Removed	Energy usage	Days on site
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (294)	Aug 11, 4:26 PM	Still on site	28.40 kWh	4 days
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (22)	Aug 11, 4:26 PM	Still on site	28.40 kWh	4 days

Drying Chamber: Study Room 233


Affected Area Readings

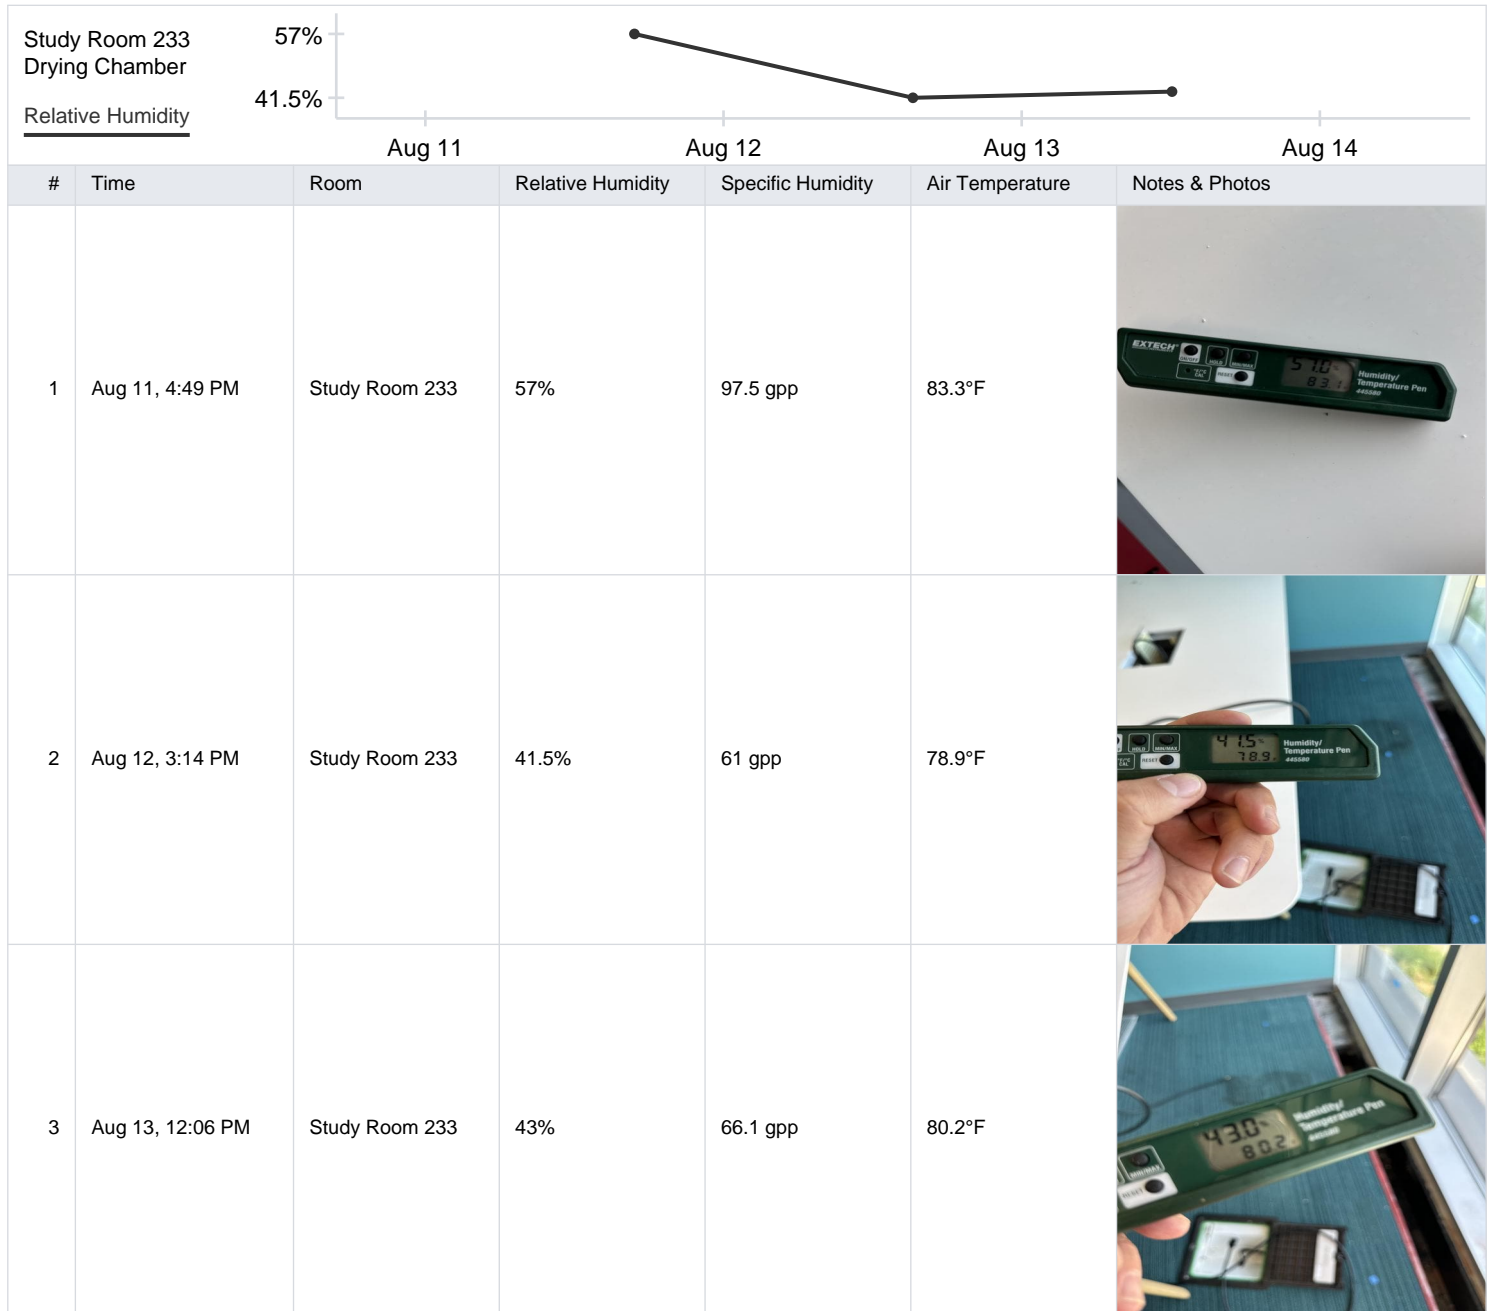


Affected Area: Study Room 233

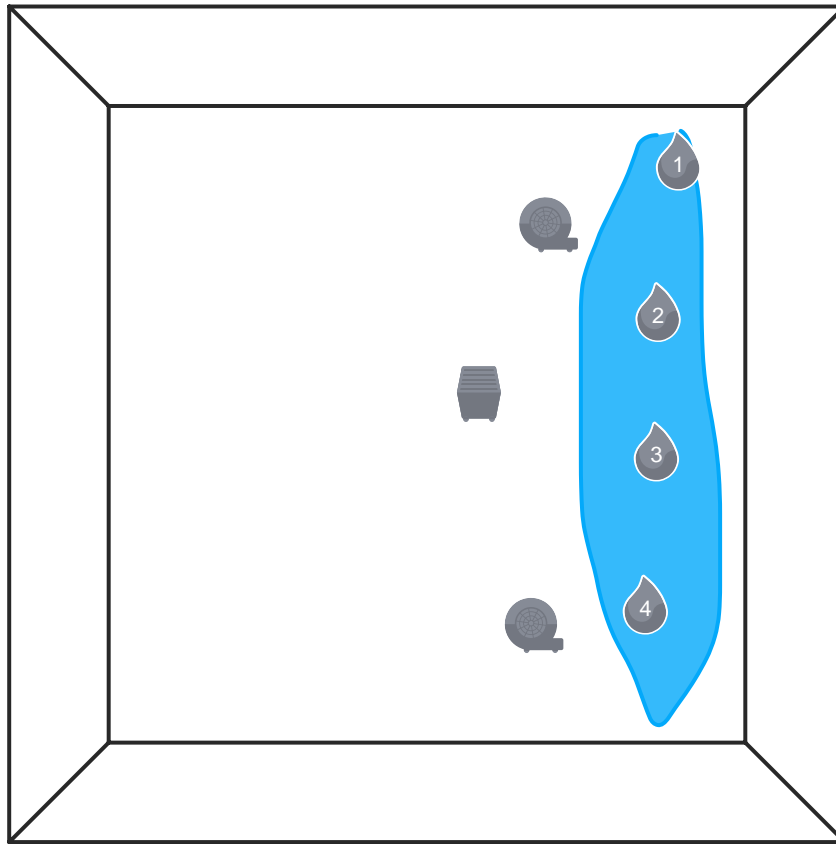


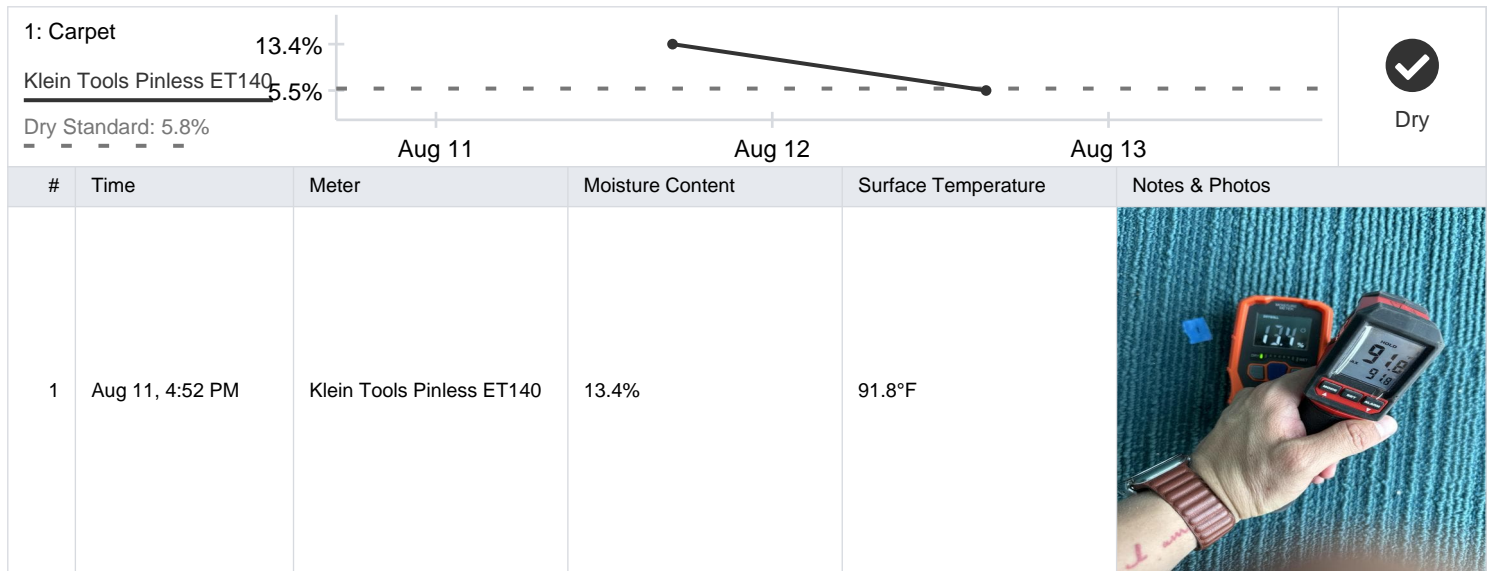


Point 1:




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 3:15 PM	Klein Tools Pinless ET140	5.5%	82.9°F	

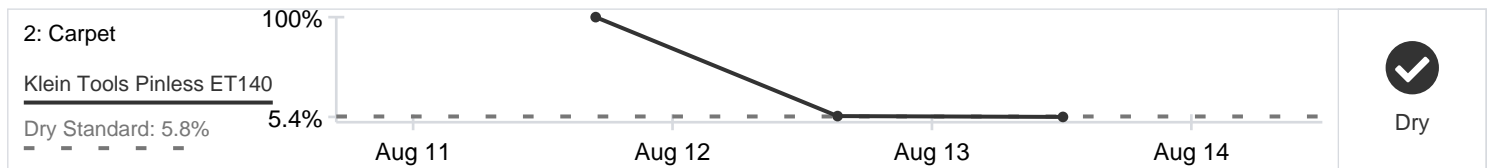Point 2:





#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
1	Aug 11, 4:53 PM	Klein Tools Pinless ET140	100%	45.9°F	
2	Aug 12, 3:16 PM	Klein Tools Pinless ET140	6.2%	82.8°F	
3	Aug 13, 12:07 PM	Klein Tools Pinless ET140	5.4%	83.3°F	

Point 3:

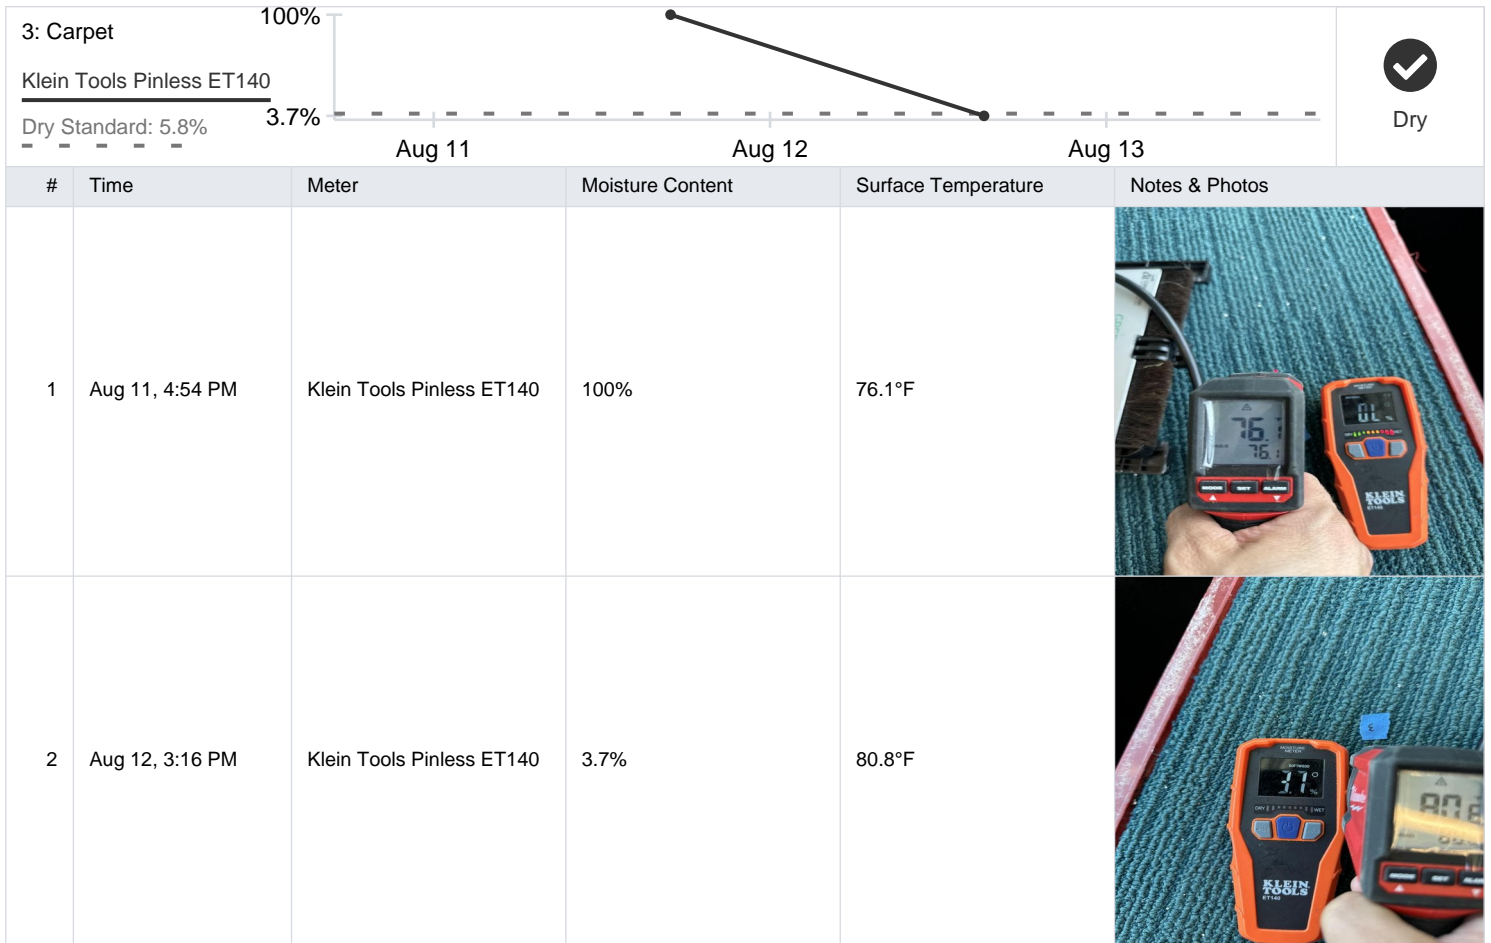

Point 4:

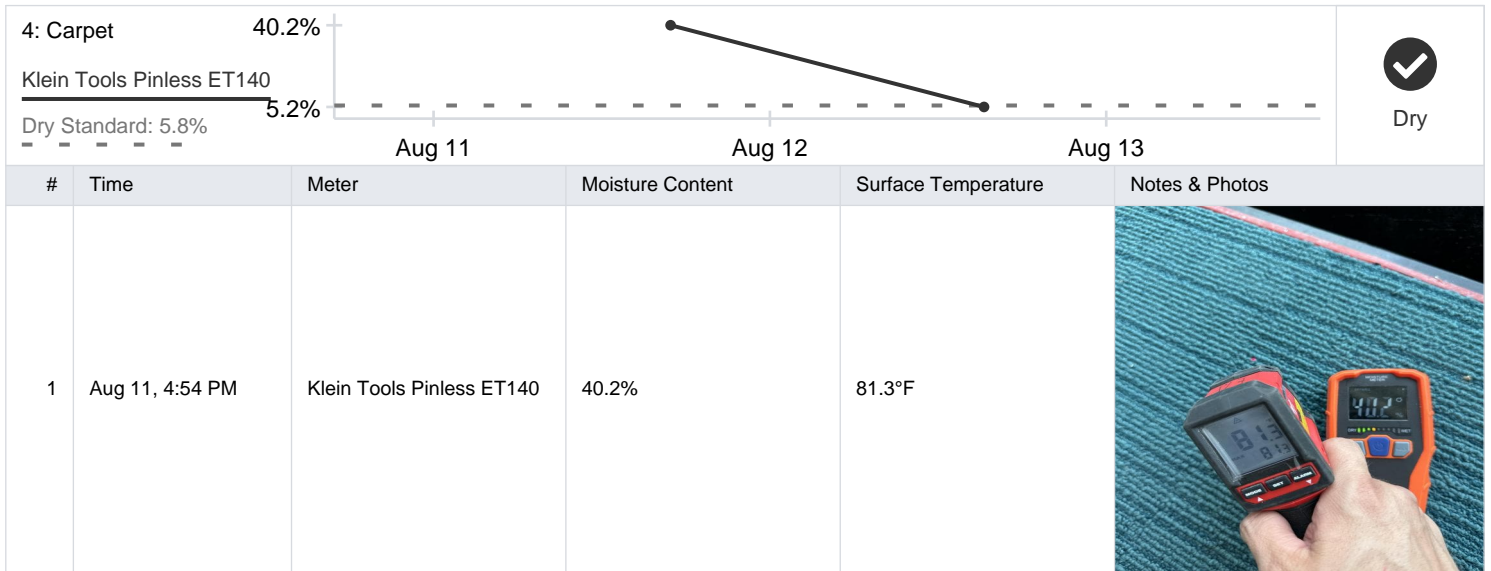




#	Time	Meter	Moisture Content	Surface Temperature	Notes & Photos
2	Aug 12, 3:16 PM	Klein Tools Pinless ET140	5.2%	92.7°F	


Equipment List: Study Room 233

Dehumidifier: ALORAIR Storm LGR Extreme [STORMLGREXTREME] (03)

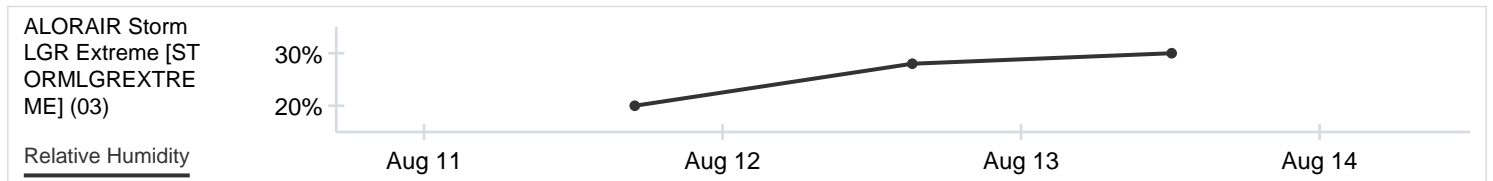Placed	Removed	Power	Energy usage	Days on site
Aug 11, 4:56 PM	Still on site	0.64 kW	56.48 kWh	4 days



#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
1	Aug 11, 4:56 PM	20%	66.4 gpp	105°F	31 gpp		
2	Aug 12, 3:15 PM	28%	53.4 gpp	87°F	8 gpp		

#	Time	Relative Humidity	Specific Humidity	Air Temperature	Grain Depression	Hours Running	Notes & Photos
3	Aug 13, 12:06 PM	30%	61 gpp	89°F	5 gpp		

Air Movers: Study Room 233

Name	Placed	Removed	Energy usage	Days on site
Xpower XPOWER PL-700A Professional Low Profile Air Mover [PL700A] (25)	Aug 11, 4:55 PM	Still on site	28.24 kWh	4 days
Xpower XPOWER X-34AR Professional Sealed Motor Axial Fan [X34AR] (19)	Aug 11, 4:55 PM	Still on site	16.14 kWh	4 days

Unaffected Areas

Unaffected Area: 1st floor common area

No readings

Equipment List: 1st floor common area

None

Unaffected Area: Vestibule

No readings

Equipment List: Vestibule

None